ENGINE Engine - Repair Instructions - X5 (N62TU V8)

ENGINE

Engine - Repair Instructions - X5 (N62TU V8)

00 ENGINE, GENERAL

00 DANGER OF POISONING IF OIL IS INGESTED/ABSORBED THROUGH THE SKIN

Danger of poisoning!

Ingesting oil or absorbing through the skin may cause poisoning!

Possible symptoms are:

- Headaches
- o Dizziness
- o Stomach aches
- Vomiting
- o Diarrhoea
- o Cramps/fits
- o Unconsciousness

Protective measures/rules of conduct:

- Pour oil only into appropriately marked containers
- Do not pour oil into drinking vessels (drinks bottles, glasses, cups or mugs)
- Observe country-specific safety regulations

First aid measures:

Do not induce vomiting.

If the person affected is still conscious, he/she must rinse out their mouth with water, drink plenty of water and consult a doctor immediately.

If the person affected is unconscious, do not administer anything by mouth, place the person in the recovery position and seek immediate medical attention.

00 RISK OF INJURY IF OIL COMES INTO CONTACT WITH EYES AND SKIN

Danger of injury!

Contact with eyes or skin may result in injury!

Possible symptoms are:

domingo, 3 de octubre de 2021 12:49:41 a. m.	Page 1	© 2011 Mitchell Repair Information Company, LLC.
--	--------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- Impaired sight
- Irritation of the eyes
- o Reddening of the skin
- Rough and cracked skin

Protective measures/rules of conduct:

- Wear protective goggles
- Wear oil-resistant protective gloves
- Observe country-specific safety regulations

First aid measures:

- Eye contact: Rinse eyes immediately with plenty of water for at least 15 minutes; if available, use an eyerinsing bottle. If irritation of the eyes persists, consult a doctor.
- Skin contact: Wash off with soap and water immediately. If irritation persists, consult a doctor.

NOTE: Do not use solvents/thinners.

00 SAFETY INSTRUCTIONS FOR HANDLING OIL

WARNING: Danger of poisoning if oil is ingested/absorbed through the skin! See <u>00</u>

<u>DANGER OF POISONING IF OIL IS INGESTED/ABSORBED THROUGH THE SKIN</u>.

Risk of injury if oil comes into contact with eyes and skin! See <u>00 RISK OF</u> INJURY IF OIL COMES INTO CONTACT WITH EYES AND SKIN.

Recycling:

Observe country-specific waste-disposal regulations.

Measures if oil is unintentionally released:

- Personal precautionary measures: Danger of slipping! Keep non-involved persons away from the work area. Wear personal protective clothing/equipment.
- Environmental protection measures: Prevent oil from draining into drain channels, sewerage systems, pits, cellars, water and the ground.
- Limiting spread: Use oil blocks to prevent the surface spread of oil.
- Cleaning procedure: Bind and dispose of escaped oil with nonflammable absorbents.

NOTE: Do not flush oil away with water or aqueous cleaning agents.

00 00 610 ENGINE OIL SERVICE (N62/N62TU)

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Recycling:

Catch and dispose of used oil.


Observe country-specific waste-disposal regulations.

NOTE: For purposes of clarity, this work step is shown without the reinforcement plate.

Open oil drain plug (1) in oil sump.

Remove oil drain plug (2) on oil filter cap (3).

Release oil filter cover (3).

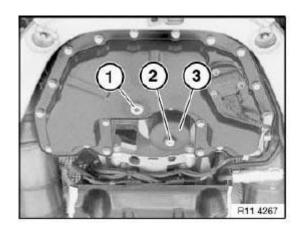

<u>Fig. 1: Identifying Oil Drain Plug, Oil Filter Cap And Oil Filter Cover</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace and lubricate sealing rings (1 and 2).

Replace oil filter element (3) and slide into oil filter cover.

Oil filter element (3) must snap audibly into place.

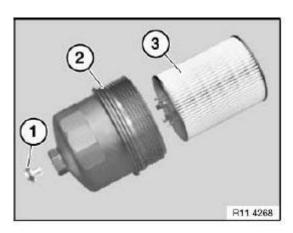


Fig. 2: Identifying Sealing Rings And Oil Filter Element Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace sealing ring.

Install oil drain plug (1) and tighten down.

Tightening torque 11 13 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

Insert and tighten down oil filter cover (3).

Tightening torque 11 42 2AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

Insert oil drain plug (2) on oil filter cap (3) and tighten down.

Tightening torque: 10 Nm.

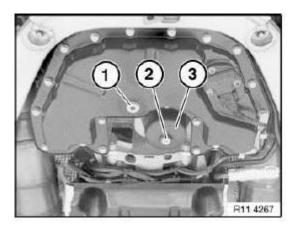


Fig. 3: Identifying Oil Drain Plug, Oil Filter Cap And Oil Filter Cover Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Pour in engine oil.

Start engine and run at idle until oil indicator lamp goes out.

Switch off engine, wait approx. 5 minutes and then check engine oil level.

Top up engine oil if necessary.

11 00 045 CHECKING ABSOLUTE COMPRESSION OF ALL CYLINDERS

Diagnosis and Information System (DIS)



W05 95 001

Fig. 4: Identifying Diagnosis And Information System (DIS) Courtesy of BMW OF NORTH AMERICA, INC.

Necessary preliminary tasks:

- Remove acoustic cover. Unfasten screws. Raise acoustic cover and remove towards front.
- Remove right ignition coil cover.
- Connect DIS Tester.

Test:

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- o Call up Diagnosis
- Select car > right arrow key
- Function selection
 - Complete vehicle
 - Drive
 - Engine management
 - Valve gear
 - Valvetronic variable valve gear
 - Mechanical components/function
- o Test schedule > right arrow key
 - Compression test > right arrow key
- o Follow DIS Tester instructions.

NOTE: Clear fault memory

11 00 050 REMOVING AND INSTALLING ENGINE (N62/N62TU)

Special tools required:

• 11 0 000

Necessary preliminary tasks:

- Disconnect negative battery lead. See <u>12 00... INSTRUCTIONS FOR DISCONNECTING AND</u> CONNECTING BATTERY.
- Both exhaust manifolds remain on engine during removal.

Observe specified tightening torque and safety precautions in all work steps.

REFERENCE CHART


Work step	Note
Lift engine hood into assembly position Secure engine in installation position with special tool Remove gearbox	After removing transmission, secure engine against tilting.
Remove intake filter housing . See <u>13 71 000 REMOVING AND INSTALLING/REPLACING INTAKE FILTER HOUSING (N52K)</u> .	
Remove radiator	
Remove radiator lines.	
Remove expansion tank.	
Remove intake air manifold . See 11 61 050 REMOVING AND INSTALLING INTAKE AIR MANIFOLD (N62).	

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Remove heater radiator line.	
Unlock engine wiring harness section on control unit and detach.	Wiring harness remains on engine.
Unlock spark plug wiring harness section on control unit and detach. Wiring harness remains on engine.	
Release negative lead on spring strut dome.	
Release battery positive lead at positive terminal.	
Detach vacuum line and vacuum hose from vacuum pump.	
Unlock line on tank venting valve and disconnect.	
Remove both oxygen monitor sensors.	
Remove both oxygen control sensors	
Release negative lead on engine support arm.	
Remove vibration damper and tensioning pulley from A/C compressor drive belt	
Release power steering pump on bracket, hydraulic lines remain connected.	Do not remove power steering pump, secure against falling down.
Release A/C compressor on bracket, lines remain connected, do not evacuate A/C system.	Do not remove A/C compressor, secure against falling down.
Release ABS control unit on bracket, lines remain connected.	Do not remove ABS control unit, secure against falling down.
Remove lower universal joint of steering spindle	

Vehicles with Dynamic Drive only:

Unlock and detach hydraulic line (1).

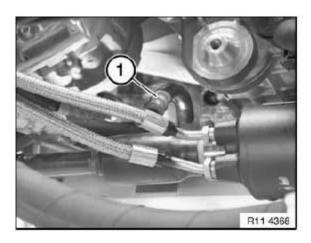

<u>Fig. 5: Identifying Hydraulic Line</u> Courtesy of BMW OF NORTH AMERICA, INC.

Suspend engine off-center from special tool $11\ 0\ 000$.

domingo, 3 de octubre de 2021 12:49:29 a. m.	Page 7	© 2011 Mitchell Repair Information Company, LLC.
--	--------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Release engine mounts on left and right from above.



Fig. 6: Identifying Special Tool (11 0 000)
Courtesy of BMW OF NORTH AMERICA, INC.

Protect assembly compartment and hydraulic lines against damage.

Installation:

Observe specified tightening torque and safety precautions in all work steps.

11 00 670 SECURING ENGINE IN INSTALLATION POSITION (N62)

Special tools required:

- 00 0 200
- 00 0 202
- 00 0 204
- 00 0 208
- 00 0 451
- 00 0 452
- 11 0 000

WARNING: Danger of injury!

Owing to the new guidelines on pedestrian protection, side panels are no longer suitable for supporting the engine.

Observe following instructions relating to special tool:

- 1. Prior to each use, check the special tools for defects, modifications and operational reliability.
- 2. Damaged/modified special tools must not be used!
- 3. No changes or modifications may be made to the special tools!

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

4. Keep special tools dry, clean and free of grease.

Necessary preliminary tasks:

- Secure engine bonnet/hood in service position . See <u>51 00 ... SERVICE POSITION OF ENGINE</u> HOOD/BONNET .
- Remove both intake ducts
- Remove assembly compartment partition wall . See <u>51 71 ... REMOVING AND INSTALLING/REPLACING ASSEMBLY COMPARTMENT PARTITION WALL</u> .
- Remove tension strut on spring strut dome on right . See <u>51 71 372 REMOVING AND INSTALLING/REPLACING BOTH TENSION STRUTS ON SPRING STRUT DOMES</u> .

Assemble transverse member 00 0 200 with special tools 00 0 202, 00 0 204, 00 0 208.

Modification:

Replace profile strips with special tools 00 0 451.

Replace front supports with special tools 00 0 452.

NOTE: Ensure that the longer feet of special tools 00 0 452 point to the middle of the vehicle.


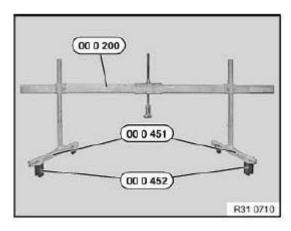


Fig. 7: Identifying Special Tool (00 0 451),(00 0 452) And (00 0 200) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The support points on the left side are shown.

Position transverse member 00 0 200 with a 2nd person helping on designated areas (1, 2).

NOTE: Make sure that the front supports 00 0 452 are correctly positioned on the support carriers.

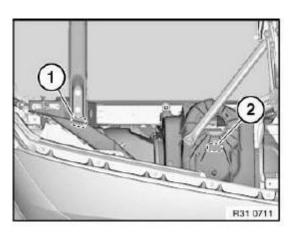

<u>Fig. 8: Identifying Transverse Member With Designated Areas</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Avoid a change of engine position in the transversal or longitudinal direction. Always make sure there is sufficient clearance between the engine (or its attachment parts) and the body.

Secure special tool 11 0 000 to spindle 00 0 202.

Attach suitable chains to special tool 11 0 000 and suspend from both engine suspension eyelets.

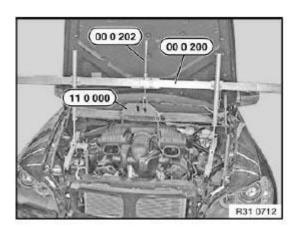


Fig. 9: Identifying Special Tool (11 0 000), (00 0 200) And (11 0 000) Courtesy of BMW OF NORTH AMERICA, INC.

WARNING: Danger of injury!

Tighten down all adjusting screws and nuts on transverse member 00 0 20 0.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

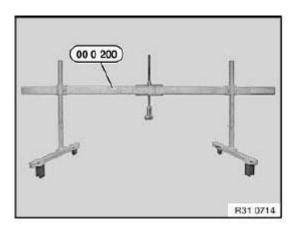


Fig. 10: Identifying Special Tool (00 0 200) Courtesy of BMW OF NORTH AMERICA, INC.

Unscrew nuts (1).

Raise engine approx. 10 mm with transverse member.

Installation:

Replace self-locking nut.

Tightening torque 22 11 2AZ . See **ENGINE AND GEARBOX SUSPENSION - TIGHTENING TORQUES** .

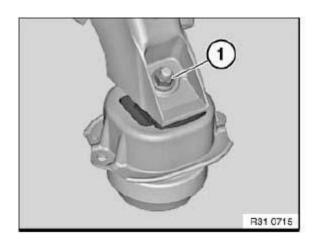



Fig. 11: Identifying Self-Locking Nut
Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE IDENTIFICATION

Drive in engine numbers at marked surface with impact tool.


M47/M47TU/M47T2

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

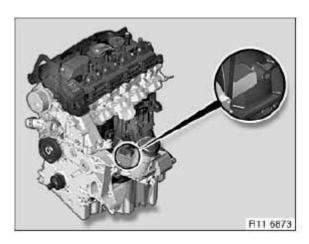

<u>Fig. 12: Identifying Engine Identification Numbers (M47/M47TU/M47T2)</u> Courtesy of BMW OF NORTH AMERICA, INC.

M57/M57TU/M57T2

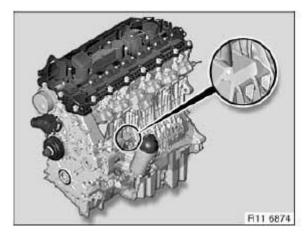

<u>Fig. 13: Identifying Engine Identification Numbers (M57/M57TU/M57T2)</u> Courtesy of BMW OF NORTH AMERICA, INC.


M67/M67TU

ENGINE Engine - Repair Instructions - X5 (N62TU V8)



Fig. 14: Identifying Engine Identification Numbers (M67/M67TU) Courtesy of BMW OF NORTH AMERICA, INC.

N47

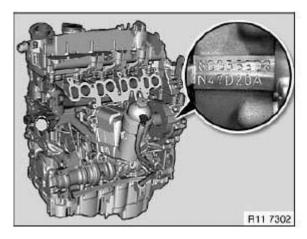

<u>Fig. 15: Identifying Engine Identification Numbers (N47)</u> Courtesy of BMW OF NORTH AMERICA, INC.

M52/M52TU

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

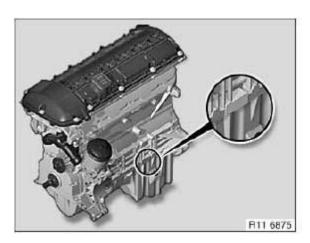


Fig. 16: Identifying Engine Identification Numbers (M52/M52TU) Courtesy of BMW OF NORTH AMERICA, INC.

M54

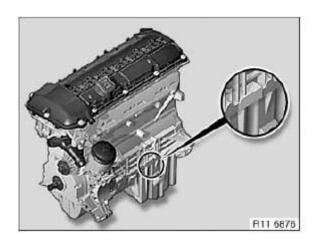


Fig. 17: Identifying Engine Identification Numbers (M54) Courtesy of BMW OF NORTH AMERICA, INC.

M56

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

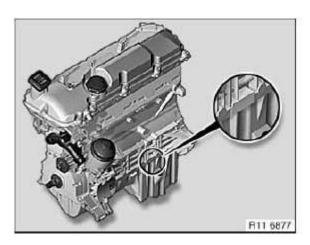


Fig. 18: Identifying Engine Identification Numbers (M56) Courtesy of BMW OF NORTH AMERICA, INC.

N40/N45


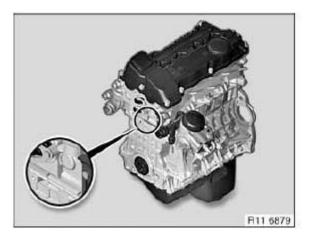


Fig. 19: Identifying Engine Identification Numbers (N40/N45) Courtesy of BMW OF NORTH AMERICA, INC.


N42/N46/N46T

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

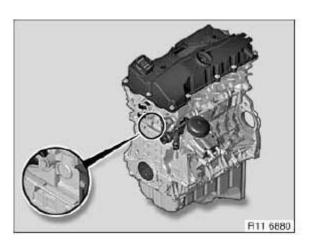

<u>Fig. 20: Identifying Engine Identification Numbers (N42/N46/N46T)</u> Courtesy of BMW OF NORTH AMERICA, INC.

N51/N52/N52K/N53/N54

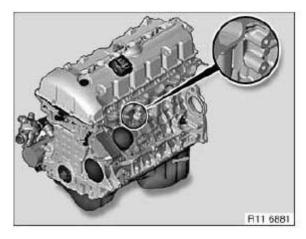

<u>Fig. 21: Identifying Engine Identification Numbers (N51/N52/N52K/N53/N54)</u> Courtesy of BMW OF NORTH AMERICA, INC.

N62

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


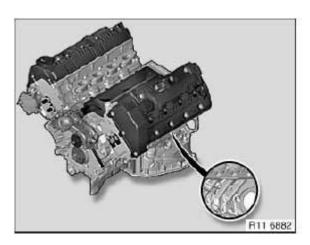


Fig. 22: Identifying Engine Identification Numbers (N62) Courtesy of BMW OF NORTH AMERICA, INC.

N73

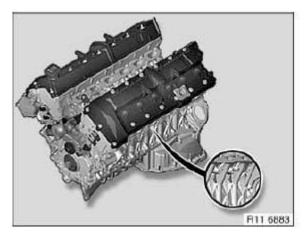

<u>Fig. 23: Identifying Engine Identification Numbers (N73)</u> Courtesy of BMW OF NORTH AMERICA, INC.

S54


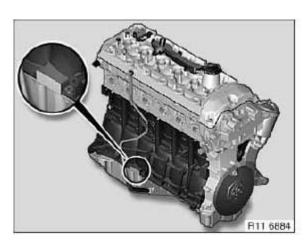


Fig. 24: Identifying Engine Identification Numbers (S54) Courtesy of BMW OF NORTH AMERICA, INC.

S85

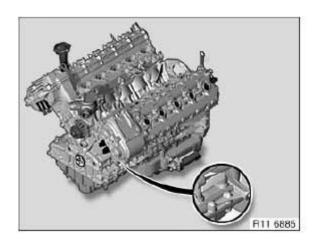

<u>Fig. 25: Identifying Engine Identification Numbers (S85)</u> Courtesy of BMW OF NORTH AMERICA, INC.


W10/W11

ENGINE Engine - Repair Instructions - X5 (N62TU V8)



<u>Fig. 26: Identifying Engine Identification Numbers (W10/W11)</u> Courtesy of BMW OF NORTH AMERICA, INC.

W17

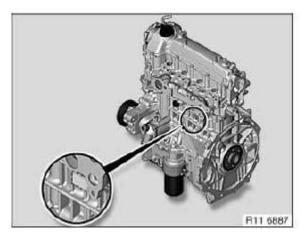

<u>Fig. 27: Identifying Engine Identification Numbers (W17)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Assemble engine.

12 CYLINDER HEAD WITH COVER

11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Remove design cover, if equipped.
- Unfasten acoustic cover screws. Raise acoustic cover and remove towards front.

domingo, 3 de octubre de 2021 12:49:29 a. m.	Page 19	© 2011 Mitchell Repair Information Company, LLC.
--	---------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

• Remove ignition coil cover

NOTE: For purposes of clarity, the following work steps are shown on the engine after it has been removed.

Unclip cable holder (1) with cables.

Pull tank venting valve (2) off holder.

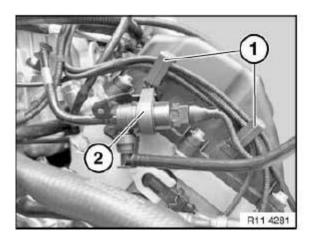


Fig. 28: Identifying Cable Holder And Cables Tank Venting Valve Courtesy of BMW OF NORTH AMERICA, INC.

Unlock plug (1) and remove.

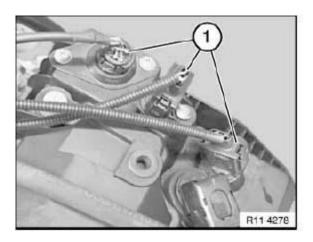


Fig. 29: Identifying Plug Courtesy of BMW OF NORTH AMERICA, INC.

Release screws and remove sealing element (2).


Remove sensors (3 and 4).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Installation:

Replace sealing element (2).

Replace sealing rings on sensors (3 and 4).

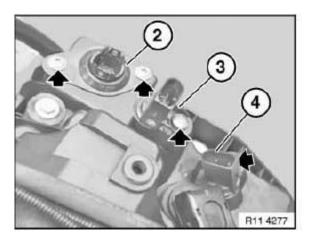

<u>Fig. 30: Locating Sealing Rings, Sensors And Sealing Element</u> Courtesy of BMW OF NORTH AMERICA, INC.

Removing ignition coils.

Release both grounding cables.

Unlock and detach vent hose.

Unclip cable duct (1) and remove cable from holder.

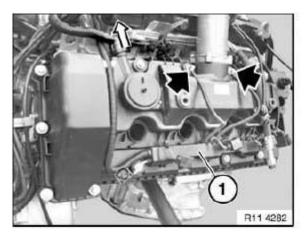


Fig. 31: Locating Cable Duct Courtesy of BMW OF NORTH AMERICA, INC.

Remove servomotor for left eccentric shaft . See 11 37 022 REMOVING AND INSTALLING/REPLACING

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU).

Unfasten screws.

Remove spacer (3) upwards.

Installation:

Replace sealing ring.

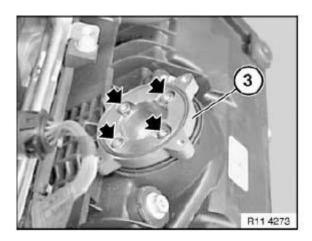


<u>Fig. 32: Locating Sealing Ring</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove injection pipe

Release screw connections (1, 2, 3 and 4).

If necessary, pull out oil dipstick.

Remove cylinder head cover.

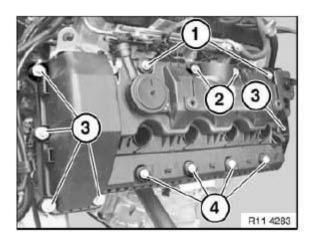

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fig. 33: Identifying Screw Connections Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Note installation direction of sealing ring (1).

Groove in sealing ring (1) points outwards.



Fig. 34: Identifying Sealing Ring Courtesy of BMW OF NORTH AMERICA, INC.

Replace sealing ring (1) and press into cylinder head cover until flush.

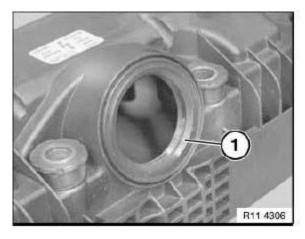


Fig. 35: Identifying Sealing Ring Into Cylinder Head Cover Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace seal (1).

Align gasket (1) loosely in cover groove. Starting at corner radii, secure gasket (1) in cover groove and press

into groove so that it is free of tension.


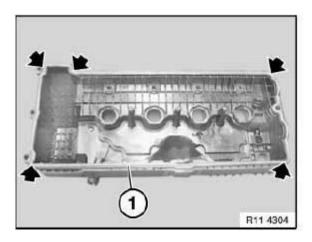


Fig. 36: Locating Seal Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace spark plug domes.

Coat rubber seals on spark plug dome (1) with anti-friction rubber coating.

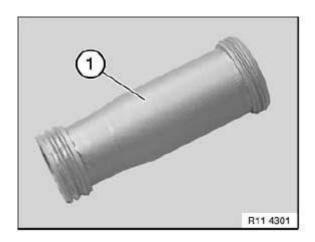


<u>Fig. 37: Identifying Spark Plug Domes</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Install spark plug domes in cylinder head.

When fitting cylinder head cover:

Align spark plug domes to cylinder head cover.

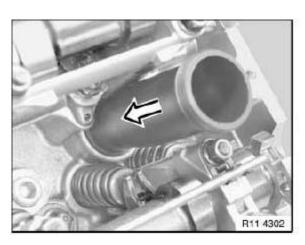


<u>Fig. 38: Installing Spark Plug Domes In Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean seal residue from sealing surfaces.

Coat contact surfaces of joint with Drei Bond 1209.

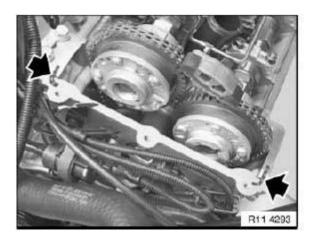


<u>Fig. 39: Locating Seal Residue From Sealing Surfaces</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean seal residue from sealing surfaces.

Apply a thin, uniform bead of Drei Bond 1209 sealing agent to transition area of half-moon sections.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

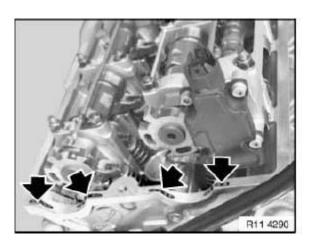

<u>Fig. 40: Locating Transition Area Of Half-Moon Sections</u> Courtesy of BMW OF NORTH AMERICA, INC.

Replace sealing elements (1).

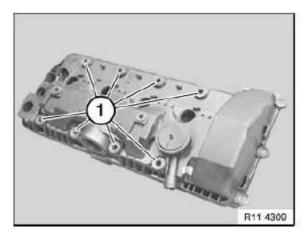


Fig. 41: Identifying Sealing Elements
Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Make sure gasket is correctly seated at sides and on rear side of cylinder head.



Fig. 42: Locating Gasket Correctly Seated On Rear Side Of Cylinder Head Courtesy of BMW OF NORTH AMERICA, INC.


Installation:

Screw connections (1, 2, 3 and 4) of cylinder head cover are different.

Replace screw connections (3).

Insert screw connections (1, 2 and 3) without pretension and align cover.

Tighten down screw connections (1, 2 and 3) in diagonal sequence from inside to outside.

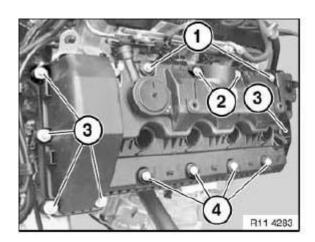

<u>Fig. 43: Identifying Screw Connections</u> Courtesy of BMW OF NORTH AMERICA, INC.

11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)

(cylinder bank 1 to 4)

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Remove design cover, if equipped.

Unfasten acoustic cover screws. Raise acoustic cover and remove towards front.

Remove electronics box cover.

Remove electronics box seal.

These work steps are described in **REPLACING CONTROL UNIT**.

Remove ignition coil cover.

Remove intake hose with air-mass flow sensor.

NOTE: For purposes of clarity, the following work steps are shown on the engine after it has been removed.

Unlock plug (1) and remove.

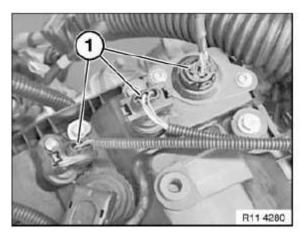



Fig. 44: Identifying Plug Courtesy of BMW OF NORTH AMERICA, INC.

Release screws and remove sealing element (2). Remove sensors (3 and 4).

Installation:

Replace sealing element (2).

Replace sealing rings on sensors (3 and 4).

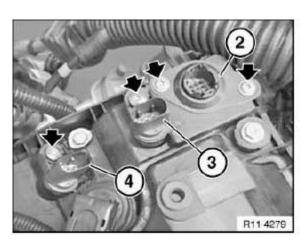

<u>Fig. 45: Locating Sealing Element And Sensor</u> Courtesy of BMW OF NORTH AMERICA, INC.

Removing ignition coils.

Release both grounding cables.

Unlock and detach vent hose.

Unclip cable duct (1) and remove cable from holder.

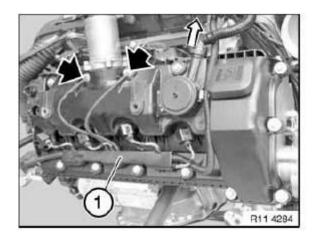



Fig. 46: Removing Cable From Holder Courtesy of BMW OF NORTH AMERICA, INC.

Remove servomotor for right eccentric shaft . See <u>11 37 024 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.

Unfasten screws.

Remove spacer (3) upwards.

Replace seal.

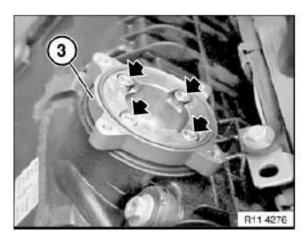

<u>Fig. 47: Locating Spacer</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove injection pipe.

Release screw connections (1, 2, 3 and 4).

Remove cylinder-head cover.

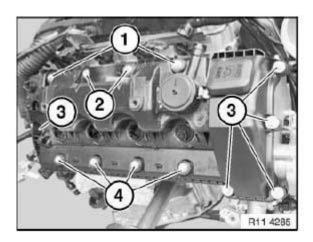


Fig. 48: Identifying Cylinder-Head Cover Screw Connections Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Note installation direction of sealing ring (1).

Groove in sealing ring (1) points outwards.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

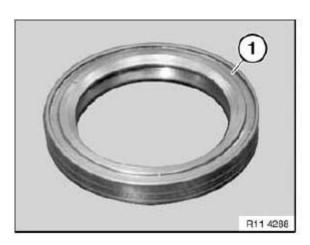


Fig. 49: Identifying Sealing Ring Courtesy of BMW OF NORTH AMERICA, INC.

Replace sealing ring (1) and press into cylinder head cover until flush.

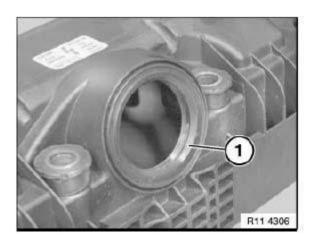


Fig. 50: Identifying Sealing Ring Into Cylinder Head Cover Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace seal (1).

Align gasket (1) loosely in cover groove. Starting at corner radii, secure gasket (1) in cover groove and press into groove so that it is free of tension.

Installation:

Make sure sliding rails are correctly seated when mounting on cylinder head.

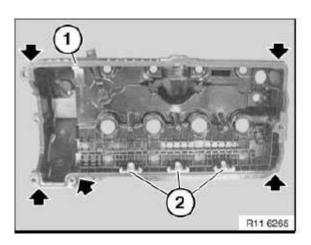


Fig. 51: Locating Cylinder Head Cover Gasket Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace spark plug domes.

Coat rubber seals on spark plug dome (1) with anti-friction rubber coating.

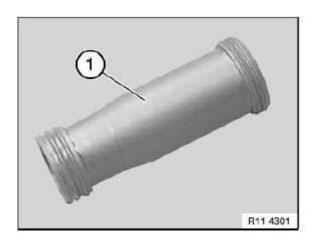



Fig. 52: Identifying Spark Plug Domes
Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Install spark plug domes in cylinder head.

When fitting cylinder head cover:

Align spark plug domes to cylinder head cover.

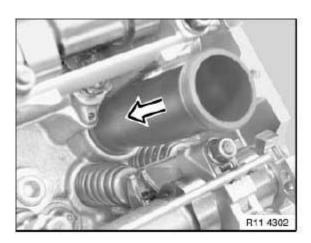


<u>Fig. 53: Installing Spark Plug Domes In Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean seal residue from sealing surfaces.

Coat contact surfaces of joint with Drei Bond 1209.

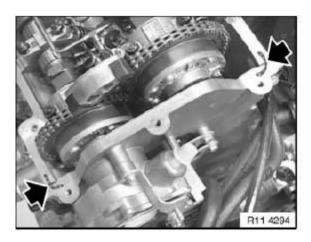


<u>Fig. 54: Locating Seal Residue From Sealing Surfaces</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:


Clean seal residue from sealing surfaces.

Apply a thin, uniform bead of Drei Bond 1209 sealing agent to transition area of half-moon sections.

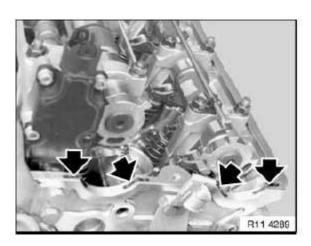

<u>Fig. 55: Locating Sealing Agent To Transition Area Of Half-Moon Sections</u> Courtesy of BMW OF NORTH AMERICA, INC.

Replace sealing elements (1).

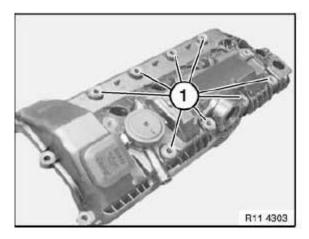

<u>Fig. 56: Identifying Sealing Elements</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Make sure gasket is correctly seated at sides and on rear side of cylinder head.



<u>Fig. 57: Locating Correctly Seated On Rear Side Of Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:


Screw connections (1, 2, 3 and 4) of cylinder head cover are **different**.

Replace screw connections (3).

Move cylinder head cover with gasket into assembly position.

Secure cylinder head cover, starting with screw connection (4) from front.

Tighten down screw connections (1, 2 and 3) in diagonal sequence from inside to outside.

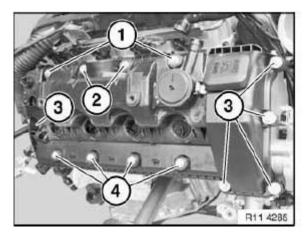

<u>Fig. 58: Identifying Cylinder-Head Cover Screw Connections</u> Courtesy of BMW OF NORTH AMERICA, INC.

11 12 105 REMOVING AND INSTALLING LEFT CYLINDER HEAD (N62 FROM 9/03 AND N62TU)

(cylinder bank 5 to 8)

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

NOTE: To remove the exhaust manifolds, the engine must be secured in the

installation position with the special tool and then the front axle bracket

lowered.

Remove left exhaust manifold.

After removing exhaust manifolds:

Reinstall front axle bracket provisionally and remove special tool for securing engine in installation position.

Open drain plug for coolant on left side of engine block.

Drain off coolant and dispose of correctly.

Installation:

Replace sealing ring.

Tightening torque of drain plug 11 11 5AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

Top up coolant. Vent cooling system and check for leaks. See <u>17 00 039 VENTING COOLING SYSTEM AND CHECKING FOR WATER LEAKS (N52K)</u>.

Remove ignition coils on cylinder bank 5 to 8.

Remove servomotor for left eccentric shaft. See <u>11 37 022 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.

Remove intake air manifold. See <u>11 61 050 REMOVING AND INSTALLING INTAKE AIR MANIFOLD</u> (N62).

Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.

Remove left timing case cover . See <u>11 14 080 REMOVING AND INSTALLING TOP LEFT TIMING</u> CASE COVER (N62/N62TU).

Disconnect plug connections and lay engine wiring harness to one side.

Remove spark plugs on cylinder bank 5 to 8.

Remove vent hose on cylinder head.

NOTE: Illustration with engine removed.

Detach hose (1) on check valve (2).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

E65 only:

Release screws (3).

Remove tube (4) with check valve (2).

NOTE: Do not remove guide tube (5) for oil dipstick.

Installation:

Replace sealing ring on tube (4) and coat with antiseize agent.

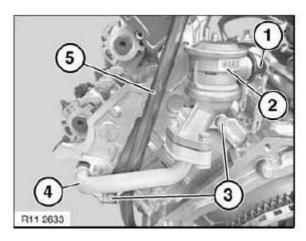


Fig. 59: Identifying Check Valve, Tube And Hose Courtesy of BMW OF NORTH AMERICA, INC.

Removal:


Removal of cylinder head is described separately from installation.

Remove inlet and exhaust adjustment unit on left side. See <u>11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).

NOTE: Illustration with engine removed.

Remove eccentric shaft sensor (2).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

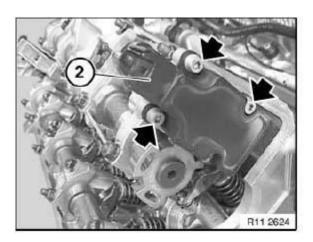

<u>Fig. 60: Locating Eccentric Shaft Sensor</u> Courtesy of BMW OF NORTH AMERICA, INC.

Detach guide rail from cylinder head.

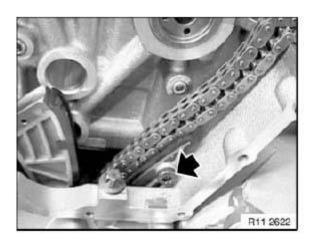


Fig. 61: Locating Guide Rail From Cylinder Head Courtesy of BMW OF NORTH AMERICA, INC.

Release screws between cylinder head and timing case cover.

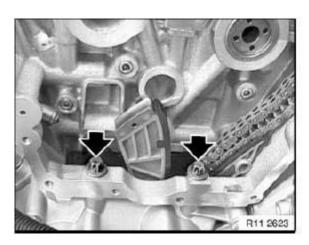


Fig. 62: Locating Cylinder Head Timing Case Cover And Screw Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: At narrow points, use a socket with 3/8" drive and a short extension.

Release cylinder-head bolts in sequence 10... 1.

Lift off cylinder head.

Lift off cylinder head gasket.

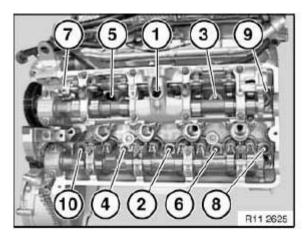


Fig. 63: Identifying Cylinder-Head Bolts In Sequence Courtesy of BMW OF NORTH AMERICA, INC.

Installation:


Installation of cylinder head is described separately from removal.

Clean sealing faces of cylinder head and crankcase; if necessary, remove gasket debris with wooden scraper. Make sure no gasket debris drops into the oil and coolant ducts.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Threaded bores in engine block must be free of dirt and oil (risk of cracking).


Coat joint between engine block and timing case cover with Drei Bond 1209.

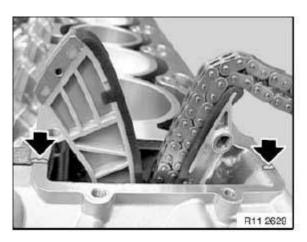

<u>Fig. 64: Locating Coat Joint Between Engine Block And Timing Case Cover Courtesy of BMW OF NORTH AMERICA, INC.</u>

Check dowel sleeves (1) for damage and correct installation position.

Fit new cylinder-head seal.

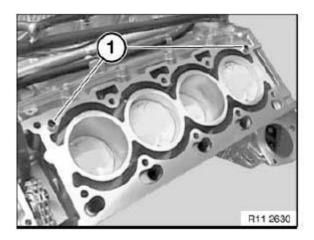

<u>Fig. 65: Identifying Dowel Sleeves</u> Courtesy of BMW OF NORTH AMERICA, INC.

Put the cylinder head on.


NOTE: Do not wash off bolt coating. Insert new cylinder head bolts and initially tighten so that they are free of play.

At narrow points, use a socket with 3/8" drive and a short extension.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Tighten down the cylinder-head bolts in order 1... 10.

Tightening torque 11 12 8AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

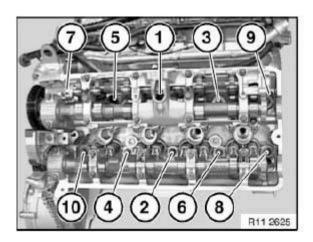

<u>Fig. 66: Identifying Cylinder-Head Bolts In Sequence</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert and tighten down screws between cylinder head and timing case cover.

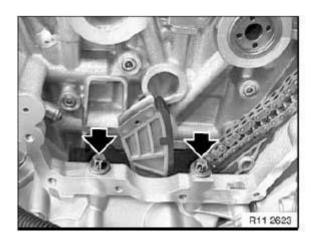


Fig. 67: Locating Cylinder Head Timing Case Cover And Screw Courtesy of BMW OF NORTH AMERICA, INC.


Replacement:

Insert screw plug (1).

Installation:


Failure to install the screw (1) will result in a malfunction in the VANOS control.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

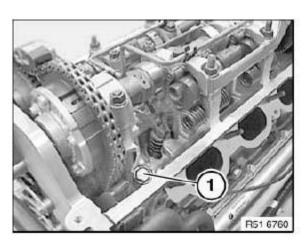

<u>Fig. 68: Identifying Screw Plug</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert and tighten down guide rail screw.

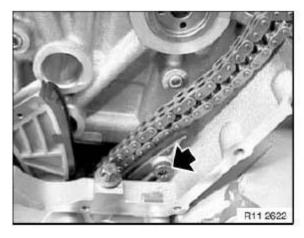

<u>Fig. 69: Locating Guide Rail From Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Illustration with engine removed.

Install eccentric shaft sensor (2).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

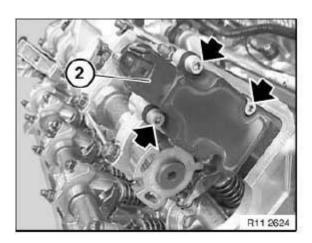


Fig. 70: Locating Eccentric Shaft Sensor
Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on left side. See 11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE (N62/N62TU).

Assemble engine.

11 12 106 REMOVING AND INSTALLING RIGHT CYLINDER HEAD (N62 FROM 9/03 AND N62TU)

(cylinder bank 1 to 4)

NOTE: To remove the exhaust manifolds, the engine must be secured in the

installation position with the special tool and then the front axle bracket

lowered.

Remove right exhaust manifold.

After removing exhaust manifolds:

Reinstall front axle bracket provisionally and remove special tool for securing engine in installation position.

Open drain plug for coolant on right side of engine block.

Drain off coolant and dispose of correctly.

Installation:

Replace sealing ring.

Tightening torque of drain plug 11 11 5AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

Top up coolant. Vent cooling system and check for leaks. See 17 00 039 VENTING COOLING SYSTEM

domingo, 3 de octubre de 2021 12:49:30 a. m.	Page 43	© 2011 Mitchell Repair Information Company, LLC.
--	---------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

AND CHECKING FOR WATER LEAKS (N52K).

Remove ignition coils on cylinder bank 1 to 4.

Remove servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU).

Remove intake air manifold. See <u>11 61 050 REMOVING AND INSTALLING INTAKE AIR MANIFOLD</u> (N62).

Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT</u> CYLINDER HEAD COVER (N62/N62TU).

Remove right timing case cover . See <u>11 14 085 REMOVING AND INSTALLING TOP RIGHT TIMING</u> CASE COVER (N62/N62TU).

Disconnect plug connections and lay engine wiring harness to one side.

Remove spark plugs on cylinder bank 1 to 4.

Remove vent hose on cylinder head.

NOTE: Illustration with engine removed.


Detach hose (1) on check valve (4).

Unfasten screws (2).

IMPORTANT: A spacer bushing is secured with screw (3) behind tube (5).

Release screw (3) and remove check valve (4), tube (5) and spacer bushing.

Unclip cables (6 and 7).

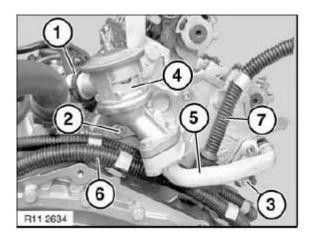

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fig. 71: Identifying Check Valve, Tube And Spacer Bushing Courtesy of BMW OF NORTH AMERICA, INC.

Installation:


Replace sealing ring on tube (5) and coat with antiseize agent.

Removal:

Removal of cylinder head is described separately from installation.

Remove inlet and exhaust adjustment unit on right side . See <u>11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u> (N62/N62TU).


Slacken off chain tensioning piston (1) by approx. one turn.

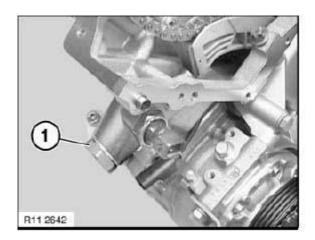

<u>Fig. 72: Identifying Slacken Off Chain Tensioning Piston</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Illustration with engine removed.

Remove eccentric shaft sensor (2).

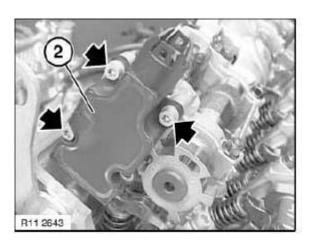

<u>Fig. 73: Locating Eccentric Shaft Sensor</u> Courtesy of BMW OF NORTH AMERICA, INC.

Detach guide rail from cylinder head.


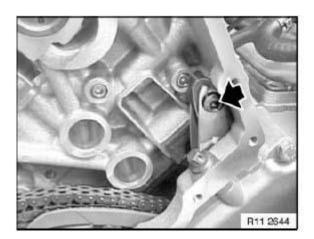


Fig. 74: Locating Guide Rail From Cylinder Head Courtesy of BMW OF NORTH AMERICA, INC.

Release screws between cylinder head and timing case cover.

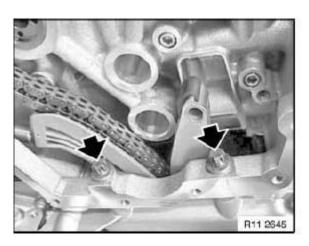

<u>Fig. 75: Locating Cylinder Head And Timing Case Cover With Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: At narrow points, use a socket with 3/8" drive and a short extension.

Release cylinder-head bolts in sequence 10... 1.

Lift off cylinder head.

Lift off cylinder head gasket.

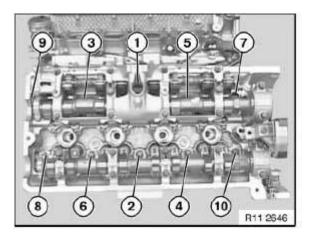


Fig. 76: Identifying Cylinder-Head Bolts In Sequence Courtesy of BMW OF NORTH AMERICA, INC.

Remove chain tensioning piston (1).

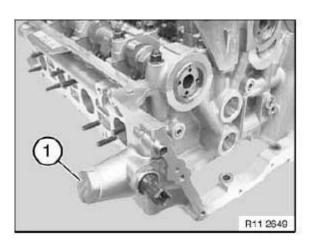


Fig. 77: Identifying Chain Tensioning Piston Courtesy of BMW OF NORTH AMERICA, INC.

Place chain tensioning piston (1) on a level surface and compress slowly and carefully.

Repeat this procedure twice.



Fig. 78: Placing Chain Tensioning Piston On Level Surface Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of cylinder head is described separately from removal.

Clean sealing faces of cylinder head and crankcase; if necessary, remove gasket debris with wooden scraper. Make sure no gasket debris drops into the oil and coolant ducts.

Threaded bores in engine block must be free of dirt and oil (risk of cracking).

Replace sealing ring.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Install chain tensioning piston (1) and initially tighten screw connection without play.


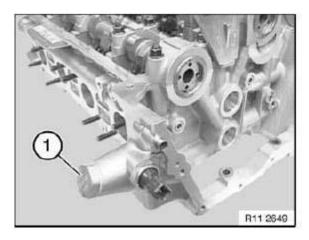


Fig. 79: Identifying Chain Tensioning Piston Courtesy of BMW OF NORTH AMERICA, INC.

Coat joint between engine block and timing case cover with Drei Bond 1209.

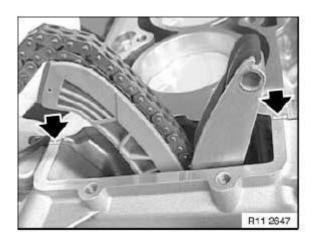

<u>Fig. 80: Identifying Coat Joint Between Engine Block And Timing Case Cover With Drei Bond (1209)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Check dowel sleeves (1) for damage and correct installation position.

Fit new cylinder-head seal.

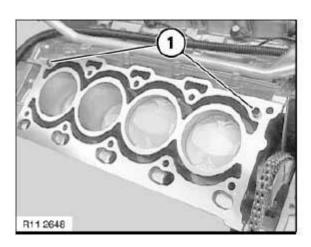


Fig. 81: Identifying Dowel Sleeves
Courtesy of BMW OF NORTH AMERICA, INC.


Put the cylinder head on.

NOTE: Do not wash off bolt coating. Insert new cylinder head bolts and initially tighten so that they are free of play.

At narrow points, use a socket with 3/8" drive and a short extension.

Tighten down the cylinder-head bolts in order 1... 10.

Tightening torque 11 12 8AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

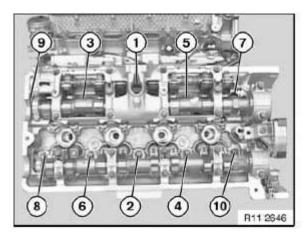

<u>Fig. 82: Identifying Cylinder-Head Bolts In Sequence</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert and tighten down screws between cylinder head and timing case cover.

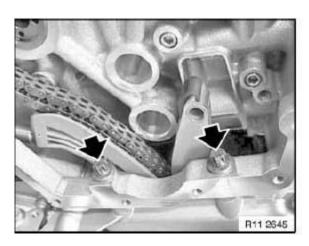


Fig. 83: Locating Cylinder Head And Timing Case Cover With Screw Courtesy of BMW OF NORTH AMERICA, INC.

Replacement:

Insert screw plug (1).

Installation:

Failure to install the screw (1) will result in a malfunction in the VANOS control.


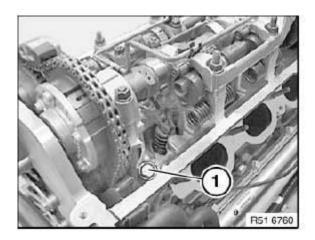


Fig. 84: Identifying Screw Plug Courtesy of BMW OF NORTH AMERICA, INC.


Insert and tighten down guide rail screw.

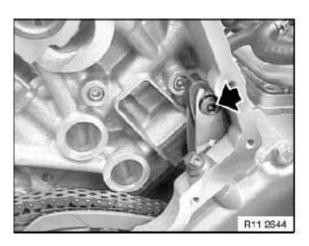

<u>Fig. 85: Locating Guide Rail From Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Illustration with engine removed.

Install eccentric shaft sensor (2).

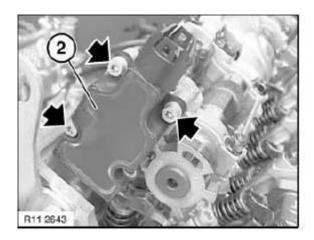

<u>Fig. 86: Locating Eccentric Shaft Sensor</u> Courtesy of BMW OF NORTH AMERICA, INC.

Tighten down chain tensioning piston (1).

Tightening torque 11 31 8AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

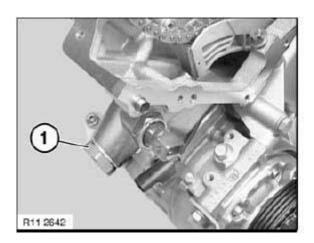


Fig. 87: Identifying Slacken Off Chain Tensioning Piston Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment units on right side. See <u>11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u> (N62/N62TU).

Assemble engine.

11 12 503 DISASSEMBLING AND ASSEMBLING CYLINDER HEAD (N62/N62TU)

Special tools required:

- 11 9 000
- 11 9 001
- 11 9 002
- 11 9 005
- 11 9 006
- 11 9 007
- 11 9 008
- 11 9 00911 9 011
- 11 9 015

Have special tool 11 9 000 ready for removing valve springs.

Secure cylinder head (1) on special tool 11 9 001.

NOTE: Secure cylinder head from above with screws contained in scope of delivery on special tool 11 9 001.

Turn special tool 11 9 001 through 180°.

domingo, 3 de octubre de 2021 12:49:30 a.m.	Page 53	© 2011 Mitchell Repair Information Company, LLC.
---	---------	--

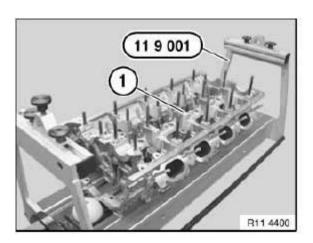


Fig. 88: Identifying Cylinder Head On Special Tool (11 9 001) Courtesy of BMW OF NORTH AMERICA, INC.

Align special tool 11 9 008 in conjunction with special tool 11 9 007 on special tool 11 9 006 to relevant combustion chamber.

Place special tool 11 9 006 on cylinder head.


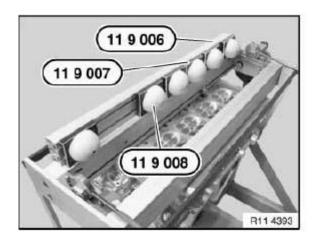


Fig. 89: Identifying Special Tool (11 9 008), (11 9 007) And (11 9 006) Courtesy of BMW OF NORTH AMERICA, INC.

Slide both special tools 11 9 005 in direction of arrow as far as they will go.

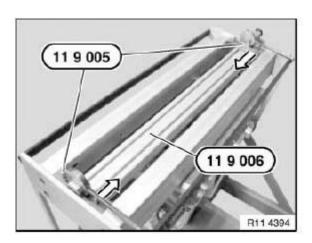

<u>Fig. 90: Sliding Special Tool (11 9 005) And (11 9 006)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Turn lever of special tools 11 9 005.

Turn special tool 11 9 001 through 180°.

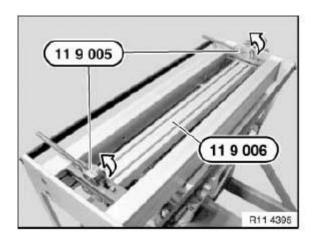


Fig. 91: Turning Special Tool (11 9 005) And (11 9 006) Courtesy of BMW OF NORTH AMERICA, INC.

Assemble clamping device with

- o special tool 11 9 002
- o special tool 11 9 009
- o special tool 11 9 011
- o special tool 11 9 015

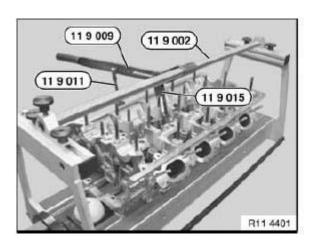


Fig. 92: Identifying Special Tool (11 9 002), (11 9 009) And (11 9 015) Courtesy of BMW OF NORTH AMERICA, INC.

Remove all valve springs.

Remove all valve stem seals . See 11 34 560 REPLACING ALL VALVE STEM SEALS (N62).

Remove all valves . See 11 34 552 REMOVING AND INSTALLING/REPLACING ALL VALVES (N62).

11 12 527 REMACHINING A VALVE SEAT - CYLINDER HEAD DISASSEMBLED (N62)

Special tools required:

- 00 3 520
- 00 3 580

Machine valve seat surface with special tool 00 3 520 or with 00 3 580 in accordance with tool manufacturer's instructions.

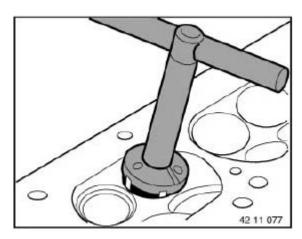



Fig. 93: Identifying Machine Valve Seat Surface With Special Tool (00 3 520) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE:

After machining valve-seat surface: Remachine outside and inside diameters with correction milling tool to the specified diameters until you obtain valve seat width (5).

- 1. Valve-seat angle
- 2. Correction angle, external diameter
- 3. Correction angle, internal diameter
- 4. Valve seat, external diameter
- 5. Valve seat width

Items (1) to (5).

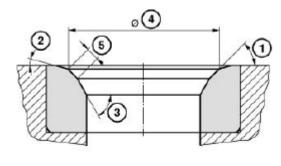

60 11 161 E


Fig. 94: Identifying Valve-Seat Angle, Correction Angle And External Diameter Courtesy of BMW OF NORTH AMERICA, INC.

11 12 719 MILLING CYLINDER HEAD SEALING FACE (N62/N62TU)

(cylinder head dismantled)

Check evenness of cylinder head sealing face with a standard straight-edge (1).


NOTE: Maximum plane deviation: longitudinal 0.10 mm.

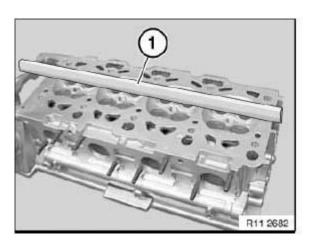

<u>Fig. 95: Identifying Cylinder Head Sealing Face With Standard Straight-Edge</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Maximum plane deviation: transversal 0.05 mm.

o Machining limit . See **ENGINE - TECHNICAL DATA - V8 (N62TU)** .

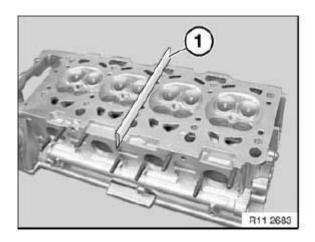

<u>Fig. 96: Identifying Cylinder Head Maximum Plane Deviation</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: A cylinder head seal 0.3 mm thicker than usual can be obtained for machined (milled) cylinder heads.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

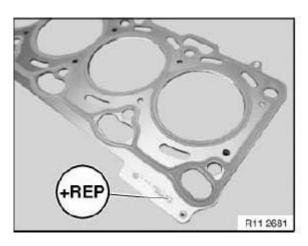


Fig. 97: Identifying Cylinder Head Seal Courtesy of BMW OF NORTH AMERICA, INC.

11 12 729 CHECKING CYLINDER HEAD FOR WATER LEAKS (N62/N62TU)

Special tools required:

- 11 9 430
- 11 9 431
- 11 9 432
- 11 9 433

(cylinder head dismantled)

Prepare special tool kit 11 9 430.

NOTE: Special tool kit 11 9 430 can be used for cylinder bank 1 to 4 and cylinder bank 5 to 8.

Place special tool 11 9 431 on cylinder head sealing surface, insert screws (special tool 11 9 433) and tighten down.

Seal coolant aperture with special tool 11 9 432 and tighten down.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

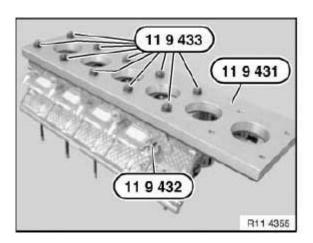


Fig. 98: Identifying Special Tool (11 9 433), (11 9 431) And (11 9 432) Courtesy of BMW OF NORTH AMERICA, INC.

Connect compressed air hose (1) to pressure gauge.

Immerse cylinder head in a water bath. Inspection pressure 4.5 bar.

Check cylinder head for escaping air (cracks).

NOTE: If necessary, add cleaning agent to water bath.

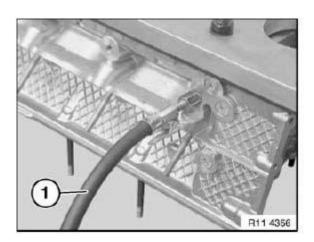


Fig. 99: Identifying Cylinder Head For Escaping Air (Cracks) Courtesy of BMW OF NORTH AMERICA, INC.

13 OIL SUMP

11 13 010 REMOVING AND INSTALLING/REPLACING OIL SUMP TOP SECTION (N62/N62TU)

Special tools required:

• 17 0 030

domingo, 3 de octubre de 2021 12:49:30 a.m.	Page 60	© 2011 Mitchell Repair Information Company, LLC.
---	---------	--


ENGINE Engine - Repair Instructions - X5 (N62TU V8)

REFERENCE CHART

Work step	Note
	Note
Remove design cover, if equipped.	
Remove center front panel	
Remove fan clutch (E65 only). See <u>11 52 020 REMOVING AND</u> INSTALLING OR REPLACING FAN CLUTCH (N62).	
Remove fan cowl (E65 only).	
Remove electric fan (E60 only)	
Remove alternator drive belt . See <u>11 28 010 REPLACING</u> <u>ALTERNATOR DRIVE BELT (N62/N62TU)</u> .	
Remove A/C compressor drive belt . See 11 28 050 REPLACING A/C	
COMPRESSOR DRIVE BELT WITH BELT TENSIONER	
(N62/N62TU).	
Remove acoustic cover. To remove, unfasten screws. Raise acoustic cover and remove towards front.	
Secure engine in installation position with special tool	
Release nuts on left and right engine mounts at top	
Remove reinforcement plate.	
Drain off engine oil.	
Remove lower oil sump section . See <u>11 13 020 REMOVING AND INSTALLING/REPLACING OIL SUMP BOTTOM SECTION</u> (N62/N62TU).	
	NOTE:
Lower front axle support.	To remove the oil sump, you must lower the front axle support. There is no need to perform a front axle alignment check.
Release power steering pump on bracket, hydraulic lines remain	
connected. Secure power steering pump against falling down.	
Unlock and disconnect hydraulic lines from heat exchanger with special tool 17 0 030. Release hydraulic lines on automatic transmission. Release holder for hydraulic lines. Remove hydraulic lines.	Installation location: on radiator at bottom left. Transmission fluid emerges when hydraulic lines are released. Catch and dispose of escaping transmission fluid. Installation: Check fluid level in automatic transmission; top up if necessary.
Unclip cable duct of oxygen sensors from automatic transmission.	


Release screw, remove tensioner (1) from A/C compressor drive belt (E65 only).

domingo, 3 de octubre de 2021 12:49:30 a. m.	Page 61	© 2011 Mitchell Repair Information Company, LLC.
--	---------	--

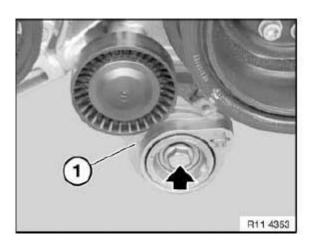

<u>Fig. 100: Locating Tensioner From A/C Compressor Drive Belt</u> Courtesy of BMW OF NORTH AMERICA, INC.

Unfasten screws.

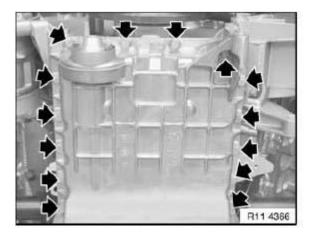

<u>Fig. 101: Locating Screws</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screws and remove oil sump top section.

Installation:

Replace sealing ring on dipstick guide tube.

Free sealing faces of seal debris and clean.

- 1. Replace gasket.
- 2. Install oil sump.
- 3. Insert all screws on transmission end,
- 4. Tighten down all screws on oil sump.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Tightening torque 11 13 2AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

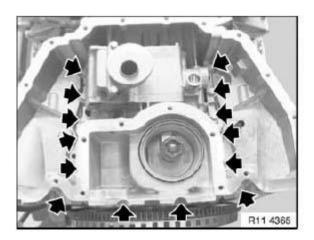


Fig. 102: Locating Oil Sump Screw
Courtesy of BMW OF NORTH AMERICA, INC.

11 13 020 REMOVING AND INSTALLING/REPLACING OIL SUMP BOTTOM SECTION (N62/N62TU)

Necessary preliminary tasks:

- Remove reinforcement plate.
- Remove oil drain plug and drain engine oil.

Unlock plug connection (1) on oil level sensor and disconnect.

Release screws and remove oil sump bottom section (2).

Tightening torque 11 13 2AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

Installation:

Clean sealing surfaces.

Replace seal.


Replace screws.

When replacing oil sump bottom section:

Convert oil level sensor.

Replace sealing ring.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

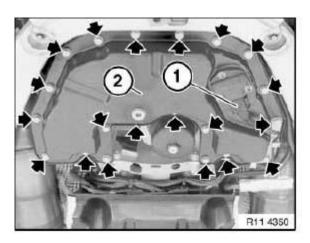

<u>Fig. 103: Locating Plug Connection On Oil Level Sensor</u> Courtesy of BMW OF NORTH AMERICA, INC.


12 13 511 REPLACING IGNITION COIL (N62TU)

Necessary preliminary tasks:

- Switch off ignition
- Remove intake filter housing . See <u>13 71 000 REMOVING AND INSTALLING/REPLACING INTAKE FILTER HOUSING (N52K)</u> .

Release screws and remove holder (1).


Pull ignition coil covers (2) out of rubber grommets.

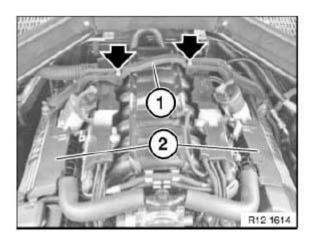

<u>Fig. 104: Pulling Ignition Coil Covers Out Of Rubber Grommets</u> Courtesy of BMW OF NORTH AMERICA, INC.

Unlock plug fastener (1) of ignition coil.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

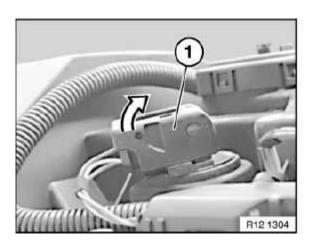


<u>Fig. 105: Identifying Plug Fastener Of Ignition Coil</u> Courtesy of BMW OF NORTH AMERICA, INC.

Detach ignition coil connector in direction of arrow.

Pull out ignition coil (2).

This procedure is applicable to all ignition coils.

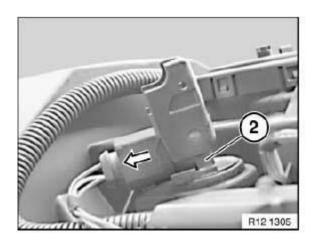


<u>Fig. 106: Pulling Ignition Coil</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Insert rubber seal on ignition coils (2) between guides.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

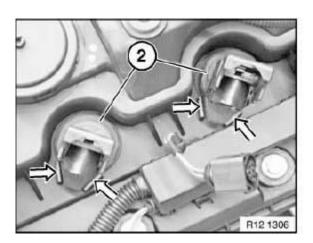

<u>Fig. 107: Inserting Rubber Seal On Ignition Coils Between Guides</u> Courtesy of BMW OF NORTH AMERICA, INC.

Assemble engine.

NOTE: Read out DME fault memory.

Check function of DME.


14 HOUSING COVER

REMOVING ACOUSTIC COVER (N62/N62TU)

Unfasten screws.

Raise acoustic cover (1) and remove towards front.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

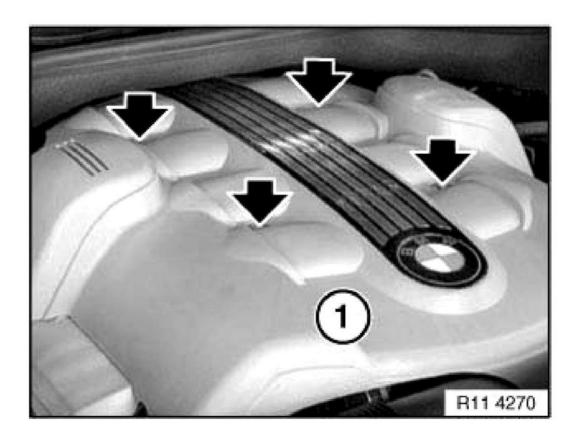

<u>Fig. 108: Identifying Acoustic Cover</u> Courtesy of BMW OF NORTH AMERICA, INC.

11 14 080 REMOVING AND INSTALLING TOP LEFT TIMING CASE COVER (N62/N62TU)

(cylinder bank 5 to 8)


Necessary preliminary tasks:

- Remove left cylinder head cover. See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove both solenoid valves on left side . See <u>11 36 715 REMOVING AND INSTALLING/REPLACING BOTH LEFT SOLENOID VALVES (N62/N62TU)</u>.
- Release alternator (air-cooled).

Release screw, remove holder (1).

Remove line (2) from holder.


ENGINE Engine - Repair Instructions - X5 (N62TU V8)

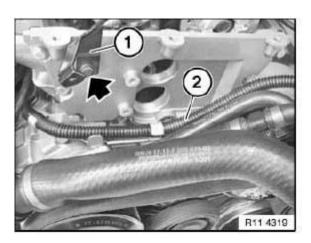

<u>Fig. 109: Locating Line From Holder</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screws (1 and 2).

Remove timing case cover (3).

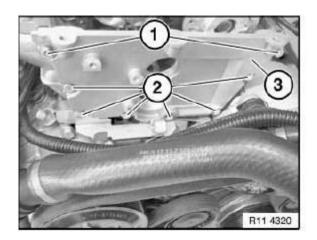

<u>Fig. 110: Identifying Timing Case Cover</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Free sealing face (2) on timing case cover (3) of seal debris and clean.


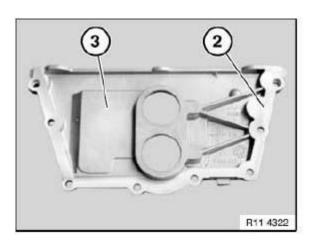


Fig. 111: Identifying Sealing Face On Timing Case Cover Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Check adapter sleeves (1) for damage and correct installation position; replace if necessary.

Free sealing face (2) of seal debris and clean.

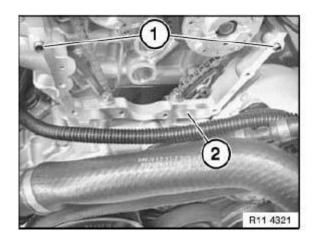

<u>Fig. 112: Identifying Adapter Sleeves And Sealing Face</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace gasket (1) and check for correct installation position.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

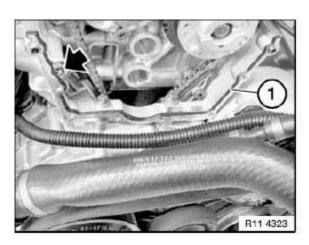


Fig. 113: Identifying Timing Case Cover Gasket Courtesy of BMW OF NORTH AMERICA, INC.


11 14 085 REMOVING AND INSTALLING TOP RIGHT TIMING CASE COVER (N62/N62TU)

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove vacuum pump . See <u>11 66 000 REMOVING AND INSTALLING/REPLACING VACUUM PUMP (N62/N62TU)</u>.
- Remove both solenoid valves on right side. See <u>11 36 720 REMOVING AND</u> INSTALLING/REPLACING BOTH RIGHT SOLENOID VALVES (N62/N62TU).

Remove cable from holder.

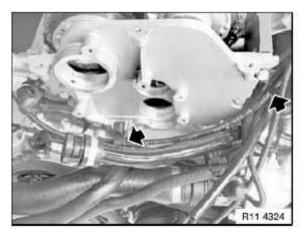


<u>Fig. 114: Identifying Cable From Holder</u> Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Release screws (1 and 2).


Remove timing case cover (3).

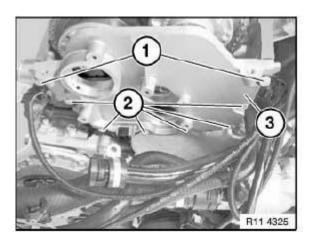

<u>Fig. 115: Identifying Timing Case Cover And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Free sealing face (2) on timing case cover (3) of seal debris and clean.

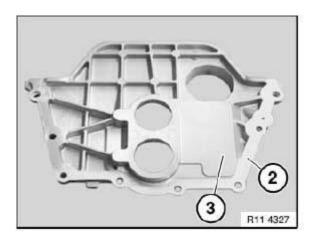

<u>Fig. 116: Identifying Sealing Face On Timing Case Cover</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Check adapter sleeves (1) for damage and correct installation position; replace if necessary.

Free sealing face (2) of seal debris and clean.

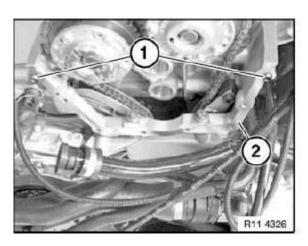


Fig. 117: Identifying Adapter Sleeves And Sealing Face Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace gasket (1) and check for correct installation position.

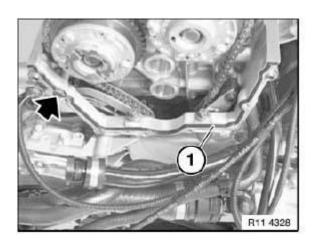


Fig. 118: Identifying Timing Case Cover Gasket Courtesy of BMW OF NORTH AMERICA, INC.

11 14 110 REMOVING AND INSTALLING BOTTOM TIMING CASE COVER (N62/N62TU)

Special tools required:

• 23 1 040

Necessary preliminary tasks:

- Remove engine . See 11 00 050 REMOVING AND INSTALLING ENGINE (N62/N62TU).
- Remove both cylinder heads . See <u>11 12 105 REMOVING AND INSTALLING LEFT CYLINDER</u> HEAD (N62 FROM 9/03 AND N62TU) and 11 12 106 REMOVING AND INSTALLING RIGHT

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

CYLINDER HEAD (N62 FROM 9/03 AND N62TU).

- Remove lower oil sump section . See <u>11 13 020 REMOVING AND INSTALLING/REPLACING OIL SUMP BOTTOM SECTION (N62/N62TU)</u>.
- Remove upper oil sump section . See <u>11 13 010 REMOVING AND INSTALLING/REPLACING OIL SUMP TOP SECTION (N62/N62TU)</u>.
- Remove vibration damper . See <u>11 23 010 REMOVING AND INSTALLING/REPLACING VIBRATION DAMPER (N62/N62TU)</u>.
- Remove water pump . See <u>11 51 000 REMOVING AND INSTALLING/REPLACING WATER PUMP (N62/N62TU)</u>.
- Remove tensioner from poly-V-belt
- Remove alternator with housing
- Remove hub for vibration damper . See <u>11 23 031 REMOVING AND INSTALLING/REPLACING VIBRATION DAMPER HUB (N62/N62TU)</u>.
- Remove flywheel . See <u>11 22 000 REMOVING AND INSTALLING/REPLACING FLYWHEEL</u> (N62/N62TU).
- Remove rear coolant cap

Release screws along lines (1).

Remove timing case cover (2) towards front.

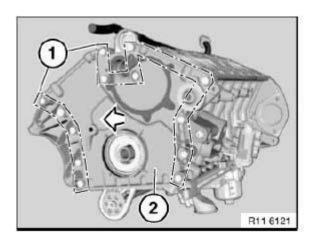


Fig. 119: Identifying Timing Case Cover And Screw Courtesy of BMW OF NORTH AMERICA, INC.

Drive out water pipe (1) with special tool 23 1 040 at cutout (2) towards front.

Installation:

Replace water pipe (1) and sealing ring (3).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

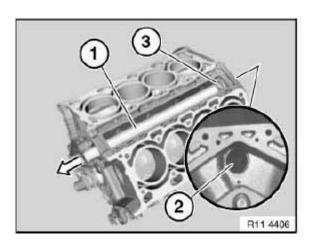


Fig. 120: Identifying Water Pipe And Sealing Ring Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean sealing surfaces and replace seal.

Install timing case cover, insert all screws and initially tighten to approx. 5 Nm.

Fully tighten all screws in alternate sequence.

Tightening torque 11 14 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

IMPORTANT: Once all screws have been tightened down, retighten them in a second operation.

Replace radial seal in timing case at bottom. See <u>11 14 141 REPLACING RADIAL SHAFT SEAL IN</u> TIMING CASE COVER AT BOTTOM (N62/N62TU).

11 14 141 REPLACING RADIAL SHAFT SEAL IN TIMING CASE COVER AT BOTTOM (N62/N62TU)

Special tools required:

- 11 9 410
- 11 9 420

Necessary preliminary tasks:

• Removing hub for vibration damper . See <u>11 23 031 REMOVING AND INSTALLING/REPLACING</u> VIBRATION DAMPER HUB (N62/N62TU).

Position lever (2) for removing radial shaft seal (1) horizontally and install special tool 11 9 410.

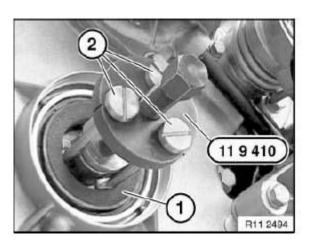


Fig. 121: Identifying Radial Shaft Seal With Special Tool (11 9 410) Courtesy of BMW OF NORTH AMERICA, INC.

Turn lever (2) so that it grips behind radial shaft seal (1).

Turn bolt (3) on special tool 11 9 410 to remove radial shaft seal (1).

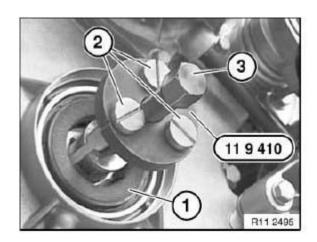


Fig. 122: Identifying Radial Shaft Seal, Bolt With Special Tool (11 9 410) Courtesy of BMW OF NORTH AMERICA, INC.


NOTE: Radial shaft seal may only be supported with a "support sleeve".

If the radial shaft seal (1) is stored for longer than six months without the support sleeve (2), its operational reliability can no longer be guaranteed and it must not be reused.

IMPORTANT: The sealing lip of the radial shaft seal is highly sensitive and must not be kinked under any circumstances.


Do not touch the sealing lip with your fingers.

Remove support sleeve (2) from radial shaft seal (1).

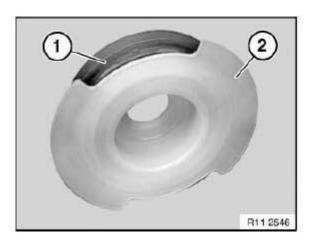

<u>Fig. 123: Identifying Support Sleeve From Radial Shaft Seal</u> Courtesy of BMW OF NORTH AMERICA, INC.

Fit radial shaft seal (1) on timing case cover.

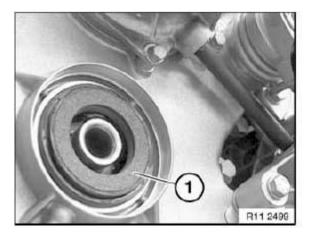

<u>Fig. 124: Identifying Radial Shaft Seal On Timing Case Cover</u> Courtesy of BMW OF NORTH AMERICA, INC.

Using special tool 11 9 420 and central bolt (3), install radial shaft seal flush with timing case cover.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

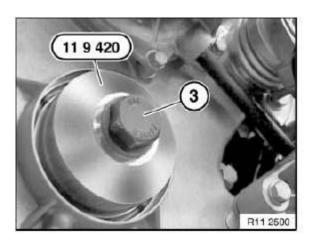


Fig. 125: Identifying Central Bolt With Special Tool (11 9 420) Courtesy of BMW OF NORTH AMERICA, INC.

11 14 151 REPLACING CRANKSHAFT RADIAL SHAFT SEAL (N62/N62TU)

Special tools required:

• 11 2 390

(transmission side)

Necessary preliminary tasks:

- Remove transmission . See <u>24 00 023 REMOVING AND INSTALLING AUTOMATIC TRANSMISSION (GA6HP26Z) N62TU</u> .
- Drain off engine oil.
- Remove flywheel . See <u>11 22 000 REMOVING AND INSTALLING/REPLACING FLYWHEEL (N62/N62TU)</u>.

Release screws (2).

Release screws (1).

Carefully remove end cover.

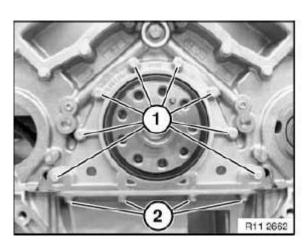


Fig. 126: Identifying End Cover And Screw Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The sealing lip of the radial shaft seal is highly sensitive and must not be kinked.

Do not touch the sealing lip with your fingers.

NOTE: Support sleeve (2) is included in scope of delivery.

If the radial shaft seal (1) is stored for longer than six months without the support sleeve (2), its operational reliability can no longer be guaranteed and it must not be reused.

The support sleeve (2) remains in the radial shaft seal and is used as a slip sleeve in the installation described later.

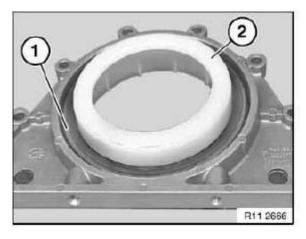


Fig. 127: Identifying Support Sleeve And Radial Shaft Seal Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Special tool 11 2 390 must not be used.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

When the radial shaft seal is installed, only the support sleeve included in the scope of delivery may be used as a slip sleeve.

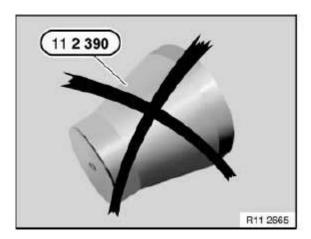


Fig. 128: Identifying Precaution For Special Tool (11 2 390) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The radial shaft seal can only be replaced completely with the end cover.

The gasket is an integral part of the end cover and cannot be replaced


individually.

Installation:

Check dowel sleeves (1) for damage and correct installation position.

Keep sealing faces clean and free of oil.

Coat contact points on joint along oil sump with Drei Bond 1209.

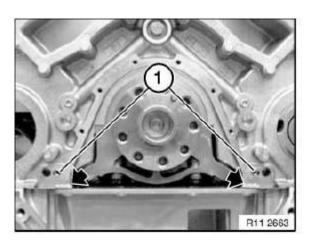


<u>Fig. 129: Identifying Dowel Sleeves</u> Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Installation:

Lightly oil running surface of crankshaft.

Fit end cover (1) with support sleeve (2) on crankshaft and push on carefully.

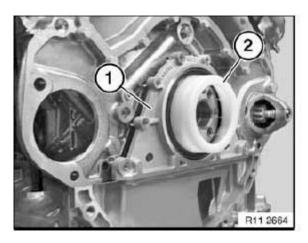

<u>Fig. 130: Identifying End Cover With Support Sleeve</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert screws (1) and initially tighten without play.

Insert screws (2) and initially tighten without play.

Tighten down screws (1).

Tighten down screws (2).

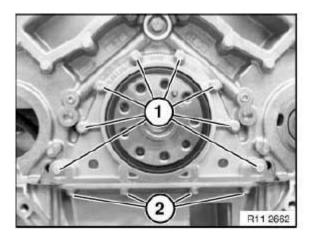


Fig. 131: Identifying End Cover And Screw Courtesy of BMW OF NORTH AMERICA, INC.

21 CRANKSHAFT WITH BEARINGS

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

11 21 500 REPLACING CRANKSHAFT (N62/N62TU)


REFERENCE CHART

Operation	Note
Remove engine . See 11 00 050 REMOVING AND INSTALLING ENGINE (N62/N62TU).	
Remove cylinder head (cylinder bank 1 to 4). See 11 12 105 REMOVING AND INSTALLING	
LEFT CYLINDER HEAD (N62 FROM 9/03 AND N62TU) or 11 12 106 REMOVING AND	
INSTALLING RIGHT CYLINDER HEAD (N62 FROM 9/03 AND N62TU).	
Remove cylinder head (cylinder bank 5 to 8). See 11 12 105 REMOVING AND INSTALLING	
LEFT CYLINDER HEAD (N62 FROM 9/03 AND N62TU) or 11 12 106 REMOVING AND	
INSTALLING RIGHT CYLINDER HEAD (N62 FROM 9/03 AND N62TU).	
Remove hub for vibration damper . See <u>11 23 031 REMOVING AND</u>	
INSTALLING/REPLACING VIBRATION DAMPER HUB (N62/N62TU).	
Removing lower timing case cover	
Removing oil pan . See 11 13 010 REMOVING AND INSTALLING/REPLACING OIL SUMP	
TOP SECTION (N62/N62TU) and 11 13 020 REMOVING AND INSTALLING/REPLACING	
OIL SUMP BOTTOM SECTION (N62/N62TU).	
Remove oil pump . See 11 41 000 REMOVING AND INSTALLING/REPLACING OIL PUMP	
(N62).	
Removing piston . See 11 25 530 REMOVING AND INSTALLING/REPLACING ALL	
PISTONS (N62TU).	
Remove flywheel . See 11 22 000 REMOVING AND INSTALLING/REPLACING	
FLYWHEEL (N62/N62TU).	

Release main bearing inclined screw connection (1).

Installation:

Tightening torque 11 11 3AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

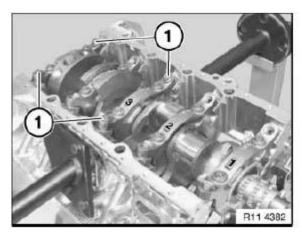

<u>Fig. 132: Identifying Main Bearing Inclined Screw Connection</u> Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Release spacer bolt (2).

Tightening torque 11 11 3AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

Release main bearing screws.

Tightening torque 11 11 2AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .


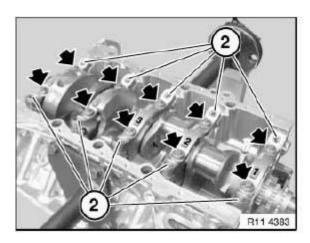


Fig. 133: Locating Spacer Bolt Courtesy of BMW OF NORTH AMERICA, INC.

Remove main bearing caps 1 to 5.

Lever out crankshaft.

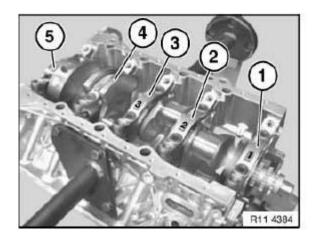

<u>Fig. 134: Identifying Main Bearing Caps</u> Courtesy of BMW OF NORTH AMERICA, INC.

Replace main crankshaft bearing shells . See <u>11 21 531 REPLACING ALL MAIN CRANKSHAFT</u> BEARING SHELLS (N62/N62TU).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Replace conrod bearing shells . See 11 24 571 REPLACING ALL CONROD BEARINGS (N62/N62TU).

11 21 531 REPLACING ALL MAIN CRANKSHAFT BEARING SHELLS (N62/N62TU)

Special tools required:

- 00 2 590
- 00 9 120

Necessary preliminary tasks:

- (engine dismantled)
- Clean components before installing.
- Preparatory tasks are described in the section REPLACING CRANKSHAFT.

NOTE:

Install main bearing shells (1) with lubrication groove in crankcase. Install main bearing shells (2) without lubrication groove in the main bearing caps.

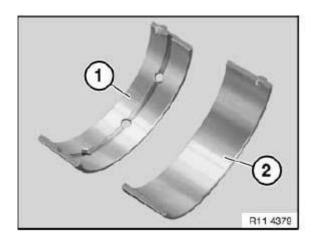


Fig. 135: Identifying Main Bearing Shells
Courtesy of BMW OF NORTH AMERICA, INC.

The letter (1) denotes the crankshaft construction stage.

S= Series

B= Construction stage 1

C= Construction stage 2

The numbers (2) denote the bearing shell classification for the relevant bearing position from 1 to 5 (main bearing cap).


domingo, 3 de octubre de 2021 12:49:30 a. m.	Page 83	© 2011 Mitchell Repair Information Company, LLC.
--	---------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

1= yellow

2= green

3= violet

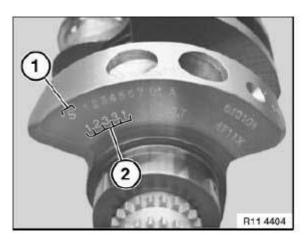


<u>Fig. 136: Identifying Letter Crankshaft Construction Stage</u> Courtesy of BMW OF NORTH AMERICA, INC.

The letters (1) denote the bearing shell classification for the relevant bearing position from 1 to 5 in the crankcase and is located on the transmission side in the Vee. The first letter on the left applies to the first bearing position at the front.

Y= yellow

G= green

V= violet

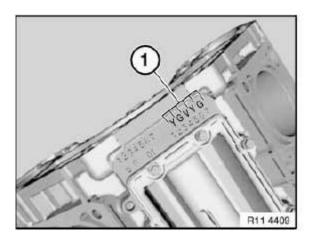

<u>Fig. 137: Identifying Letters Bearing Shell Classification</u> Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

NOTE: Main bearing caps (1, 2 and 3) are identified with punch numbers.

Main bearing caps (4 and 5) are not identified.

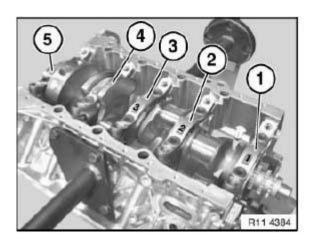


Fig. 138: Identifying Main Bearing Caps Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Main bearing cap number 5 can be identified by the surfaces (1) for the stop disks of the thrust bearing.


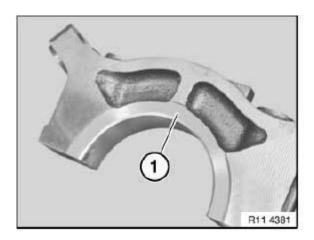


Fig. 139: Identifying Main Bearing Cap Number Surfaces Courtesy of BMW OF NORTH AMERICA, INC.

Unscrew thread support bushings in main bearing caps.



60 11 211

Fig. 140: Identifying Thread Support Bushings In Main Bearing Caps Courtesy of BMW OF NORTH AMERICA, INC.


Checking main bearing clearance:

To check crankshaft bearing clearance, use old main bearing screws.

There must be no oil in the blind holes (risk of cracking).

Do not twist crankshaft.

Fit special tool 00 2 590 (Plastigage Type PG 1) to the oil-free crankshaft.

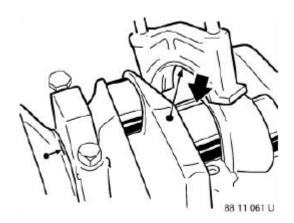

<u>Fig. 141: Locating Main Bearing Clearance</u> Courtesy of BMW OF NORTH AMERICA, INC.

- 1. Tighten all screws on main bearing cover with jointing torque.
- 2. Tighten down all screws on main bearing caps with special tool 00 9 120 and torsion angle.

Tightening torque, 11 11 2AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

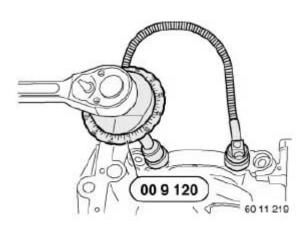


Fig. 142: Identifying Special Tool (00 9 120)
Courtesy of BMW OF NORTH AMERICA, INC.

Remove main bearing cap.

Read off main bearing play at width of flattened plastic thread with assistance of measurement scale.

Main bearing play.

- o Remove plastic thread.
- o Lubricate bearing shells and bearing shells.

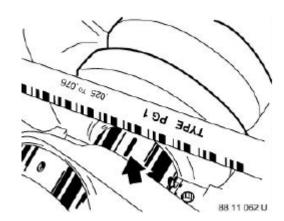


Fig. 143: Locating Main Bearing Cap Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Always replace main bearing bolts of main bearing caps with new bolts.

Do not wash off bolt coating.

No oil is permitted in the blind bores! (Danger of cracking).

Tightening specifications for main bearing:

1. Tighten all screws on main bearing cover with jointing torque.


ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 2. Unfasten screws on main bearing cover 5.
- 3. Strike back and front of crankshaft with plastic hammer to center thrust bearing (do not damage crankshaft).

Check axial play.

Check guide bearing shell, crankshaft and crankcase if necessary.

- 4. Tighten screws of main bearing cover 5 with jointing torque.
- 5. Tightening torque 11 11 2AZ. See **ENGINE TIGHTENING TORQUES (N62TU V8)**.

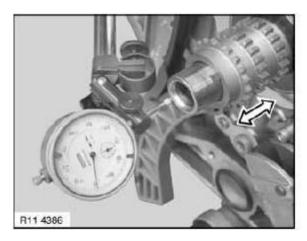


<u>Fig. 144: Checking Axial Play</u> Courtesy of BMW OF NORTH AMERICA, INC.

Tighten down all screws on main bearing caps with special tool 00 9 120 and torsion angle.

Tightening torque, 11 11 2AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

Tighten down thread support bushings (2).


Tightening torque, 11 11 3AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

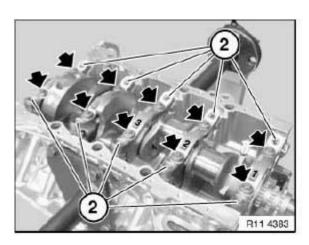

<u>Fig. 145: Locating Spacer Bolt</u> Courtesy of BMW OF NORTH AMERICA, INC.

Replace flanged head screws (1) and tighten down.

Tightening torque, 11 11 3AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

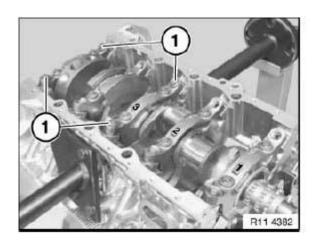

<u>Fig. 146: Identifying Main Bearing Inclined Screw Connection</u> Courtesy of BMW OF NORTH AMERICA, INC.

22 FLYWHEEL

11 22 000 REMOVING AND INSTALLING/REPLACING FLYWHEEL (N62/N62TU)

Special tools required:

- 11 4 180
- 11 9 260
- 11 9 262
- 11 9 263

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

• 11 9 264

Necessary preliminary tasks:

• Remove automatic transmission . See <u>24 00 023 REMOVING AND INSTALLING AUTOMATIC TRANSMISSION (GA6HP26Z) N62TU</u> .

Automatic transmissions only:

Block flywheel (1) with special tools 11 9 260 /11 9 263 /11 9 264.

Unfasten flywheel screws.

Remove flywheel (1).

Installation:

Clean threads on flywheel screws in crankshaft.

Flywheel (1) is secured with an alignment pin.

Fit flywheel (1).

Fit new flywheel screws.

Tightening torque 11 22 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

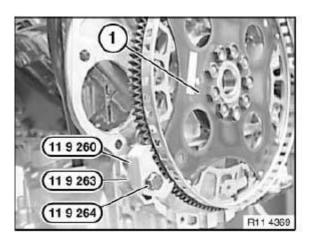


Fig. 147: Identifying Special Tool (11 9 260), (11 9 263) And (11 9 264) Courtesy of BMW OF NORTH AMERICA, INC.

Manual transmissions only:

Block flywheel (dual-mass) with special tools 11 9 260 /11 9 262 /11 9 263.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Release flywheel screws with special tool 11 4 180.

Installation:

Flywheel (1) is secured with an alignment pin.

IMPORTANT: Do not use screw locking varnish.

Tightening torque 11 22 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

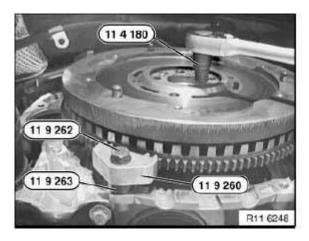


Fig. 148: Identifying Special Tool (11 4 180), (11 9 262) And (11 9 260) Courtesy of BMW OF NORTH AMERICA, INC.


23 VIBRATION DAMPER

11 23 010 REMOVING AND INSTALLING/REPLACING VIBRATION DAMPER (N62/N62TU)

Necessary preliminary tasks:

- Remove alternator drive belt . See <u>11 28 010 REPLACING ALTERNATOR DRIVE BELT</u> (N62/N62TU).
- Remove A/C compressor drive belt . See <u>11 28 050 REPLACING A/C COMPRESSOR DRIVE BELT WITH BELT TENSIONER (N62/N62TU)</u>.
- Remove fan cowl.


Release bolts and remove vibration damper (1).

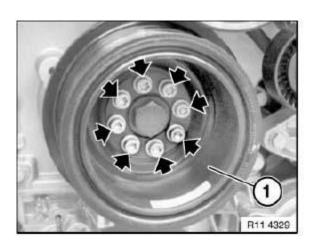

<u>Fig. 149: Locating Vibration Damper And Bolts</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Vibration damper is secured on hub with an alignment pin (4).

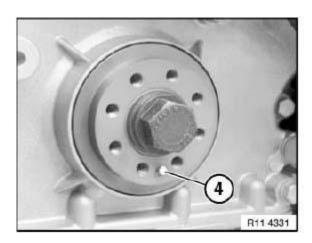

<u>Fig. 150: Identifying Vibration Damper On Hub With Alignment Pin</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Fit bore (2) in vibration damper (1) on alignment pin in hub.

Fit disk (3).

Replace screws.

Tightening torque 11 23 3AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

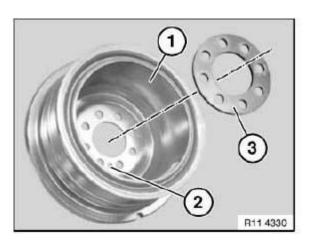


Fig. 151: Identifying Vibration Damper And Disk Courtesy of BMW OF NORTH AMERICA, INC.

11 23 031 REMOVING AND INSTALLING/REPLACING VIBRATION DAMPER HUB (N62/N62TU)

Special tools required:

- 11 3 460
- 11 9 451
- 11 9 452
- 11 9 453
- 11 9 454

Necessary preliminary tasks:

- Remove design cover, if equipped.
- Remove fan clutch (E65). See <u>11 52 020 REMOVING AND INSTALLING OR REPLACING FAN</u> CLUTCH (N62).
- Remove fan cowl (E65)
- Remove drive belt for alternator. See <u>11 28 010 REPLACING ALTERNATOR DRIVE BELT</u> (N62/N62TU).
- Remove drive belt for A/C compressor. See <u>11 28 050 REPLACING A/C COMPRESSOR DRIVE</u> <u>BELT WITH BELT TENSIONER (N62/N62TU)</u>.
- Remove front engine underguard
- Remove tensioner from A/C compressor drive belt (E65)
- Remove vibration damper . See <u>11 23 010 REMOVING AND INSTALLING/REPLACING</u> VIBRATION DAMPER (N62/N62TU).

Screw special tool 11 9 451 in conjunction with special tool 11 9 452 to vibration damper hub and to oil sump.

Release central bolt (1).

domingo, 3 de octubre de 2021 12:49:30 a.m.	Page 93	© 2011 Mitchell Repair Information Company, LLC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Remove special tools.

Remove hub for vibration damper. See <u>11 23 031 REMOVING AND INSTALLING/REPLACING VIBRATION DAMPER HUB (N62/N62TU)</u>.

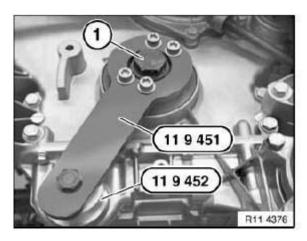


Fig. 152: Identifying Special Tool (11 9 451) And (11 9 452) Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Check vibration damper hub and radial seal, replace if necessary.

Align groove in vibration damper hub to parallel key and install vibration damper hub.

Replace central bolt (1).

Tighten down central bolt (1) to joining torque.

Tightening torque 11 23 2AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

Installation:

Fit special tool 11 3 460 on special tool 11 9 451.

NOTE: Special tool 11 3 460 is magnetic.

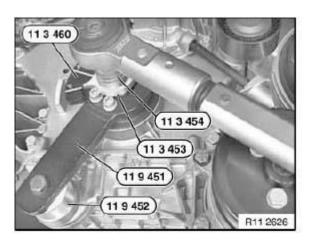


Fig. 153: Identifying Special Tool (11 3 460), (11 3 454) And (11 9 451) Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Select 0° position and secure special tool 11 9 453 with clamping screw on socket (special tool 11 9 454).

Tighten the central screw with torsion angle.

Tightening torque 11 23 2AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

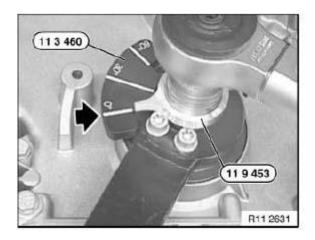


Fig. 154: Identifying Special Tool (11 3 460) And (11 9 453) Courtesy of BMW OF NORTH AMERICA, INC.

Assemble engine.

24 CONNECTING ROD WITH BEARING

11 24 571 REPLACING ALL CONROD BEARINGS (N62/N62TU)

Special tools required:

domingo, 3 de octubre de 2021 12:49:31 a. m.	Page 95	© 2011 Mitchell Repair Information Company, LLC.
--	---------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 00 2 590
- 00 9 120
- 11 2 110

(piston removed)

IMPORTANT: Note grinding stages on crankshaft . See <u>ENGINE - TECHNICAL DATA - V8</u> (N62TU) .

The letter (1) denotes the crankshaft construction stage.

The numbers (2) denote the bearing shell classification for the relevant bearing position from 1 to 5 (main bearing cap).

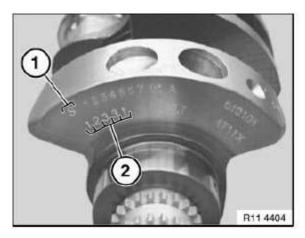


Fig. 155: Identifying Letter Crankshaft Construction Stage Courtesy of BMW OF NORTH AMERICA, INC.

Install new conrod bearing shells.

Insert one red and one blue bearing shell for each conrod.

Install piston . See 11 25 530 REMOVING AND INSTALLING/REPLACING ALL PISTONS (N62TU).

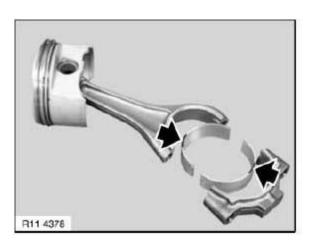


Fig. 156: Installing Conrod Bearing Shells
Courtesy of BMW OF NORTH AMERICA, INC.

Check connecting-rod bearing clearance:

Piston in BDC position.

Fit special tool 00 2 590 (Plastigage Type PG 1) to the oil-free crankshaft.

Fit bearing caps so that pair numbers match up.

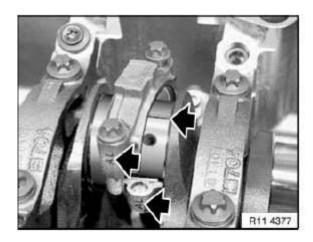


Fig. 157: Locating Connecting-Rod Bearing Clearance Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not distort conrods or crankshaft.

Use conrod bolts to check conrod bearing clearance.

Tighten down conrod bolts with special tool 00 9 120 or special tool 11 2 110.

Tightening torque 11 24 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).


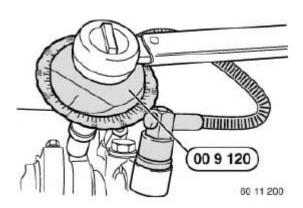


Fig. 158: Identifying Special Tool (00 9 120) Courtesy of BMW OF NORTH AMERICA, INC.

Remove bearing cap and read off bearing play at width of flattened plastic thread with assistance of measurement scale.

Conrod bearing clearance.

- o Remove plastic thread.
- o Lubricate crankshaft and bearing shells.
- Install new conrod bolts.

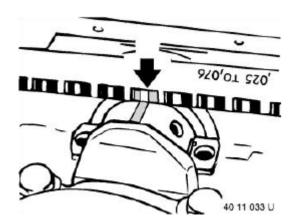

<u>Fig. 159: Locating Conrod Bearing Clearance</u> Courtesy of BMW OF NORTH AMERICA, INC.

Tighten down conrod bolts with special tool 00 9 120 or special tool 11 2 110.

Tightening torque 11 24 1AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

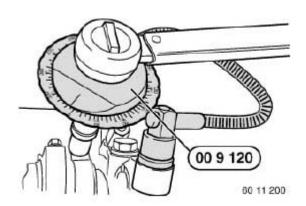


Fig. 160: Identifying Special Tool (00 9 120)
Courtesy of BMW OF NORTH AMERICA, INC.

25 PISTON WITH RINGS AND PIN

11 25 530 REMOVING AND INSTALLING/REPLACING ALL PISTONS (N62TU)

Special tools required:

- 00 9 120
- 11 5 430
- 11 5 440
- 11 5 450

IMPORTANT: Re-install piston, conrod and bearing shells back in the same position and in the same installation location.

Conrods and conrod bearing caps are denoted with the same pairing letters, do not mix them up.

Necessary preliminary tasks:

- (engine removed)
- Install engine on assembly stand.
- Remove both cylinder heads . See 11 12 105 REMOVING AND INSTALLING LEFT CYLINDER
 HEAD (N62 FROM 9/03 AND N62TU) and 11 12 106 REMOVING AND INSTALLING RIGHT
 CYLINDER HEAD (N62 FROM 9/03 AND N62TU).
- Removing oil pan . See 11 13 010 REMOVING AND INSTALLING/REPLACING OIL SUMP TOP SECTION (N62/N62TU) and 11 13 020 REMOVING AND INSTALLING/REPLACING OIL SUMP BOTTOM SECTION (N62/N62TU).
- Remove oil pump . See <u>11 41 000 REMOVING AND INSTALLING/REPLACING OIL PUMP (N62)</u>.

In event of heavy oil carbon residue:

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Carefully remove oil carbon residue from cylinder wall.

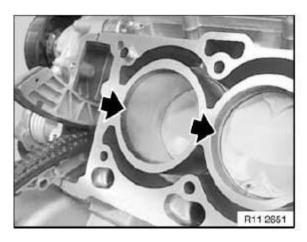


Fig. 161: Locating Oil Carbon Residue From Cylinder Wall Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: When removing and installing pistons, make sure piston cooling spray nozzles (1) are not damaged.


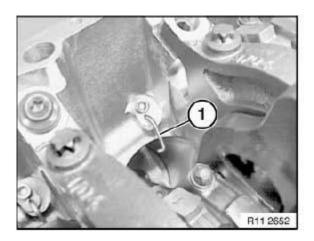


Fig. 162: Identifying Piston Cooling Spray Nozzles Courtesy of BMW OF NORTH AMERICA, INC.

Unscrew conrod bearing cover.

IMPORTANT: Conrods and conrod bearing caps are denoted with the same pairing letters. Set down conrod bearing caps in order.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

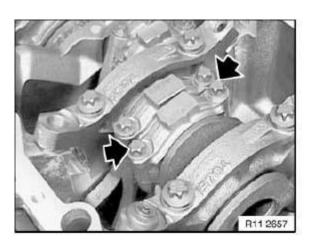

<u>Fig. 163: Locating Conrod Bearing Cover</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert special tool 11 5 440 in conrod.

Screw special tool 11 5 440 into conrod with screw (1).

Remove conrod with piston from cylinder head side.

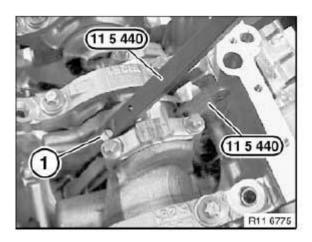


Fig. 164: Identifying Special Tool (11 5 440) And (11 5 440) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Piston and piston pin are matched to each other.

Mixing up the components will result in engine damage.

Lever out circlip with special tool 11 4 492 in direction of arrow and press out piston pin.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

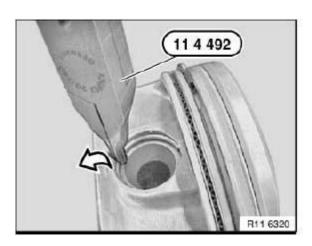


Fig. 165: Identifying Special Tool (11 4 492) Courtesy of BMW OF NORTH AMERICA, INC.

If necessary, replace connecting rods.

NOTE: The conrods can also be replaced individually.

The piston pin must be able to be pressed through the liner by hand with little force and must not display any significant play.

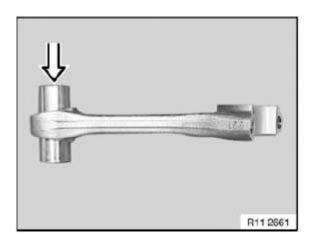



Fig. 166: Pressing Piston Pin Courtesy of BMW OF NORTH AMERICA, INC.

Prior to installation, measure piston installation clearance:

Measure piston diameter with micrometer at measuring point A from lower edge of piston and offset by 90° to piston pin axis.

Measuring point A . See **ENGINE - TECHNICAL DATA - V8 (N62TU)** .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

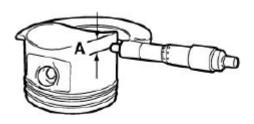

88 11 051 U

Fig. 167: Measuring Piston Diameter With Micrometer Courtesy of BMW OF NORTH AMERICA, INC.

Adjust micrometer to cylinder bore of engine block. Set internal caliper on micrometer to zero. Measure bottom, center and top of cylinder bore in direction of travel and direction of engine rotation.

Diameter of cylinder bore . See **ENGINE - TECHNICAL DATA - V8 (N62TU)** .

Piston installation clearance . See **ENGINE - TECHNICAL DATA - V8 (N62TU)** .

Total permissible wear tolerance . See **ENGINE - TECHNICAL DATA - V8 (N62TU)** .

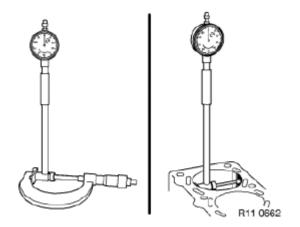


Fig. 168: Identifying Micrometer To Cylinder Bore Of Engine Block Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The pistons and conrods of cylinders 1 to 8 are identical.

IMPORTANT: The conrods of cylinder banks 1 to 4 and 5 to 8 are mounted to the pistons differently.

Cylinder bank 1 to 4

Mount conrod on piston in such a way that arrow on piston points **upwards** and marking on conrod points **upwards**.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


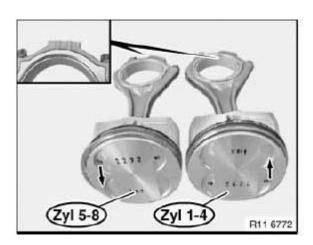


Fig. 169: Identifying Piston Marking On Conrod Points Courtesy of BMW OF NORTH AMERICA, INC.

Cylinder bank 5 to 8

Mount conrod on piston in such a way that arrow on piston points **downwards** and marking on conrod points **upwards**.

Install conrod bearing . See 11 24 571 REPLACING ALL CONROD BEARINGS (N62/N62TU).

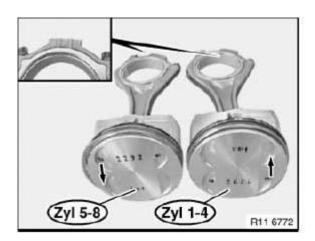

<u>Fig. 170: Identifying Piston Marking On Conrod Points</u> Courtesy of BMW OF NORTH AMERICA, INC.

Install retaining ring.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

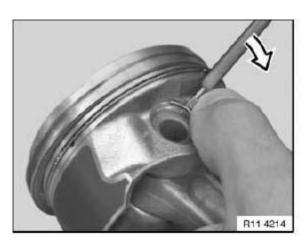


Fig. 171: Installing Retaining Ring Courtesy of BMW OF NORTH AMERICA, INC.

Offset the contact points (1) of the piston rings by approx. 120° to each other but do not position above the piston pin boss.

NOTE: See illustration. Illustration shows N52.

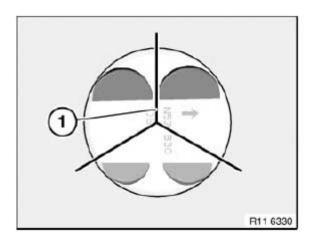


Fig. 172: Identifying Contact Points Of Piston Rings Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

B40 and B48:

Insert special tools 11 5 440 in conrod.

Installation:

B40:

domingo, 3 de octubre de 2021 12:49:31 a. m.	Page 105	© 2011 Mitchell Repair Information Company, LLC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Prepare piston with rings with special tool 11 5 450.

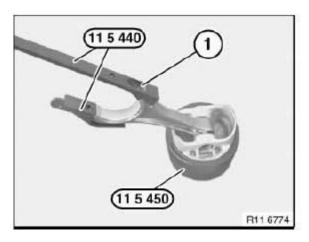


Fig. 173: Identifying Special Tool (11 5 440) And (11 5 450) Courtesy of BMW OF NORTH AMERICA, INC.

B40:

Lightly coat pistons and piston rings with oil. Offset the contact points of the piston rings by approx. 120° to each other but do not position above the piston pin boss.

Slide in special tool 11 5 450 with piston (1).

Install piston so that arrow points to camshaft drive.

IMPORTANT: Danger of piston ring failure.

Press in piston with finger force only.

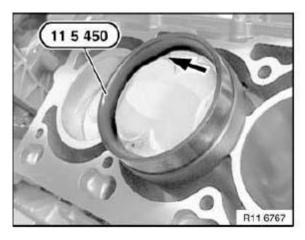


Fig. 174: Identifying Special Tool (11 5 450)
Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

B48:

Keep piston rings compressed with special tool 11 5 430.

Install piston so that arrow points to camshaft drive.

IMPORTANT: Danger of piston ring failure.

Press in piston with finger force only.

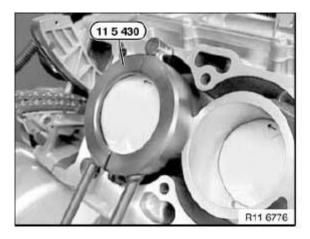


Fig. 175: Identifying Special Tool (11 5 430) Courtesy of BMW OF NORTH AMERICA, INC.

Attach crankpin to connecting rod.

Remove special tools 11 5 450.

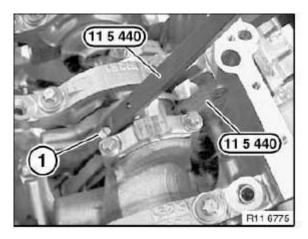


Fig. 176: Identifying Special Tool (11 5 440) And (11 5 440) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: For purposes of clarity, the pairing letters (1) are shown on the removed

conrod.

IMPORTANT: Conrods and conrod bearing caps are denoted with the same pairing letters (1), do not mix them up.

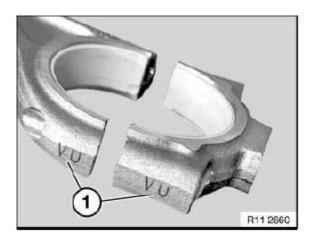


Fig. 177: Identifying Conrods And Conrod Bearing Caps Denoted With Pairing Letters Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Conrod of cylinder 1 to 4 is installed in direction of travel, see arrow (1), front. Conrod of cylinder 5 to 8 is installed in direction of travel, see arrow (1), rear. Markings on conrod must be situated on the outside (see arrows) Incorrect assembly will result in engine damage.

Apply light coat of oil to connecting-rod bearing shells.

Fit bearing cap so that pairing letters match up.

Install new conrod bolts.

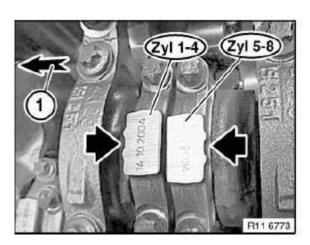


Fig. 178: Identifying Conrod Of Cylinder Of Travel

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Courtesy of BMW OF NORTH AMERICA, INC.

Secure conrod with special tool 00 9 120.

Tightening torque 11 24 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

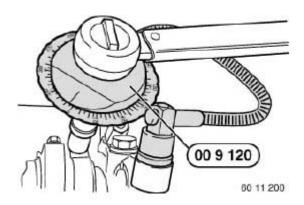


Fig. 179: Identifying Special Tool (00 9 120) Courtesy of BMW OF NORTH AMERICA, INC.

Assemble engine.


11 25 671 REPLACING PISTON RINGS ON ALL PISTONS (N62)

(piston removed)

Measuring axial clearance of piston rings in piston ring groove (1 and 2):

See 11 24 571 REPLACING ALL CONROD BEARINGS (N62/N62TU).

NOTE: It is not possible to measure the axial clearance of the oil scraper rings.

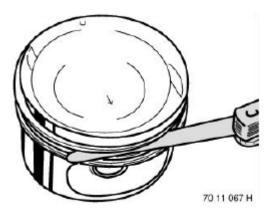

<u>Fig. 180: Measuring Axial Clearance Of Piston Rings In Piston Ring Groove</u> Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Remove piston rings (1 and 2) with piston ring compressing pliers.

NOTE: It might not be possible to find the identification on used piston rings.

Put aside piston rings in correct sequence and installation position.

New pistons may only be installed together with new piston rings.


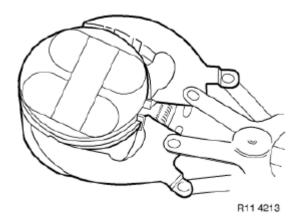


Fig. 181: Removing Piston Rings Courtesy of BMW OF NORTH AMERICA, INC.

Measure end clearance. See 11 24 571 REPLACING ALL CONROD BEARINGS (N62/N62TU).

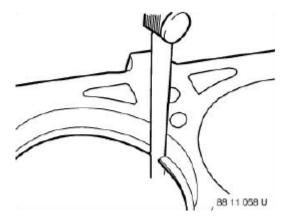

<u>Fig. 182: Measuring End Clearance</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Picture shows a schematic representation.


Installation:

Install piston rings with "TOP" to piston top.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 1. Plain compression ring
- 2. Stepped compression ring "Top"
- 3. Steel band ring with support spring

Offset the contact points of the piston rings by approx. 120° to each other but do not position above the piston pin boss.

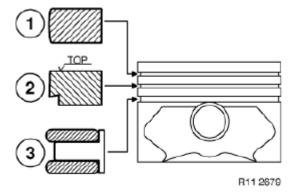

<u>Fig. 183: Identifying Piston Rings With Top To Piston Top</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Oil control ring comprises two steel band rings (1) and a support spring (2).

Insert support spring (2) into piston ring groove.

CAUTION: Incorrect installation possible.


Contact points of support spring (2) slip very easily over each other when fitted.

Contact points must be positioned exactly on each other.

If the contact points overlap, the oil scraper ring will be damaged when the piston is installed.

Then fit steel band rings (1) so that contact joints are offset approx. 120°.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

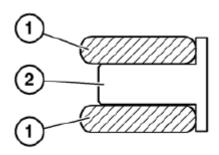

R11 2680

Fig. 184: Identifying Oil Control Ring Comprises Steel Band Rings And Support Spring Courtesy of BMW OF NORTH AMERICA, INC.

28 V-RIBBED BELT WITH TENSIONER

11 28 010 REPLACING ALTERNATOR DRIVE BELT (N62/N62TU)

Special tools required:

• 11 3 340

Necessary preliminary tasks:

• Remove fan clutch with fan impeller (E65/66). See <u>11 52 020 REMOVING AND INSTALLING OR REPLACING FAN CLUTCH (N62)</u>.

NOTE: If the drive belt is to be reused:

Mark direction of travel and reinstall drive belt in same direction of travel.

Pretension belt tensioner slowly and carefully with a Torx socket as far as it will go and secure with special tool 11 3 340.

Remove drive belt.

IMPORTANT: If contaminated with hydraulic fluid: Replace drive belt.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

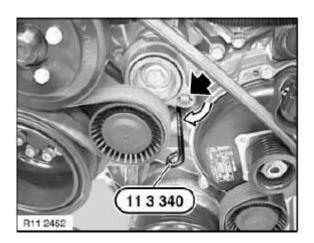


Fig. 185: Removing Drive Belt With Special Tool (11 3 340) Courtesy of BMW OF NORTH AMERICA, INC.

Put on the drive belt.

Remove special tool 11 3 340.

Installation:

Check that drive belt is correctly positioned on pulleys.

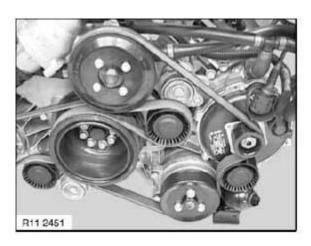


Fig. 186: Identifying Drive Belt Correctly Positioned On Pulleys Courtesy of BMW OF NORTH AMERICA, INC.

11 28 050 REPLACING A/C COMPRESSOR DRIVE BELT WITH BELT TENSIONER (N62/N62TU)

Special tools required:

• 11 3 340

Necessary preliminary tasks:

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- Remove alternator drive belt . See <u>11 28 010 REPLACING ALTERNATOR DRIVE BELT (N62/N62TU)</u>.
- Remove engine splash guard.

NOTE: If the drive belt is to be reused:

Mark direction of travel and reinstall drive belt in same direction of travel.

Pretension belt tensioner slowly and carefully with a Torx socket as far as it will go and secure with special tool 11 3 340.

Remove drive belt.

IMPORTANT: If contaminated with hydraulic fluid: Replace drive belt.

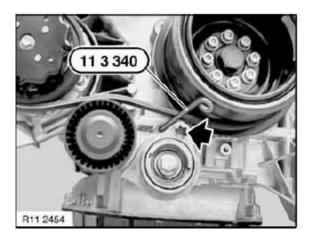


Fig. 187: Identifying Special Tool (11 3 340)
Courtesy of BMW OF NORTH AMERICA, INC.


Put on the drive belt.

Remove special tool 11 3 340.

Installation:

Check that drive belt is correctly positioned on pulleys.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

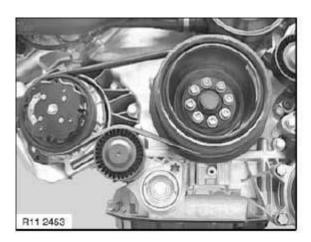

<u>Fig. 188: Identifying Drive Belt Correctly Positioned On Pulleys</u> Courtesy of BMW OF NORTH AMERICA, INC.

11 28 050 REPLACING A/C COMPRESSOR DRIVE BELT (N62TU)

Necessary preliminary tasks:

- Remove <u>ALTERNATOR DRIVE BELT</u>.
- Remove engine splash guard.

Installation: If reusing the drive belt, mark the direction of rotation and reinstall in the same direction. Check drive belt for coolant and oil residues, replace if necessary.

IMPORTANT: If contaminated with hydraulic fluid: Replace drive belt.

Release screw (1) by 180°.

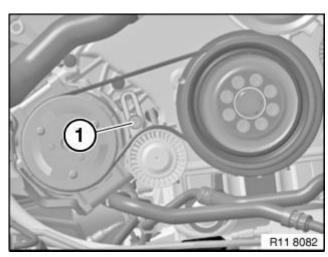


Fig. 189: Release Screw (1) By 180° Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Release screw (1) on tensioning pulley (2).


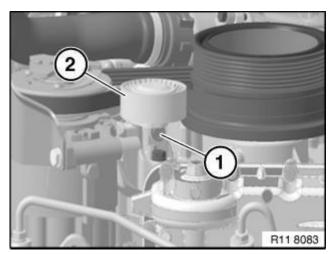


Fig. 190: Release Screw (1) On Tensioning Pulley (2) Courtesy of BMW OF NORTH AMERICA, INC.

Release tensioning pulley (1) until drive belt can be removed. Remove drive belt (2) towards front.

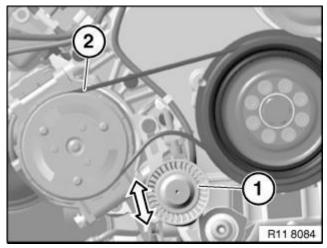

<u>Fig. 191: Remove Drive Belt (2) Towards Front</u> Courtesy of BMW OF NORTH AMERICA, INC.

Check installation position of drive belt.

31 CAMSHAFT

11 31 032 REMOVING AND INSTALLING/REPLACING LEFT INLET CAMSHAFT (N62 FROM 9/03 AND N62TU)

Special tools required:

• 11 9 470

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 11 9 472
- 11 9 473
- 11 9 474
- 11 9 475
- 11 9 480
- 11 9 490


(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU).
- Remove ignition coils on cylinder bank 5 to 8
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove spark plugs on cylinder bank 5 to 8
- Remove left inlet and exhaust adjustment units. See <u>11 36 047 REMOVING AND</u>
 <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u>
 (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

Rotate inlet camshaft against direction of rotation until lettering (1) on 8th cylinder points upwards in cylinder axis and cam is horizontal.

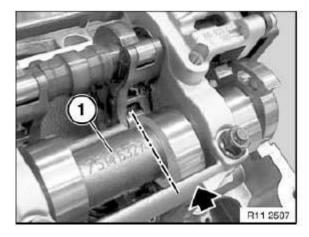


<u>Fig. 192: Locating Camshaft Numbers</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 5 to 8 with R E1 to R E5 from inlet side.

Release nuts and remove bearing cap R E1.

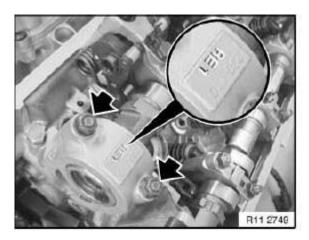

<u>Fig. 193: Locating Camshaft Bearing Caps Nut</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

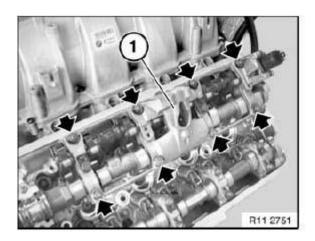

<u>Fig. 194: Locating Nuts Of Bearing Bracket</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Rocker arms are freely accessible after bearing bracket has been removed.

Do "not" remove rocker arm (1) on inlet side.


IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

The tolerance classes are designated as illustrated with the numbers from 1 to 4.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Used rocker arms (1) may only be reused in the same position.

When replacing rocker arms (1) on inlet side: install rocker arms of the same tolerance class in the same position.

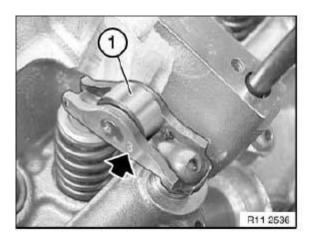

<u>Fig. 195: Locating Rocker Arms On Inlet Side</u> Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

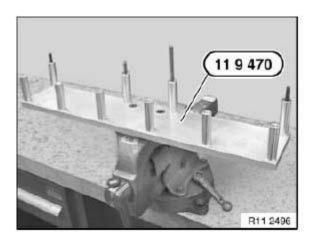


Fig. 196: Identifying Special Tool (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

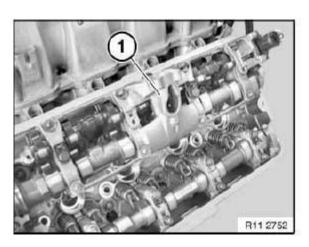


Fig. 197: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).


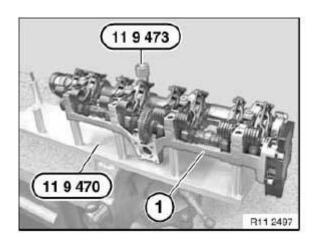


Fig. 198: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.


NOTE: Lower section of bearing bracket (1) remains on cylinder head.

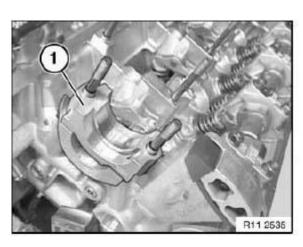

<u>Fig. 199: Identifying Lower Section Of Bearing Bracket On Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: This work step will only be necessary if after the inlet camshaft has been removed the eccentric shaft is also to be removed.

If necessary, remove eccentric shaft sensor (2).

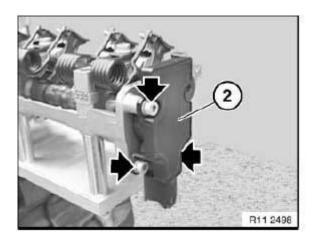

<u>Fig. 200: Locating Eccentric Shaft Sensor</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Removal of the intermediate levers and torsion springs is described on the 8th cylinder. The same procedure is applicable to cylinders 5 to 7.

Raise one end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

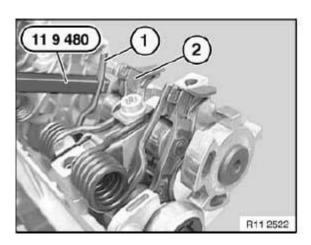


Fig. 201: Identifying Torsion Spring, Intermediate Lever With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9490 to end of torsion spring.

Support end of torsion spring protected with special tool 11 9490 on inlet camshaft.

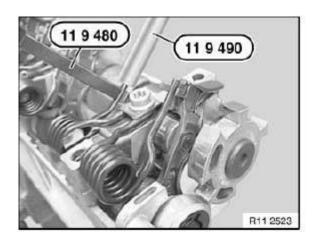


Fig. 202: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.


IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

Used intermediate levers (2) may only be reused in the same position.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

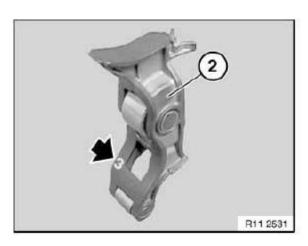


<u>Fig. 203: Locating Intermediate Levers</u> Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

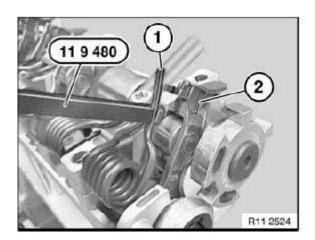


<u>Fig. 204: Identifying Torsion Spring With Special Tool (11 9 480)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9490 to second end of torsion spring.


Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

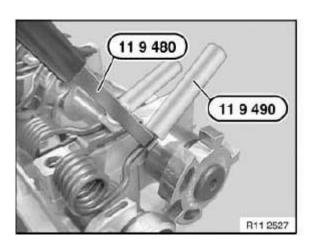


<u>Fig. 205: Identifying Special Tool (11 9 480) And (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1).

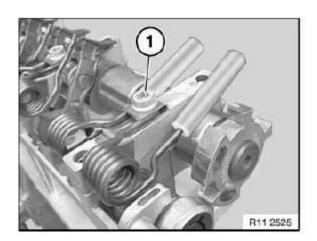

<u>Fig. 206: Identifying Camshaft Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove torsion spring (1) and special tool 11 9 490.

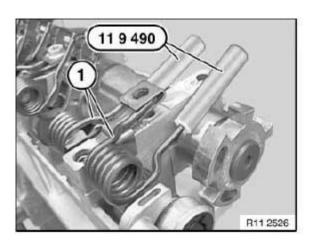

<u>Fig. 207: Identifying Torsion Spring With Special Tool (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove intermediate levers and torsion springs of cylinders 5 to 7 according to the same procedure and set down in an orderly fashion.

Unscrew nut (special tool 11 9 473).

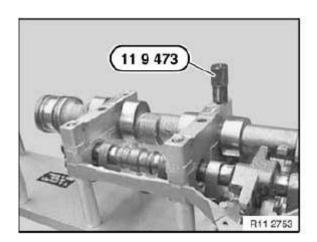



Fig. 208: Identifying Camshaft Nut With Special Tool (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps are marked in graphic with R E2 to R E5.

Remove bearing caps R E2 to R E5 and place to one side in order.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

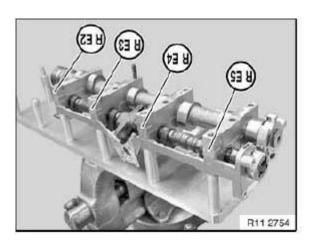

<u>Fig. 209: Identifying Camshaft Bearing Caps Of Cylinders</u> Courtesy of BMW OF NORTH AMERICA, INC.

Lift out inlet camshaft (1).

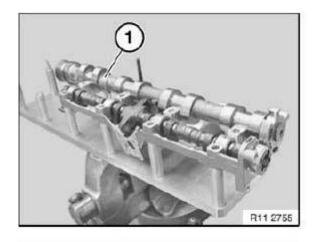


Fig. 210: Identifying Inlet Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Further tasks:

The section Removing and installing left eccentric shaft contains important installation instructions.

If necessary, replace plain compression rings (1).

IMPORTANT: Plain compression rings (1) can easily break.

Plain compression rings (1) are engaged at joint.

Press compression ring (1) on one side into groove, pull up on other side and remove catch.

Carefully pull compression ring (1) apart and remove towards front.


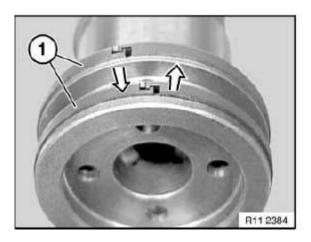


Fig. 211: Pulling Compression Ring Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Inlet camshaft of cylinder bank 5 to 8 is marked with "EIN 58".

If necessary, replace sensor gear (1).

Release screw (2) and remove sensor gear (1).

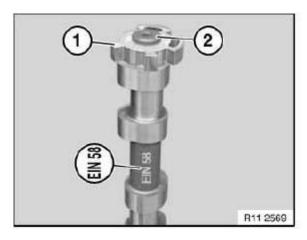

<u>Fig. 212: Identifying Sensor Gear And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of inlet camshaft is described separately from removal.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.

NOTE: Camshaft has a groove and sensor gear has a lug for fastening purposes.

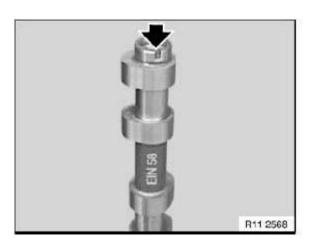


Fig. 213: Locating Camshaft Groove And Sensor Gear Courtesy of BMW OF NORTH AMERICA, INC.

Fit sensor gear (1) and align to groove in camshaft.

Insert screw (2) and tighten down.

Tightening torque 11 31 14AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

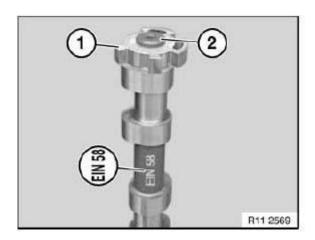



Fig. 214: Identifying Sensor Gear And Screw Courtesy of BMW OF NORTH AMERICA, INC.

Installing plain compression rings (1):

IMPORTANT: Plain compression rings (1) can easily break.


Carefully pull compression ring (1) apart and install from front.

Press compression ring (1) on one side into groove, install catch on other side.

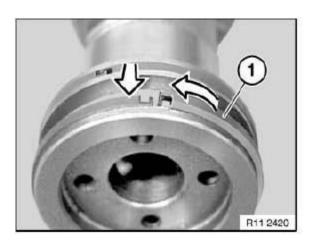

<u>Fig. 215: Installing Plain Compression Rings</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert inlet camshaft (1) so that cams point upwards at cylinder 5 as shown in graphic.

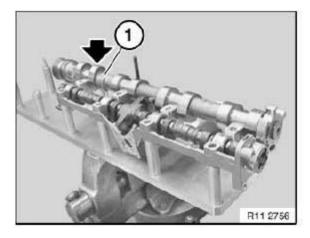


<u>Fig. 216: Locating Inlet Camshaft</u> Courtesy of BMW OF NORTH AMERICA, INC.

Make sure bearing shells (1) of eccentric shaft are engaged in bearing bracket.


NOTE: Bearing shell (1) is guided in a groove in bearing cap.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

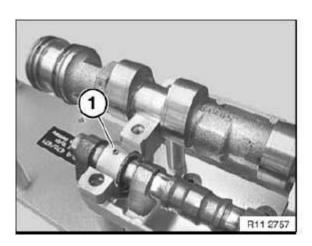

<u>Fig. 217: Identifying Bearing Shell</u> Courtesy of BMW OF NORTH AMERICA, INC.


Check dowel sleeves (1) for damage and correct installation position.

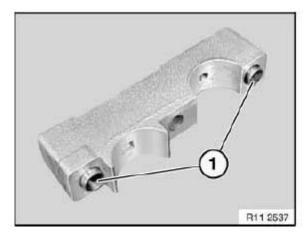

<u>Fig. 218: Identifying Dowel Sleeves</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Bearing caps are marked in graphic with R E2 to R E5.

Fit bearing caps R E2 to R E5.

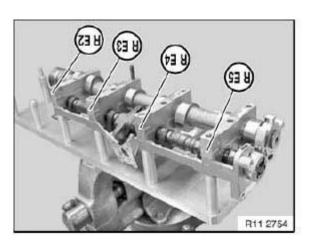

<u>Fig. 219: Identifying Camshaft Bearing Caps Of Cylinders</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Initially tighten special tool 11 9 473 without play only.

Secure bearing bracket and bearing cap with nut (special tool 11 9 473).

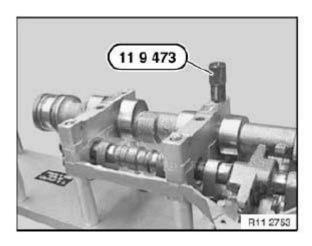


Fig. 220: Identifying Camshaft Nut With Special Tool (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The mounting of the bearing bracket described later can only be performed if the first bearing of the inlet camshaft is aligned with special tool 11 9 472.

Fit special tool 11 9 472 as shown in graphic and align inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

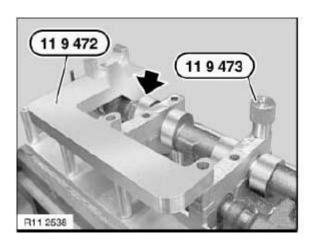


Fig. 221: Locating Special Tool (11 9 472) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

Fit centering sleeves (special tool 11 9 475) and align special tool 11 9 472 to bearing caps 2 and 3.

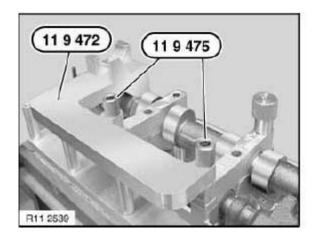


Fig. 222: Identifying Special Tool (11 9 472) And (11 9 475) Courtesy of BMW OF NORTH AMERICA, INC.

Insert special tool 11 9 474 and initially tighten without play.

NOTE: Special tools 11 9 472, 11 9 474 and 11 9 475 remain fitted until all torsion springs and intermediate levers have been installed.

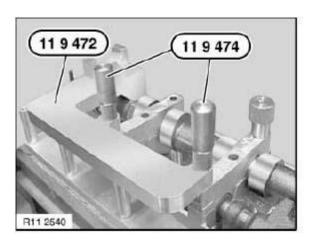


Fig. 223: Identifying Special Tool (11 9 472) And (11 9 474) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Installation of the intermediate levers and torsion springs is described on the 8th cylinder. The same procedure is applicable to cylinders 5 to 7.

Attach special tool 11 9 490 to ends of torsion spring.

Install torsion spring (1).


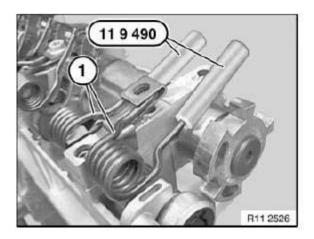


Fig. 224: Identifying Torsion Spring With Special Tool (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Insert screw (1) and tighten down.

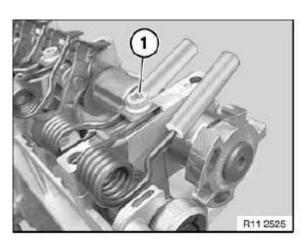

<u>Fig. 225: Identifying Camshaft Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single engine.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

Used intermediate levers (2) may only be reused in the same position.

Lubricate all sliding surfaces on intermediate lever (2) with engine oil.


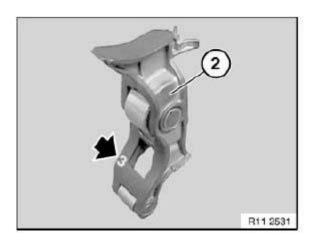


Fig. 226: Locating Intermediate Levers
Courtesy of BMW OF NORTH AMERICA, INC.

Raise torsion spring (1) with special tool 11 9 480.

Remove special tool 11 9 490.

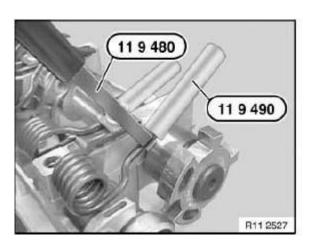

<u>Fig. 227: Identifying Special Tool (11 9 480) And (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).


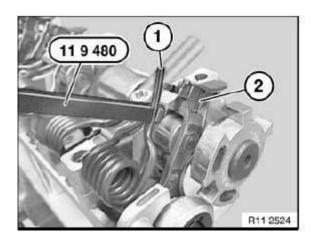


Fig. 228: Identifying Torsion Spring With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring with special tool 11 9 480.

Remove special tool 11 9 490.

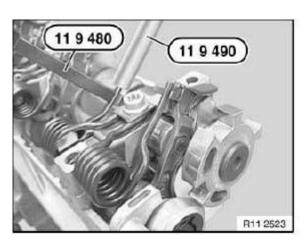

<u>Fig. 229: Identifying Special Tool (11 9 480) And (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).

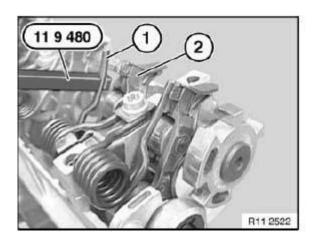


Fig. 230: Identifying Torsion Spring, Intermediate Lever With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Install eccentric shaft sensor (2).

Insert screws and tighten down eccentric shaft sensor (2).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


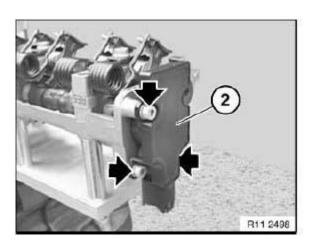


Fig. 231: Locating Eccentric Shaft Sensor Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 474.

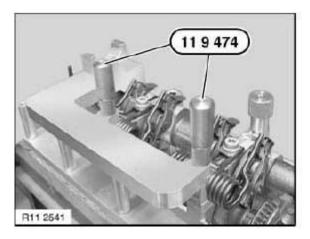

<u>Fig. 232: Identifying Special Tool (11 9 474)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 472 and special tool 11 9 475.


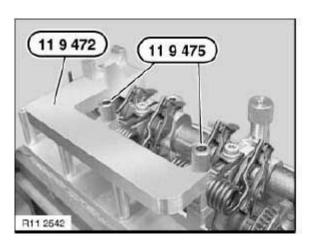


Fig. 233: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

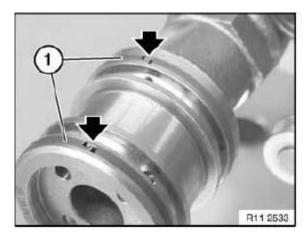

<u>Fig. 234: Locating Compression Rings</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.


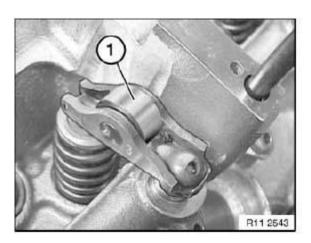


Fig. 235: Identifying Rocker Arms
Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

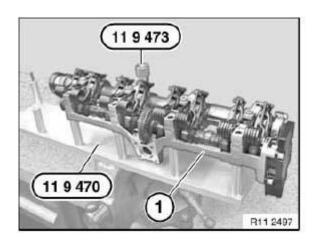

<u>Fig. 236: Identifying Special Tool (11 9 470) And (11 9 473)</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.

IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.


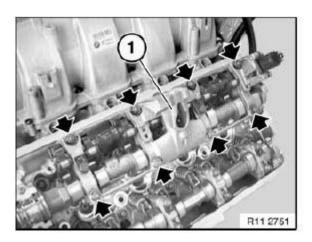


Fig. 237: Locating Nuts Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Fit bearing cap R E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

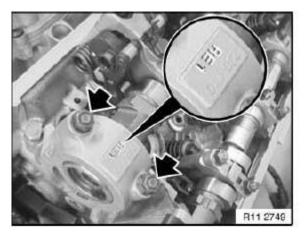

<u>Fig. 238: Locating Camshaft Bearing Caps Nut</u> Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft in direction of rotation until cam on 5th cylinder points upwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

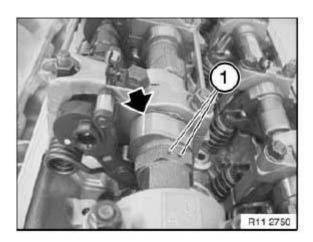


Fig. 239: Locating Marking On Hexagon Drive Of Inlet Camshaft Faces Upwards Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on left side. See <u>11 36 047 REMOVING AND</u> <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).

Install spark plugs on cylinder bank 5 to 8.

Install left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 5 to 8.

Install servomotor for left eccentric shaft. . See <u>11 37 022 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

11 31 034 REMOVING AND INSTALLING/REPLACING RIGHT INLET CAMSHAFT (N62 FROM 9/03 AND N62TU)

Special tools required:

- 11 9 470
- 11 9 472
- 11 9 473
- 11 9 474
- 11 9 475
- 11 9 480
- 11 9 490

(cylinder bank 1 to 4)


ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Necessary preliminary tasks:

- Remove servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND</u> <u>INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.
- Remove ignition coils on cylinder bank 1 to 4
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING</u> RIGHT CYLINDER HEAD COVER (N62/N62TU).
- Remove spark plugs on cylinder bank 1 to 4
- Remove right inlet and exhaust adjustment units. See <u>11 36 048 REMOVING AND</u>
 <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u> (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

Rotate inlet camshaft in direction of rotation until cam on 1st cylinder is positioned horizontally as shown in illustration.

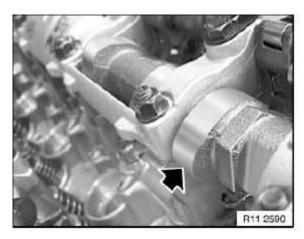

<u>Fig. 240: Locating Camshaft</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 1 to 4 with L E1 to L E5 from inlet side.

Release nuts and remove bearing cap L E1.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

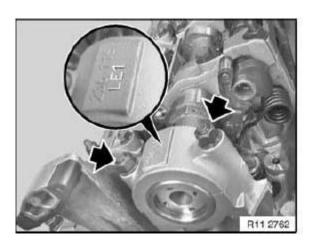


Fig. 241: Locating Bearing Cap L E1 And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

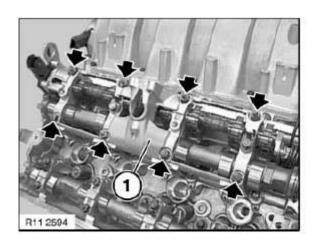


Fig. 242: Locating Camshaft Bearing Bracket And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Rocker arms are freely accessible after bearing bracket has been removed.

Do "not" remove rocker arm (1) on inlet side.


IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

The tolerance classes are designated as illustrated with the numbers from 1 to 4.

Used rocker arms (1) may only be reused in the same position.

When replacing rocker arms (1) on inlet side: install rocker arms of the same tolerance class in the same position.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

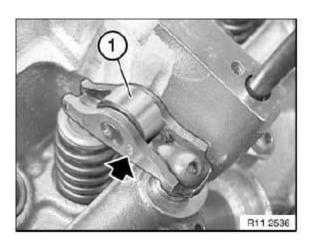

<u>Fig. 243: Locating Rocker Arms On Inlet Side</u> Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

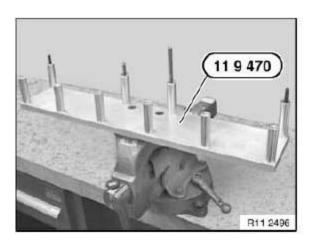


Fig. 244: Identifying Special Tool (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


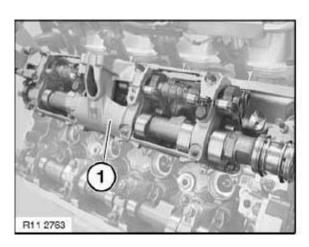


Fig. 245: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).

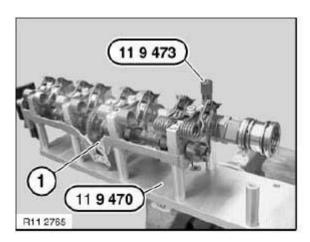

<u>Fig. 246: Identifying Special Tool (11 9 473) And (11 9 470)</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

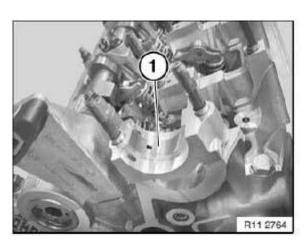


Fig. 247: Identifying Lower Section Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: This work step will only be necessary if after the inlet camshaft has been removed the eccentric shaft is also to be removed.

If necessary, remove eccentric shaft sensor (2).

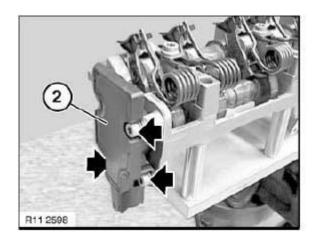


Fig. 248: Locating Eccentric Shaft Sensor Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Removal of the intermediate levers and torsion springs is described on the 4th cylinder. The same procedure is applicable to cylinders 1 to 3.

Raise one end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

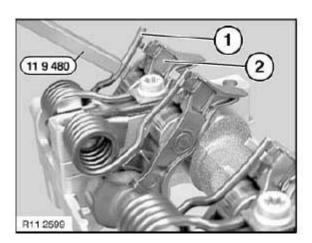


Fig. 249: Identifying Intermediate Lever And Torsion Spring Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

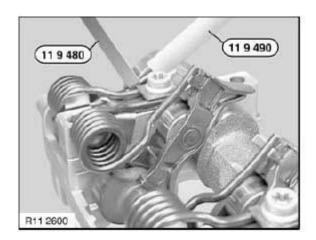


Fig. 250: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

Used intermediate levers (2) may only be reused in the same position.

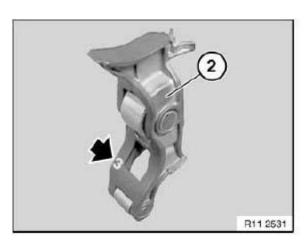


Fig. 251: Locating Intermediate Levers
Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.


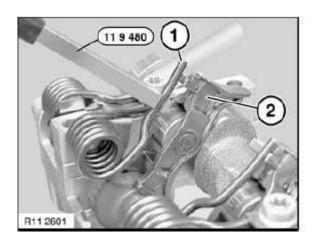


Fig. 252: Identifying Intermediate Lever, Torsion Spring With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to second end of torsion spring.


Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

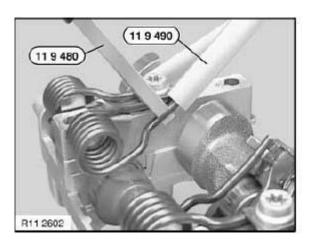


<u>Fig. 253: Identifying Special Tool (11 9 480) And (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1).

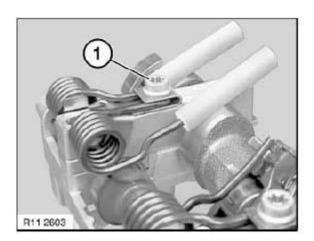

<u>Fig. 254: Identifying Support End Of Torsion Spring</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove torsion spring (1) and special tool 11 9 490.

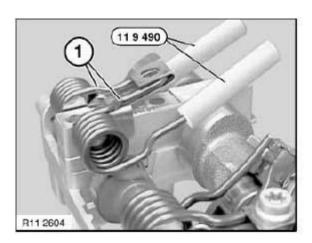

<u>Fig. 255: Identifying Torsion Spring With Special Tool (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove intermediate levers and torsion springs of cylinders 1 to 3 according to the same procedure and set down in an orderly fashion.

Unscrew nut (special tool 11 9 473).


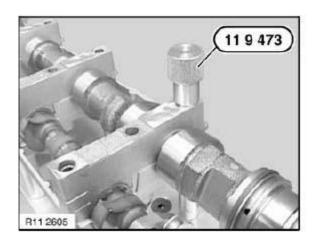


Fig. 256: Identifying Special Tool (11 9 473)
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps are marked in graphic with L E2 to L E5.

Remove bearing caps L E2 to L E5 and place to one side in order.

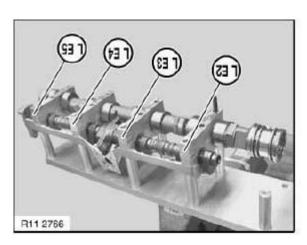

<u>Fig. 257: Identifying Camshaft Bearing Caps Of Cylinders</u> Courtesy of BMW OF NORTH AMERICA, INC.

Lift out inlet camshaft (1).

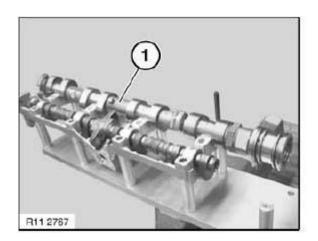


Fig. 258: Identifying Inlet Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Further tasks:

The section Removing and installing right eccentric shaft contains important

installation instructions. See <u>11 37 008 REMOVING AND</u>

INSTALLING/REPLACING RIGHT ECCENTRIC SHAFT (N62 FROM 9/03 AND

N62TU).

If necessary, replace plain compression rings (1).

IMPORTANT: Plain compression rings (1) can easily break.

Plain compression rings (1) are engaged at joint.

Press compression ring (1) on one side into groove, pull up on other side and remove catch.

domingo, 3 de octubre de 2021 12:49:32 a. m.	Page 151	© 2011 Mitchell Repair Information Company, LLC.
--	----------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Carefully pull compression ring (1) apart and remove towards front.


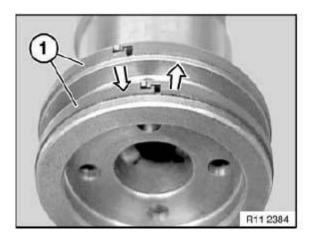


Fig. 259: Pulling Compression Ring Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Inlet camshaft of cylinder bank 1 to 4 is marked with "EIN 14".

If necessary, replace sensor gear (1).

Release screw (2) and remove sensor gear (1).

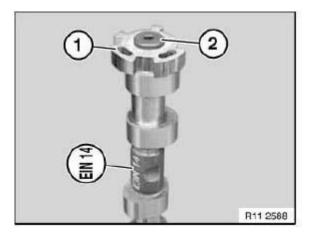

<u>Fig. 260: Identifying Sensor Gear And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation

Installation of inlet camshaft is described separately from removal.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.

NOTE: Camshaft has a groove and sensor gear has a lug for fastening purposes.


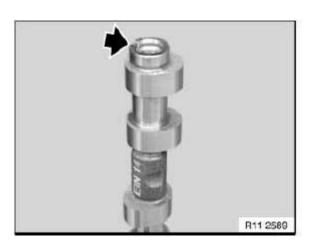


Fig. 261: Locating Camshaft Groove And Sensor Gear Courtesy of BMW OF NORTH AMERICA, INC.

Fit sensor gear (1) and align to groove in camshaft.

Insert screw (2) and tighten down.

Tightening torque 11 31 14AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

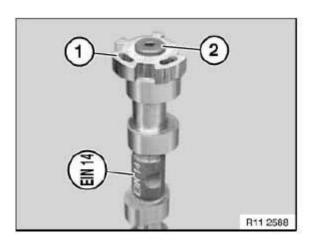


<u>Fig. 262: Identifying Sensor Gear And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installing plain compression rings (1):

IMPORTANT: Plain compression rings (1) can easily break.


Carefully pull compression ring (1) apart and install from front.

Press compression ring (1) on one side into groove, install catch on other side.

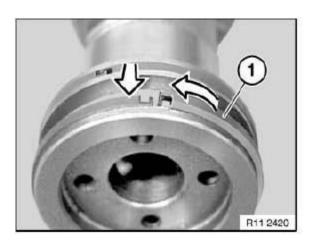

<u>Fig. 263: Installing Plain Compression Rings</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert inlet camshaft (1) so that cams point upwards at 4th cylinder as shown in graphic.

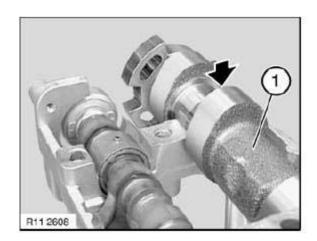


<u>Fig. 264: Locating Inlet Camshaft</u> Courtesy of BMW OF NORTH AMERICA, INC.

Make sure bearing shells (1) of eccentric shaft are engaged in bearing bracket.


NOTE: Bearing shell (1) is guided in a groove in bearing cap.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

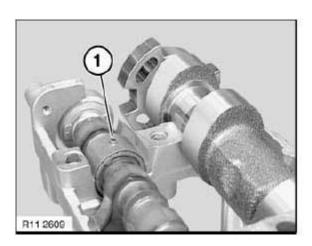

<u>Fig. 265: Identifying Bearing Shell</u> Courtesy of BMW OF NORTH AMERICA, INC.


Check dowel sleeves (1) for damage and correct installation position.

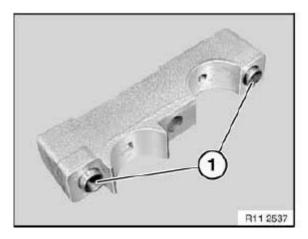

<u>Fig. 266: Identifying Dowel Sleeves</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Bearing caps are marked in graphic with L E2 to L E5.


Fit bearing caps L E2 to L E5.

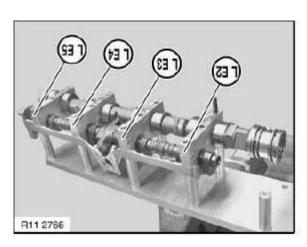

<u>Fig. 267: Identifying Camshaft Bearing Caps Of Cylinders</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Initially tighten special tool 11 9 473 without play only.

Secure bearing bracket and bearing cap with nut (special tool 11 9 473).

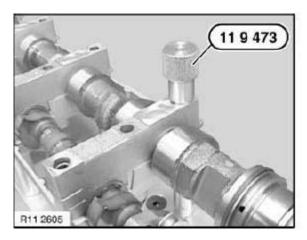


<u>Fig. 268: Identifying Special Tool (11 9 473)</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The mounting of the bearing bracket described later can only be performed if the first bearing of the inlet camshaft is aligned with special tool 11 9 472.


Fit special tool 11 9 472 as shown in graphic and align inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

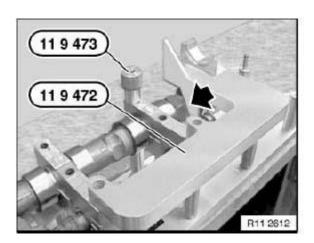

<u>Fig. 269: Locating Special Tool (11 9 473) And (11 9 472)</u> Courtesy of BMW OF NORTH AMERICA, INC.


Fit centering sleeves (special tool 11 9 475) and align special tool 11 9 472 to bearing caps 2 and 3.

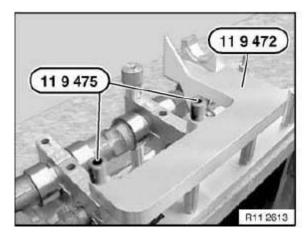

<u>Fig. 270: Identifying Special Tool (11 9 475) And (11 9 472)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert special tool 11 9 474 and initially tighten without play.

NOTE: Special tools 11 9 472, 11 9 474 and 11 9 475 remain fitted until all torsion springs and intermediate levers have been installed.

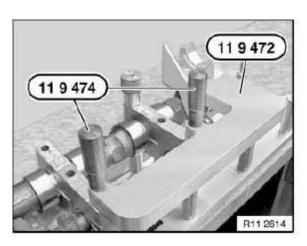

<u>Fig. 271: Identifying Special Tool (11 9 474) And (11 9 472)</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Installation of the intermediate levers and torsion springs is described on the 4th cylinder.

The same procedure is applicable to cylinders 1 to 3.

Attach special tool 11 9 490 to ends of torsion spring.

Install torsion spring (1).


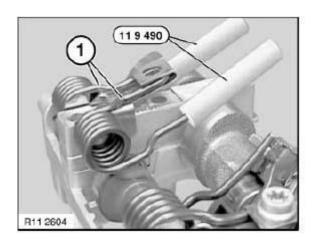


Fig. 272: Identifying Torsion Spring With Special Tool (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Insert screw (1) and tighten down.

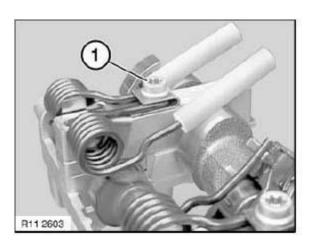

engine.

Fig. 273: Identifying Support End Of Torsion Spring Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single

The tolerance classes are designated as illustrated with the numbers from 1 to

Used intermediate levers (2) may only be reused in the same position.

Lubricate all sliding surfaces on intermediate lever (2) with engine oil.

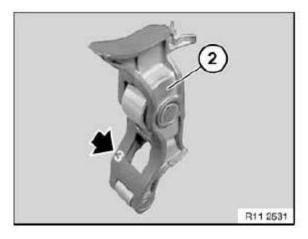


Fig. 274: Locating Intermediate Levers
Courtesy of BMW OF NORTH AMERICA, INC.

Raise torsion spring (1) with special tool 11 9 480.

Remove special tool 11 9 490.

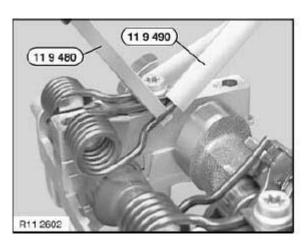


Fig. 275: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).


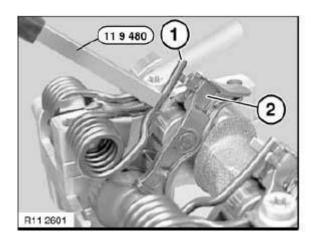


Fig. 276: Identifying Intermediate Lever, Torsion Spring With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring with special tool 11 9 480.

Remove special tool 11 9 490.

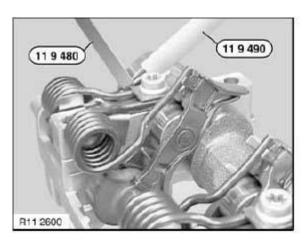


<u>Fig. 277: Identifying Special Tool (11 9 480) And (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).

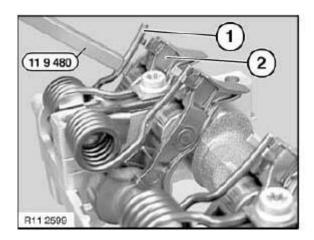

<u>Fig. 278: Identifying Intermediate Lever And Torsion Spring</u> Courtesy of BMW OF NORTH AMERICA, INC.

Install eccentric shaft sensor (2).

Insert screws and tighten down eccentric shaft sensor (2).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

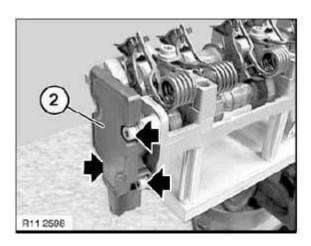


Fig. 279: Locating Eccentric Shaft Sensor Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 474.

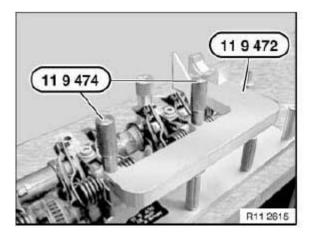


Fig. 280: Identifying Special Tool (11 9 474) And (11 9 472) Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 472 and special tool 11 9 475.

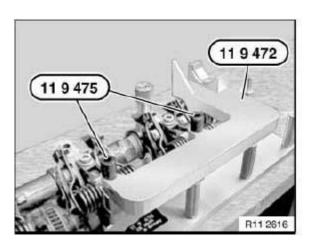


Fig. 281: Identifying Special Tool (11 9 474) And (11 9 472) Courtesy of BMW OF NORTH AMERICA, INC.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

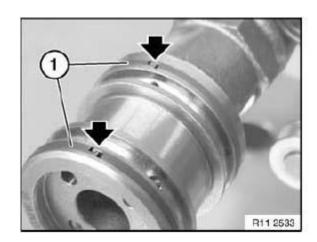


Fig. 282: Locating Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.


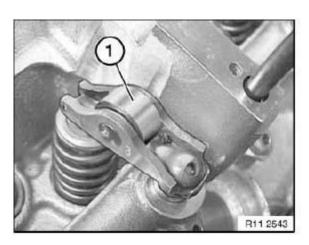


Fig. 283: Identifying Rocker Arms
Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

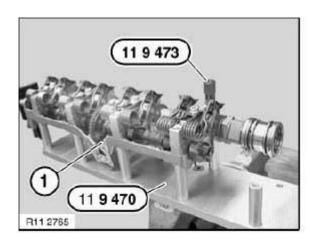

<u>Fig. 284: Identifying Special Tool (11 9 473) And (11 9 470)</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.


IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

domingo, 3 de octubre de 2021 12:49:32 a.m.	Page 164	© 2011 Mitchell Repair Information Company, LLC.
---	----------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

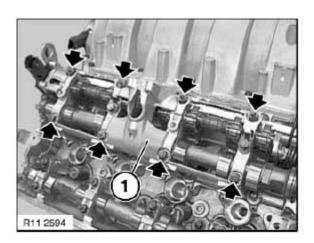

<u>Fig. 285: Locating Camshaft Bearing Bracket And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

Fit bearing cap L E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

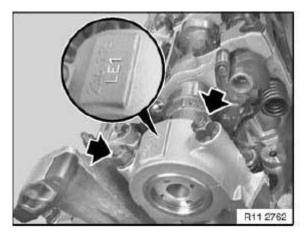


Fig. 286: Locating Bearing Cap L E1 And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft at hexagon head against direction of rotation until cam on 1st cylinder points downwards at an angle as shown in graphic.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

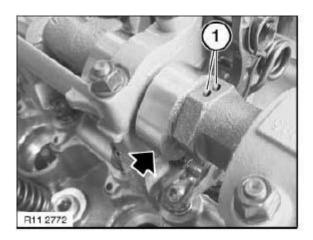


Fig. 287: Locating Marking On Hexagon Drive Of Inlet Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on right side. See 11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE (N62/N62TU).

Install spark plugs on cylinder bank 1 to 4.

Install right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT</u> <u>CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 1 to 4.

Install servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

11 31 036 REMOVING AND INSTALLING/REPLACING LEFT EXHAUST CAMSHAFT (N62/N62TU)

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND</u> <u>INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.
- Remove ignition coils on cylinder bank 5 to 8
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).
- Remove spark plugs on cylinder bank 5 to 8
- Remove left inlet and exhaust adjustment units . See <u>11 36 047 REMOVING AND</u>

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE (N62/N62TU).

Remove slide rail (1).

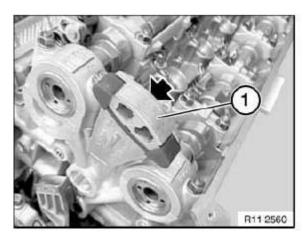


Fig. 288: Identifying Slide Rail Courtesy of BMW OF NORTH AMERICA, INC.

Rotate exhaust camshaft at hexagon head until exhaust cam on cylinder (6) is facing upwards.

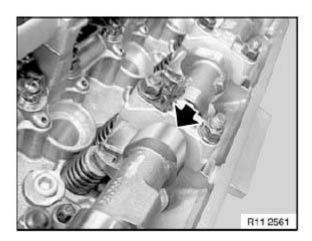



Fig. 289: Locating Exhaust Camshaft On Cylinder Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of exhaust camshaft are marked on cylinder bank 5 to 8 with R A1 to R A5 from inlet side.

Release nuts and remove bearing cap R A1.


ENGINE Engine - Repair Instructions - X5 (N62TU V8)

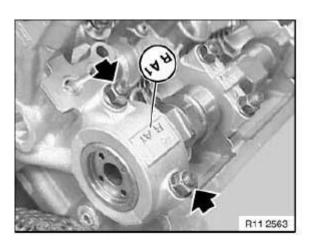

<u>Fig. 290: Identifying Camshaft Bearing Caps Of Cylinders</u> Courtesy of BMW OF NORTH AMERICA, INC.


NOTE: Retaining clips (1) for oil line are fitted on bearing caps 3 and 5.

Release nuts on bearing caps R A2 to R A5.

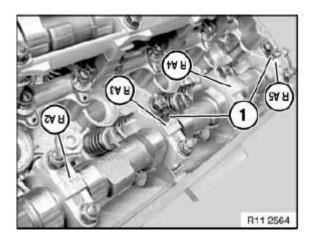

<u>Fig. 291: Identifying Retaining Clips For Oil Line Fitted On Bearing Caps</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove bearing caps R A2 to R A5.

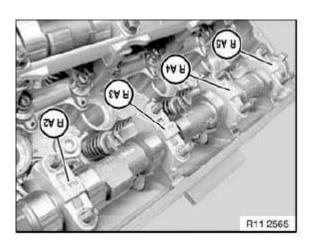

<u>Fig. 292: Identifying Camshaft Bearing Caps Of Cylinders</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove exhaust camshaft (1).

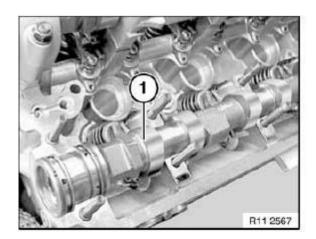


Fig. 293: Identifying Exhaust Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

If necessary, replace plain compression rings (1).

IMPORTANT: Plain compression rings (1) can easily break.

Plain compression rings (1) are engaged at joint.

Press compression ring (1) on one side into groove, pull up on other side and remove catch.

Carefully pull compression ring (1) apart and remove towards front.


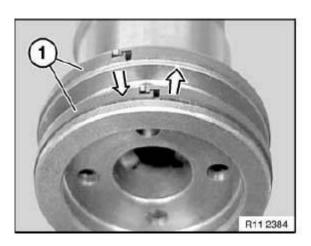


Fig. 294: Pulling Compression Ring Courtesy of BMW OF NORTH AMERICA, INC.

If necessary, replace sensor gear (1).

Release screw (2) and remove sensor gear (1).

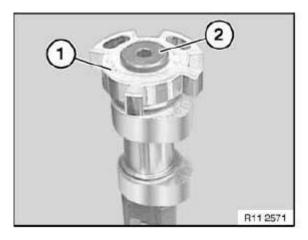

<u>Fig. 295: Identifying Sensor Gear And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of exhaust camshaft is described separately from removal.

Clean all bearings and cams of exhaust camshaft and lubricate with engine oil.

NOTE: Camshaft has a groove and sensor gear has a lug for fastening purposes.



<u>Fig. 296: Locating Camshaft Groove And Sensor Gear</u> Courtesy of BMW OF NORTH AMERICA, INC.

Fit sensor gear (1) and align to groove in camshaft.

Insert screw (2) and tighten down.

Tightening torque 11 31 14AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

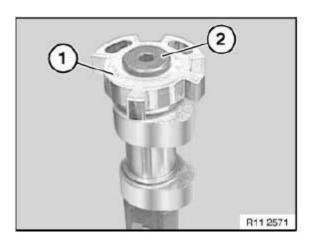


Fig. 297: Identifying Sensor Gear And Screw Courtesy of BMW OF NORTH AMERICA, INC.


Installing plain compression rings (1):

IMPORTANT: Plain compression rings (1) can easily break.

Carefully pull compression ring (1) apart and install from front.

Press compression ring (1) on one side into groove, install catch on other side.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

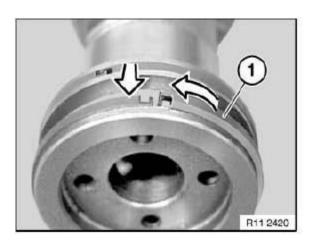

<u>Fig. 298: Installing Plain Compression Rings</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Rocker arms (1) of exhaust camshaft are of same design as rocker arms of inlet camshaft.

The classification 3 shown in the graphic has no effect on the function on the exhaust camshaft.

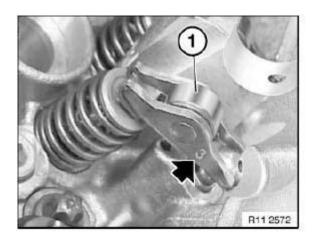



Fig. 299: Locating Rocker Arms Of Exhaust Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) slip slightly when exhaust camshaft is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Used rocker arms (1) may only be reused in the same position.

Align rockers (1) straight.

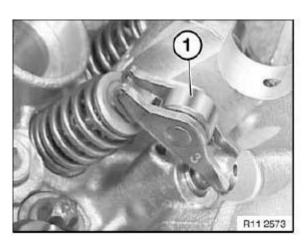

<u>Fig. 300: Identifying Rocker Arms</u> Courtesy of BMW OF NORTH AMERICA, INC.

Lubricate exhaust camshaft and bearing caps with engine oil.

Install exhaust camshaft (1).

Rotate exhaust camshaft (1) until exhaust cam on cylinder 6 is facing upwards.

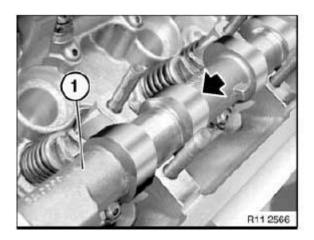


Fig. 301: Identifying Exhaust Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

Check dowel sleeves (2) for damage and correct installation position.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

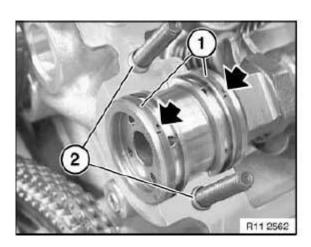


Fig. 302: Locating Dowel Sleeves And Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of exhaust camshaft are marked on cylinder bank 5 to 8 with R A1 to R A5 from inlet side.

Fit bearing caps R A2 to R A5.

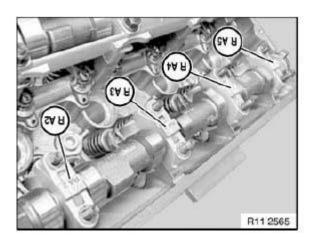


Fig. 303: Identifying Camshaft Bearing Caps Of Cylinders Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Retaining clips (1) for oil line are fitted on bearing caps 3 and 5.

Insert nuts and tighten by hand without play.

Tighten down nuts on bearing caps R A2 to R A5 in 1/2 turn increments evenly from inside to outside.

Tightening torque 11 31 1AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

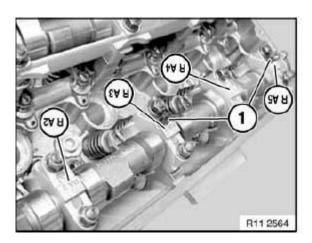



Fig. 304: Identifying Retaining Clips For Oil Line Fitted On Bearing Caps Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

Fit bearing cap R A1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

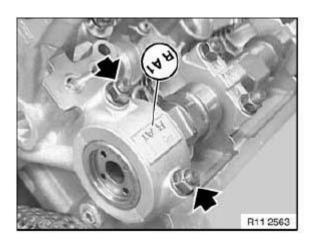

<u>Fig. 305: Identifying Camshaft Bearing Caps Of Cylinders</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: A gasket (2) is installed between cylinder head and slide rail (1).

Replace gasket (2) and preinstall on slide rail (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


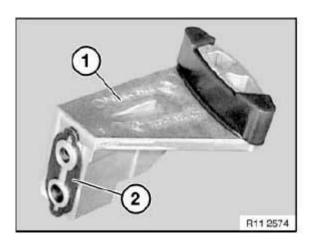


Fig. 306: Identifying Cylinder Head And Slide Rail Courtesy of BMW OF NORTH AMERICA, INC.

Install slide rail (1) with gasket, insert screw and tighten down.

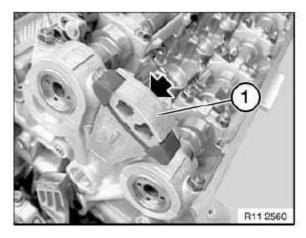

<u>Fig. 307: Identifying Slide Rail</u> Courtesy of BMW OF NORTH AMERICA, INC.

Rotate exhaust camshaft against direction of rotation until cam on 5th cylinder points upwards at an angle as shown in illustration.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)



Fig. 308: Locating Exhaust Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on left side . See <u>11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).

Install spark plugs on cylinder bank 5 to 8.

Install left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).

Install ignition coils on cylinder bank 5 to 8.

Assemble engine.

11 31 038 REMOVING AND INSTALLING/REPLACING RIGHT EXHAUST CAMSHAFT (N62/N62TU)

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Remove servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND</u> <u>INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.
- Remove ignition coils on cylinder bank 1 to 4
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove spark plugs on cylinder bank 1 to 4
- Remove right inlet and exhaust adjustment units . See <u>11 36 048 REMOVING AND</u> <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u> (N62/N62TU).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Remove slide rail (1).

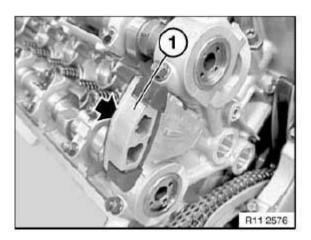


Fig. 309: Locating Slide Rail Courtesy of BMW OF NORTH AMERICA, INC.

Rotate exhaust camshaft at hexagon head against direction of rotation until exhaust cam on cylinder (2) faces upwards.

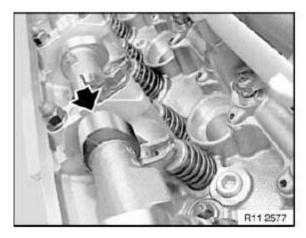



Fig. 310: Locating Exhaust Camshaft On Cylinder Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of exhaust camshaft are marked on cylinder bank 1 to 4 with L A1 to L A5 from inlet side.

Release nuts and remove bearing cap L A1.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

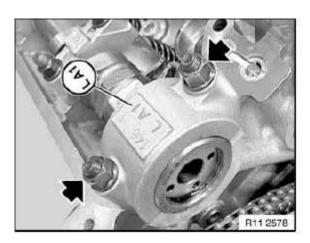

<u>Fig. 311: Locating Bearing Cap L A1 And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Retaining clips (1) for oil line are fitted on bearing caps 3 and 5.

Release nuts on bearing caps L A2 to L A5.

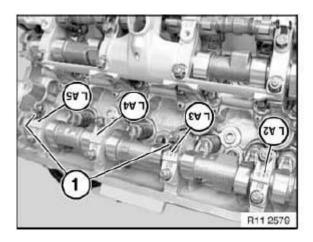


Fig. 312: Identifying Retaining Clips For Oil Line Fitted On Bearing Caps Courtesy of BMW OF NORTH AMERICA, INC.

Remove bearing caps L A2 to L A5.

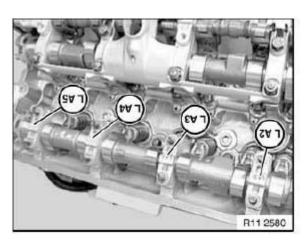


Fig. 313: Identifying Bearing Caps L A2 To L A5 Courtesy of BMW OF NORTH AMERICA, INC.

Remove exhaust camshaft (1).

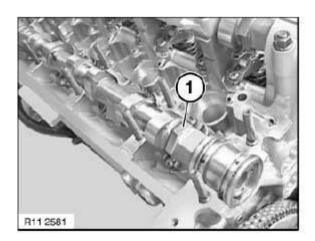


Fig. 314: Identifying Exhaust Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

If necessary, replace plain compression rings (1).

IMPORTANT: Plain compression rings (1) can easily break.

Plain compression rings (1) are engaged at joint.

Press compression ring (1) on one side into groove, pull up on other side and remove catch.

Carefully pull compression ring (1) apart and remove towards front.


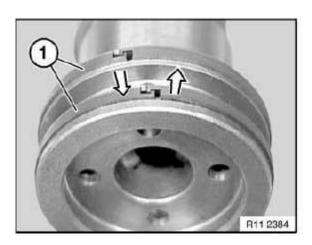


Fig. 315: Pulling Compression Ring Courtesy of BMW OF NORTH AMERICA, INC.

If necessary, replace sensor gear (1).

Release screw (2) and remove sensor gear (1).

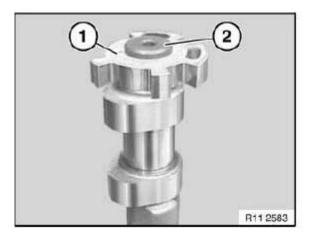


<u>Fig. 316: Identifying Sensor Gear And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of exhaust camshaft is described separately from removal.

Clean all bearings and cams of exhaust camshaft and lubricate with engine oil.

NOTE: Camshaft has a groove and sensor gear has a lug for fastening purposes.

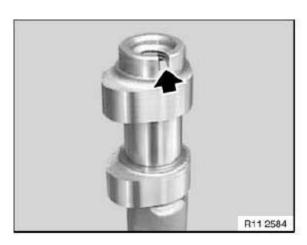

<u>Fig. 317: Locating Camshaft Groove And Sensor Gear</u> Courtesy of BMW OF NORTH AMERICA, INC.

Fit sensor gear (1) and align to groove in camshaft.

Insert screw (2) and tighten down.

Tightening torque 11 31 14AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

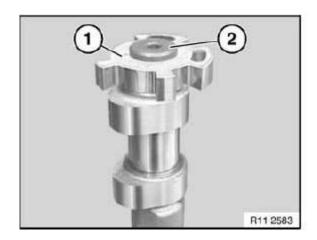


Fig. 318: Identifying Sensor Gear And Screw Courtesy of BMW OF NORTH AMERICA, INC.

Installing plain compression rings (1):

IMPORTANT: Plain compression rings (1) can easily break.

Carefully pull compression ring (1) apart and install from front.

Press compression ring (1) on one side into groove, install catch on other side.

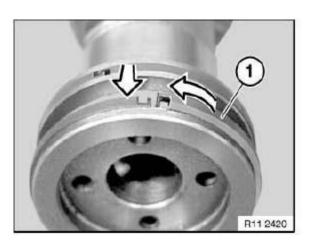


Fig. 319: Installing Plain Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Rocker arms (1) of exhaust camshaft are of same design as rocker arms of inlet camshaft.

The classification 3 shown in the graphic has no effect on the function on the exhaust camshaft.

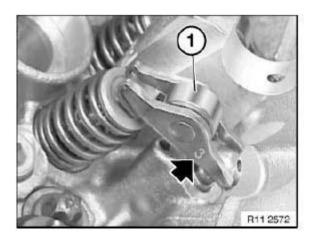



Fig. 320: Locating Rocker Arms Of Exhaust Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) slip slightly when exhaust camshaft is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Used rocker arms (1) may only be reused in the same position.

Align rockers (1) straight.

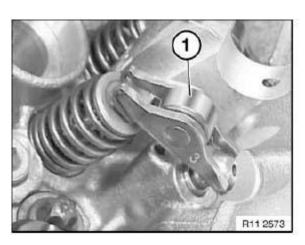


<u>Fig. 321: Identifying Rocker Arms</u> Courtesy of BMW OF NORTH AMERICA, INC.

Lubricate exhaust camshaft and bearing caps with engine oil.

Install exhaust camshaft (1).

Rotate exhaust camshaft (1) until exhaust cam on cylinder 2 is facing upwards.

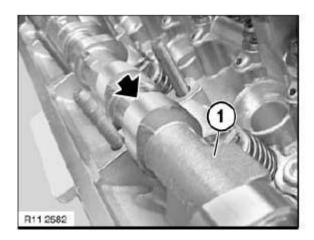

<u>Fig. 322: Locating Exhaust Camshaft And Bearing Caps</u> Courtesy of BMW OF NORTH AMERICA, INC.

Check dowel sleeves (2) for damage and correct installation position.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

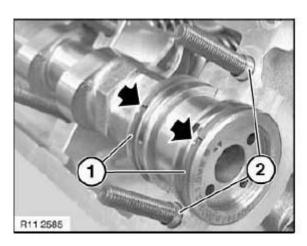


Fig. 323: Locating Dowel Sleeves And Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of exhaust camshaft are marked on cylinder bank 1 to 4 with L A1 to L A5 from inlet side.

Fit bearing caps L A2 to L A5.

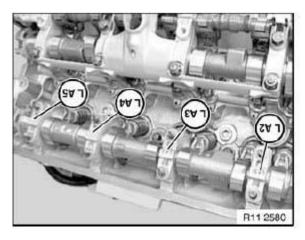


Fig. 324: Identifying Bearing Caps L A2 To L A5 Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Retaining clips (1) for oil line are fitted on bearing caps 3 and 5.

Insert nuts and tighten by hand without play.

Tighten down nuts on bearing caps L A2 to L A5 in 1/2 turn increments evenly from inside to outside.

Tightening torque 11 31 1AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

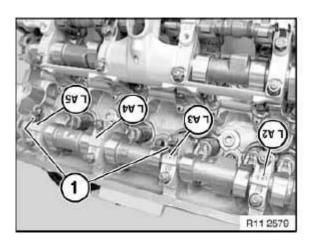



Fig. 325: Identifying Retaining Clips For Oil Line Fitted On Bearing Caps Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

Fit bearing cap L A1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

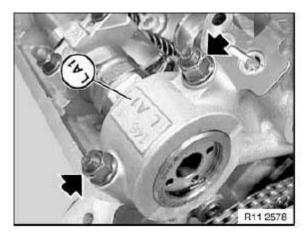


<u>Fig. 326: Locating Bearing Cap L A1 And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: A gasket (2) is installed between cylinder head and slide rail (1).


Replace gasket (2) and preinstall on slide rail (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

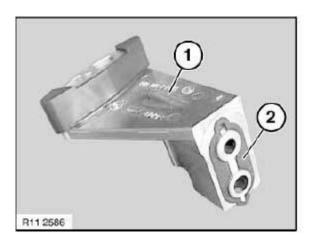

<u>Fig. 327: Identifying Cylinder Head And Slide Rail</u> Courtesy of BMW OF NORTH AMERICA, INC.

Install slide rail (1) with gasket, insert screw and tighten down.

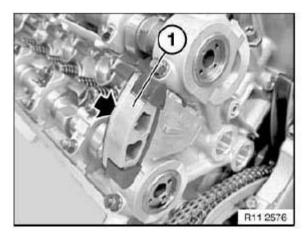

<u>Fig. 328: Locating Slide Rail</u> Courtesy of BMW OF NORTH AMERICA, INC.

Rotate exhaust camshaft against direction of rotation until cam on 1st cylinder points upwards at an angle as shown in graphic.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

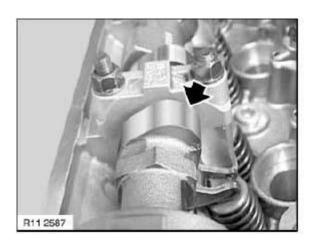


Fig. 329: Locating Cam On 1st Cylinder Points Angle Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on right side . See <u>11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE (N62/N62TU)</u>.

Install spark plugs on cylinder bank 1 to 4.

Install right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT</u> <u>CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 1 to 4.

Assemble engine.

11 31 052 REPLACING BOTH TIMING CHAINS (N62/N62TU)

Special tools required:

- 11 2 001
- 11 2 002
- 11 2 003
- 11 2 007

Necessary preliminary tasks:

• Remove lower timing case cover . See <u>11 14 110 REMOVING AND INSTALLING BOTTOM</u> TIMING CASE COVER (N62/N62TU).

Remove timing chain (1).

Remove timing chain (5).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Release screws (7).

Remove guide rails (3 and 6).


Remove tensioning rails (2 and 4).

Installation:

Maintain tension of timing chains when installing timing case cover.

Observe sparking protection on timing case cover.

Make sure timing chain (1) is correctly installed when placing it in guide rail (3).

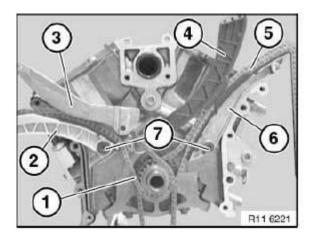

<u>Fig. 330: Identifying Timing Chains, Screws And Guide Rails</u> Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tools 11 2 001 and 11 2 002 to crankshaft.

Insert special tool 11 2 007 and remove sprocket wheel with special tool 11 2 003.

Installation:

Check sprocket wheels for wear, replace if necessary.

Heat sprocket wheel to 60°C.

WARNING: Burning hazard! Wear gloves.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

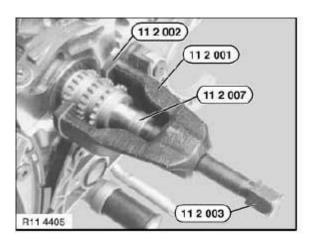


Fig. 331: Identifying Special Tool (11 2 007), (11 2 001), (11 2 003) Courtesy of BMW OF NORTH AMERICA, INC.

Assemble engine.

11 31 070 CHECKING CAMSHAFT TIMING ON LEFT SIDE (N62/N62TU)

Special tools required:

- 11 9 190
- 11 9 461
- 11 9 462

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU).
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.

Remove all spark plugs on cylinder bank 5 to 8.

If necessary, remove fan cowl.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Release screw (1).

Unclip oil line (3) from retainers (2) and remove.


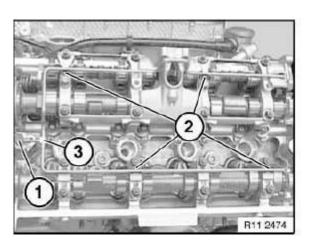


Fig. 332: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

Crank engine at central bolt in direction of rotation to firing TDC position of 1st cylinder.

NOTE: With 1st cylinder in firing TDC position, cams of inlet and exhaust camshafts at 5th cylinder point upwards at an angle as shown in illustration.

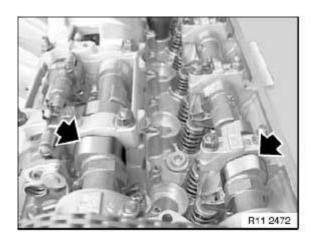

<u>Fig. 333: Locating Cam Lobe Position</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Alignment hole for TDC position is at front on timing case cover.

Crank engine at central bolt and secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

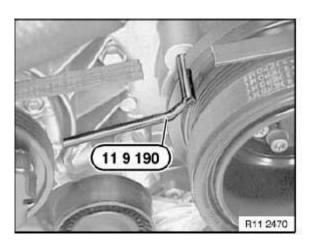


Fig. 334: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: When the engine is shut down, the inlet and exhaust adjustment unit is normally locked in its initial position.

The situation may arise in some individual cases where this initial position is not reached and the camshaft can continue to be rotated in the adjustment range of the adjustment unit.

In order to avoid incorrect timing adjustment, it is essential to check the locking of the adjustment unit and if necessary perform locking by rotating the camshafts.


Checking locking of inlet adjustment unit in initial position:

Engage hexagon head of inlet camshaft and attempt to rotate inlet camshaft carefully against direction of rotation.

If there is no fixed connection between inlet camshaft and inlet adjustment unit, rotate inlet camshaft against direction of rotation as far as it will go.

The inlet adjustment unit is locked in the initial position when the inlet camshaft is non-positively connected to the inlet adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

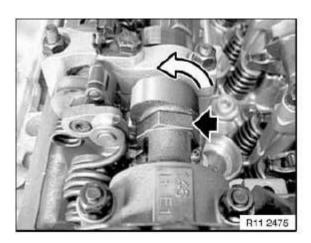

<u>Fig. 335: Rotating Inlet Camshaft</u> Courtesy of BMW OF NORTH AMERICA, INC.

Checking locking of exhaust adjustment unit in initial position:

Engage hexagon head of exhaust camshaft and attempt to rotate exhaust camshaft carefully in direction of rotation.

If there is no fixed connection between exhaust camshaft and exhaust adjustment unit, rotate exhaust camshaft in direction of rotation as far as it will go.

The exhaust adjustment unit is locked in the initial position when the exhaust camshaft is non-positively connected to the exhaust adjustment unit.

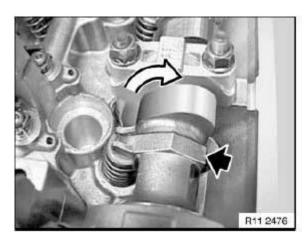


Fig. 336: Rotating Exhaust Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: If the inlet or exhaust adjustment unit of the camshafts "cannot" be locked as described, the adjustment unit is faulty and must be replaced.

Place special tool 11 9 461 on inlet camshaft and check timing.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

Remove special tool 11 9 461 from inlet camshaft.

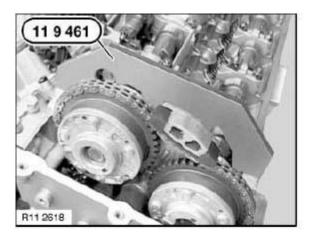


Fig. 337: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

If necessary, adjust camshaft timing on left side . See <u>11 31 573 ADJUSTING CAMSHAFT TIMING ON</u> LEFT SIDE (N62/N62TU).

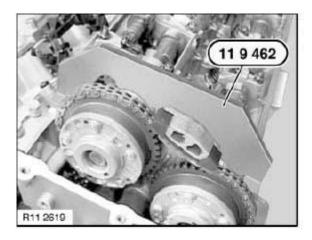


Fig. 338: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Remove all special tools.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Clip oil line (3) into retainers (2).

Insert screw (1) and tighten down.

Assemble engine.

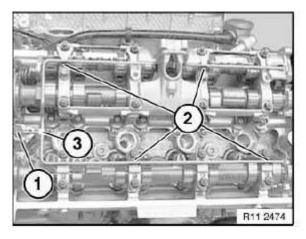


Fig. 339: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

11 31 071 CHECKING CAMSHAFT TIMING ON RIGHT SIDE (N62/N62TU)

Special tools required:

- 11 9 190
- 11 9 461
- 11 9 462

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Remove servomotor from right eccentric shaft . See <u>11 37 024 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU).
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING</u> RIGHT CYLINDER HEAD COVER (N62/N62TU).
- Remove all spark plugs on cylinder bank 1 to 4
- If necessary, remove fan cowl.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Release screw (1).

Unclip oil line (3) from retainers (2) and remove.

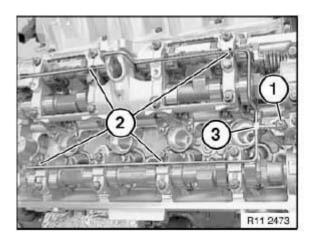


Fig. 340: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

Crank engine at central bolt in direction of rotation to firing TDC position of 1st cylinder.

NOTE: In firing TDC position, cam of exhaust camshaft at 1st cylinder points upwards at an angle.

Cam of inlet camshaft points downwards at an angle:

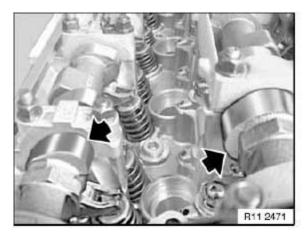


Fig. 341: Locating Cam Lobe Position
Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Alignment hole for TDC position is at front on timing case cover.

Crank engine at central bolt and secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

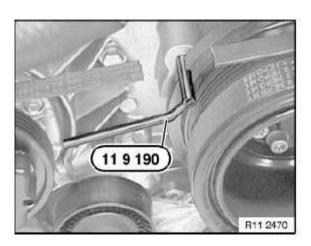


Fig. 342: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: When the engine is shut down, the inlet and exhaust adjustment unit is normally locked in its initial position.

The situation may arise in some individual cases where this initial position is not reached and the camshaft can continue to be rotated in the adjustment range of the adjustment unit.


In order to avoid incorrect timing adjustment, it is essential to check the locking of the adjustment unit and if necessary perform locking by rotating the camshafts.

Checking locking of inlet adjustment unit in initial position:

Engage hexagon head of inlet camshaft and attempt to rotate inlet camshaft carefully against direction of rotation.

If there is no fixed connection between inlet camshaft and inlet adjustment unit, rotate inlet camshaft against direction of rotation as far as it will go.

The inlet adjustment unit is locked in the initial position when the inlet camshaft is non-positively connected to the inlet adjustment unit.

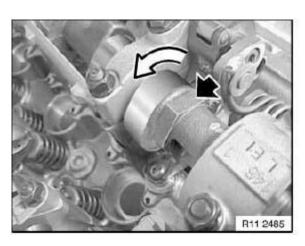

<u>Fig. 343: Rotating Inlet Camshaft</u> Courtesy of BMW OF NORTH AMERICA, INC.

Checking locking of exhaust adjustment unit in initial position:

Engage hexagon head of exhaust camshaft and attempt to rotate exhaust camshaft carefully in direction of rotation.

If there is no fixed connection between exhaust camshaft and exhaust adjustment unit, rotate exhaust camshaft in direction of rotation as far as it will go.

The exhaust adjustment unit is locked in the initial position when the exhaust camshaft is non-positively connected to the exhaust adjustment unit.

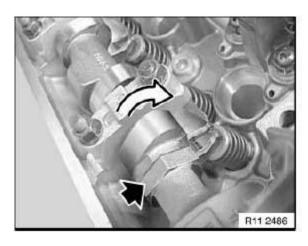


Fig. 344: Rotating Exhaust Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: If the inlet or exhaust adjustment unit of the camshafts "cannot" be locked as described, the adjustment unit is faulty and must be replaced.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

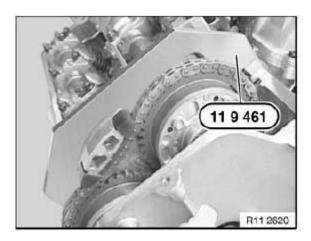


Fig. 345: Identifying Special Tool (11 9 461)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

If necessary, adjust camshaft timing on right side . See <u>11 31 574 ADJUSTING CAMSHAFT TIMING ON</u> RIGHT SIDE (N62/N62TU).

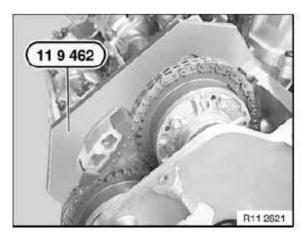


Fig. 346: Identifying Special Tool (11 9 462)
Courtesy of BMW OF NORTH AMERICA, INC.

Remove all special tools.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Clip oil line (3) into retainers (2).

Insert screw (1) and tighten down.

Assemble engine.

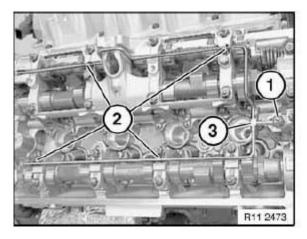


Fig. 347: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

11 31 573 ADJUSTING CAMSHAFT TIMING ON LEFT SIDE (N62/N62TU)

Special tools required:

- 11 9 190
- 11 9 460
- 11 9 461
- 11 9 462
- 11 9 463

(cylinder bank 5 to 8)


Necessary preliminary tasks:

- Check camshaft timing on left side . See <u>11 31 070 CHECKING CAMSHAFT TIMING ON LEFT SIDE (N62/N62TU)</u>.
- Remove left timing case cover . See <u>11 14 080 REMOVING AND INSTALLING TOP LEFT</u> TIMING CASE COVER (N62/N62TU).

NOTE: When slackening screws, grip camshafts at hexagon head.

Slacken screws of exhaust and inlet adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

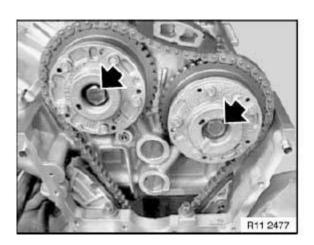

<u>Fig. 348: Locating Slacken Screws Of Exhaust And Inlet Adjustment Unit</u> Courtesy of BMW OF NORTH AMERICA, INC.

Get special tool kit 11 9 460 ready for securing camshafts.

NOTE: Special tool 11 9 461 for securing inlet camshaft.

Special tool 11 9 462 for securing exhaust camshaft.

Special tool 11 9 463 (holder with screw).


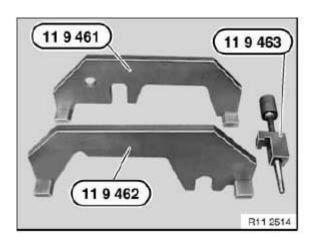


Fig. 349: Identifying Special Tool (11 9 461), (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and align inlet camshaft so that special tool 11 9 461 rests without a gap on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

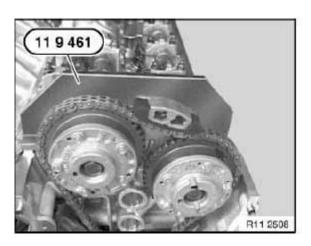

<u>Fig. 350: Identifying Special Tool (11 9 461)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

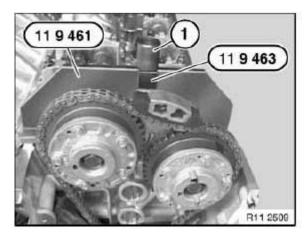


Fig. 351: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (1), grip camshaft at hexagon head.

Tighten down screw (1) of inlet adjustment unit.

Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

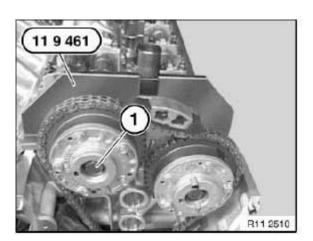


Fig. 352: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1), remove special tools 11 9 463 and 11 9 461 from inlet camshaft.

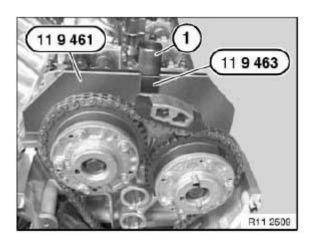


Fig. 353: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool $11\ 9\ 462$ on exhaust camshaft and align exhaust camshaft so that special tool $11\ 9\ 462$ rests without a gap on cylinder head.

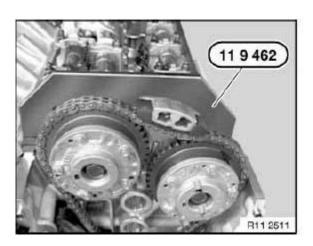


Fig. 354: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

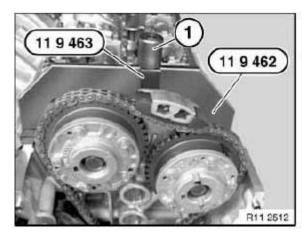


Fig. 355: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (2), grip camshaft at hexagon head.

Tighten down screw (2) of exhaust adjustment unit.

Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

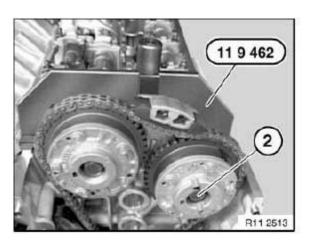


Fig. 356: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1), remove special tools 11 9 463 and 11 9 462 from exhaust camshaft.

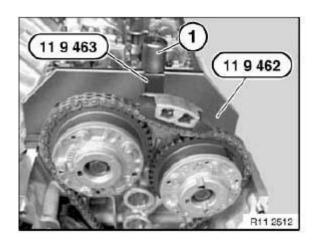


Fig. 357: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 190.

Crank engine at central bolt twice in direction of rotation until engine returns to firing TDC position of 1st cylinder.

Secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

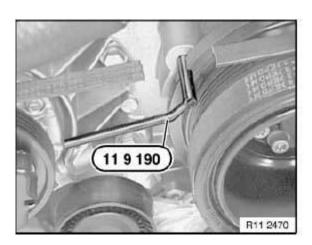


Fig. 358: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

Remove special tool 11 9 461 from inlet camshaft.

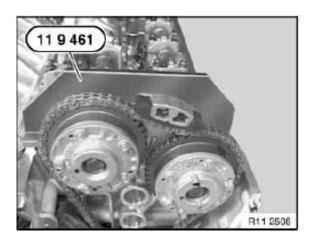


Fig. 359: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

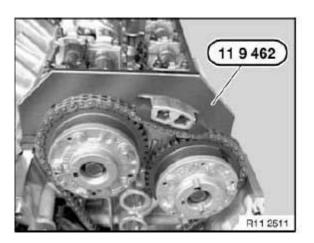


Fig. 360: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Remove all special tools.

Assemble engine.

11 31 574 ADJUSTING CAMSHAFT TIMING ON RIGHT SIDE (N62/N62TU)

Special tools required:

- 11 9 190
- 11 9 460
- 11 9 461
- 11 9 462
- 11 9 463

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Are described in the operation "CHECKING CAMSHAFT TIMING ON RIGHT SIDE".
- Remove right timing case cover . See <u>11 14 085 REMOVING AND INSTALLING TOP RIGHT TIMING CASE COVER (N62/N62TU)</u>.

NOTE: When slackening screws, grip camshafts at hexagon head.

Slacken screws of exhaust and inlet adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

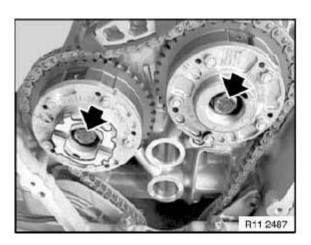


Fig. 361: Locating Slacken Screws Of Exhaust And Inlet Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

Get special tool kit 11 9 460 ready for securing camshafts.

NOTE: Special tool 11 9 461 for securing inlet camshaft.

Special tool 11 9 462 for securing exhaust camshaft.

Special tool 11 9 463 (holder with screw).

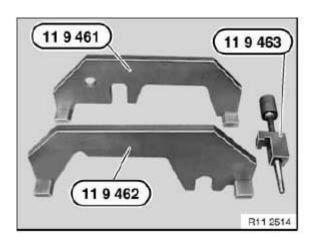


Fig. 362: Identifying Special Tool (11 9 461), (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and align inlet camshaft so that special tool 11 9 461 rests without a gap on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

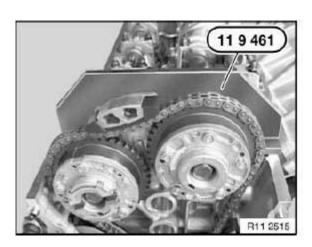


Fig. 363: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

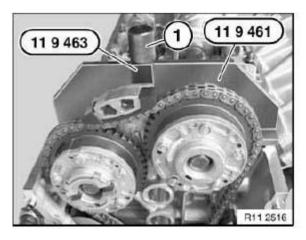



Fig. 364: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (1), grip camshaft at hexagon head.

Tighten down screw (1) of inlet adjustment unit.

Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

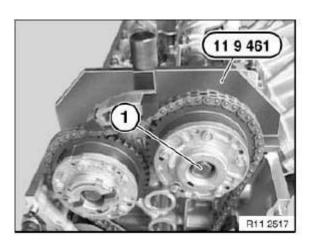

<u>Fig. 365: Identifying Special Tool (11 9 461)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1), remove special tools 11 9 463 and 11 9 461 from inlet camshaft.

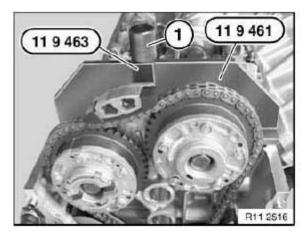


Fig. 366: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and align exhaust camshaft so that special tool 11 9 462 rests without a gap on cylinder head.


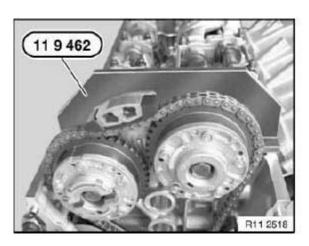


Fig. 367: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

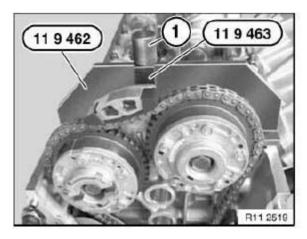


<u>Fig. 368: Identifying Special Tool (11 9 462) And (11 9 463)</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (2), grip camshaft at hexagon head.

Tighten down screw (2) of exhaust adjustment unit.

Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

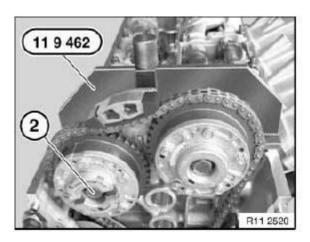

<u>Fig. 369: Identifying Special Tool (11 9 462)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1), remove special tools 11 9 463 and 11 9 462 from exhaust camshaft.

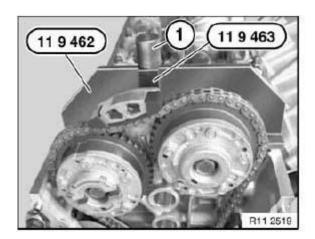


Fig. 370: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 190.

Crank engine at central bolt twice in direction of rotation until engine returns to firing TDC position of 1st cylinder.

Secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

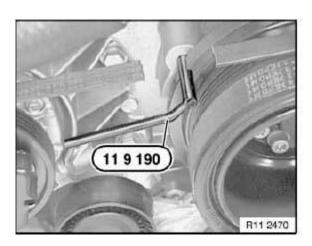


Fig. 371: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

Remove special tool 11 9 461 from inlet camshaft.

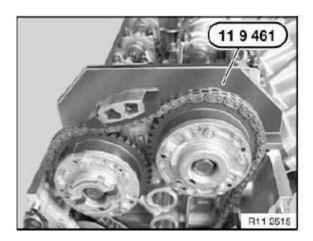


Fig. 372: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

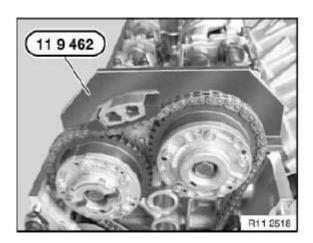


Fig. 373: Identifying Special Tool (11 9 462)
Courtesy of BMW OF NORTH AMERICA, INC.

Remove all special tools.

Assemble engine.

11 33 516 REMOVING AND INSTALLING/REPLACING ROCKER ARMS ON LEFT INLET SIDE (N62 FROM 9/03 AND N62TU)

Special tools required:

- 11 9 470
- 11 9 473

(cylinder bank 5 to 8)

Removal of rocker arms is described separately from installation.

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND</u> <u>INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.
- Remove ignition coils on cylinder bank 5 to 8
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).
- Remove spark plugs on cylinder bank 5 to 8
- Remove left inlet and exhaust adjustment units . See <u>11 36 047 REMOVING AND</u> <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Rotate inlet camshaft against direction of rotation until lettering (1) on 8th cylinder points upwards in cylinder axis and cam is horizontal.


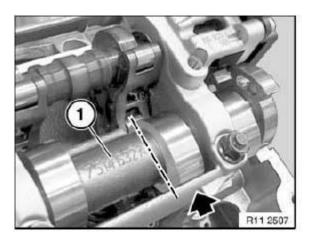


Fig. 374: Locating Camshaft Numbers
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 5 to 8 with R E1 to R E5 from inlet side.


Release nuts and remove bearing cap R E1.

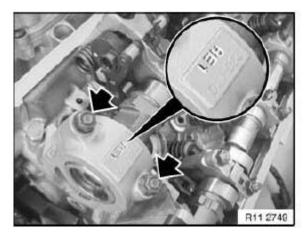

<u>Fig. 375: Locating Camshaft Bearing Caps Nut</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

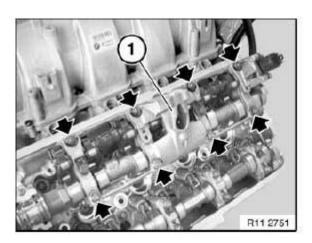

<u>Fig. 376: Locating Nuts Of Bearing Bracket</u> Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

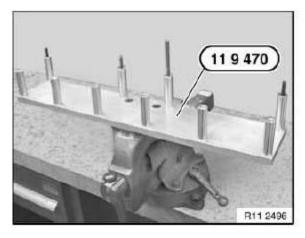


Fig. 377: Identifying Special Tool (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

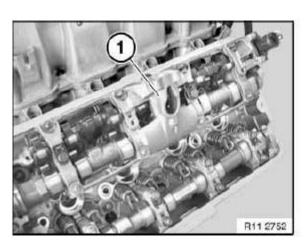


Fig. 378: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).


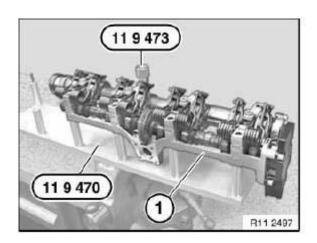


Fig. 379: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

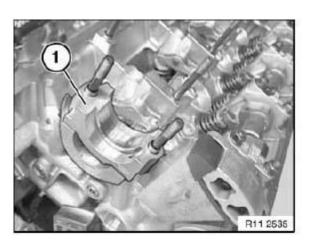


<u>Fig. 380: Identifying Lower Section Of Bearing Bracket On Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

The tolerance classes are designated as illustrated with the numbers from 1 to 4.

Used rocker arms (1) may only be reused in the same position.

Remove rocker arms (1) on inlet side and set aside in neat order.

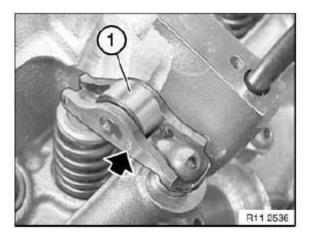

<u>Fig. 381: Locating Rocker Arms On Inlet Side</u> Courtesy of BMW OF NORTH AMERICA, INC.

Replacement only:

When replacing rocker arms (1) on inlet side:

Rocker arms have new tolerance classes and must be assigned to the old tolerance classes and fitted in the same position.

Old = new 2A

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

1

Old = new 2A

2

Old = new 2B

3

Old = new 2B

4

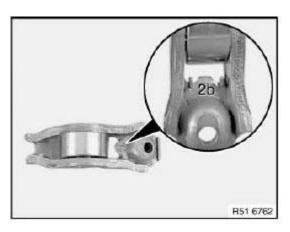


Fig. 382: Identifying Rocker Arms Number Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of rocker arms is described separately from removal.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

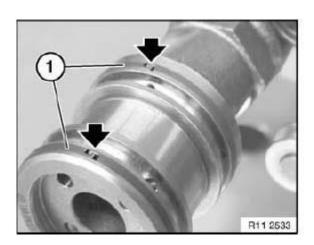


Fig. 383: Locating Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

Install rocker arms (1) on inlet side.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.

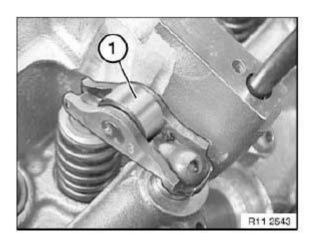


Fig. 384: Identifying Rocker Arms
Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

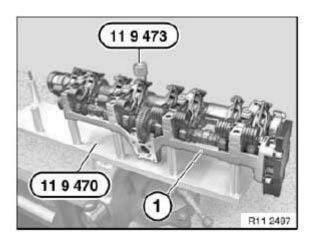


Fig. 385: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.

IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

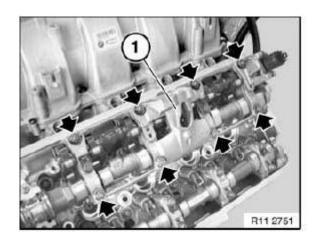


Fig. 386: Locating Nuts Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fit bearing cap R E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

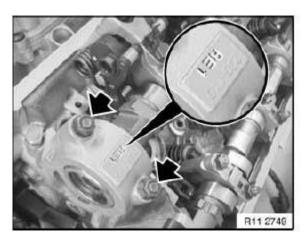


Fig. 387: Locating Camshaft Bearing Caps Nut Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft in direction of rotation until cam on 5th cylinder points upwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

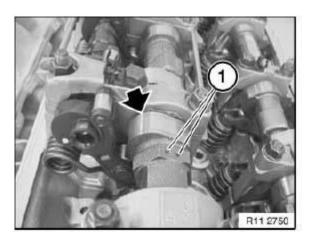


Fig. 388: Locating Marking On Hexagon Drive Of Inlet Camshaft Faces Upwards Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on left side. See 11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE (N62/N62TU).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Install spark plugs on cylinder bank 5 to 8.

Install left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 5 to 8.

Install servomotor for left eccentric shaft. . See <u>11 37 022 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

11 33 517 REMOVING AND INSTALLING/REPLACING ROCKER ARMS ON RIGHT INLET SIDE (N62 FROM 9/03 AND N62TU)

Special tools required:

- 11 9 470
- 11 9 473

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Removal of rocker arms is described separately from installation.
- Remove servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU).
- Remove ignition coils on cylinder bank 1 to 4
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove spark plugs on cylinder bank 1 to 4
- Remove right inlet and exhaust adjustment units. See <u>11 36 048 REMOVING AND</u>
 <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u>
 (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

Rotate inlet camshaft in direction of rotation until cam on 1st cylinder is positioned horizontally as shown in illustration.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)



<u>Fig. 389: Locating Camshaft</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 1 to 4 with L E1 to L E5 from inlet side.

Release nuts and remove bearing cap L E1.


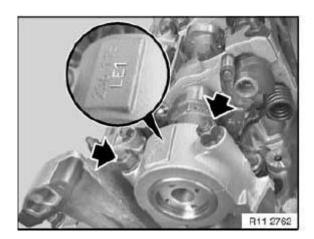


Fig. 390: Locating Bearing Cap L E1 And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

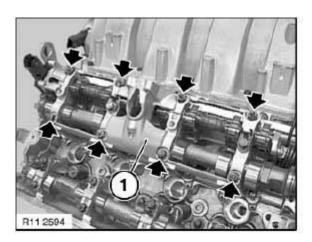

<u>Fig. 391: Locating Camshaft Bearing Bracket And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

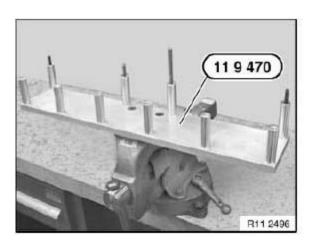


Fig. 392: Identifying Special Tool (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

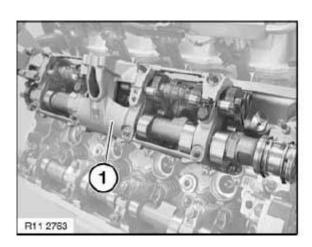


Fig. 393: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).

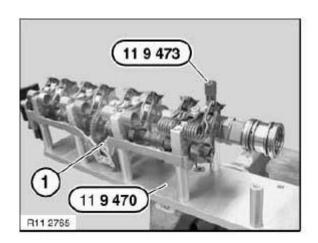


Fig. 394: Identifying Special Tool (11 9 473) And (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

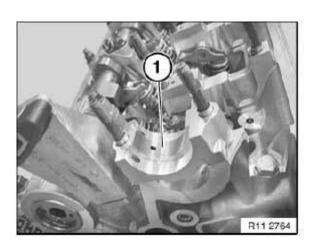


Fig. 395: Identifying Lower Section Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.


IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

The tolerance classes are designated as illustrated with the numbers from 1 to 4.

Used rocker arms (1) may only be reused in the same position.

When replacing rocker arms (1) on inlet side: install rocker arms of the same tolerance class in the same position.

Remove rocker arms (1) on inlet side and set aside in neat order.

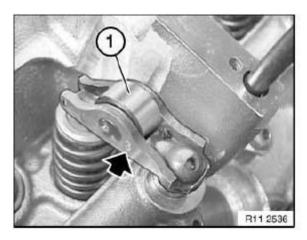

<u>Fig. 396: Locating Rocker Arms On Inlet Side</u> Courtesy of BMW OF NORTH AMERICA, INC.

Replacement only:

When replacing rocker arms (1) on inlet side:

Rocker arms have new tolerance classes and must be assigned to the old tolerance classes and fitted in the same

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

position.

Old = new 2A

1

Old = new 2A


2

Old = new 2B

3

Old = new 2B

4

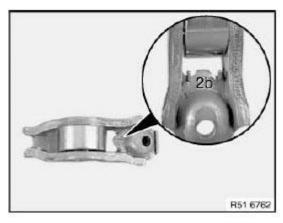

<u>Fig. 397: Identifying Rocker Arms Number</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of rocker arms is described separately from removal.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

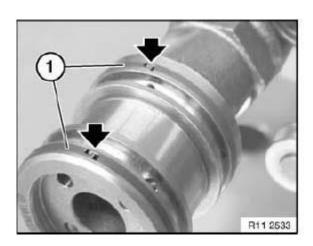


Fig. 398: Locating Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

Install rocker arms (1) on inlet side.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.

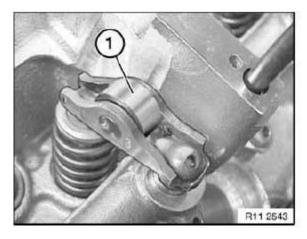


Fig. 399: Identifying Rocker Arms
Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

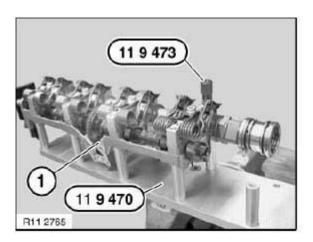


Fig. 400: Identifying Special Tool (11 9 473) And (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.

IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

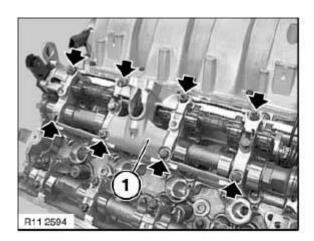


Fig. 401: Locating Camshaft Bearing Bracket And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fit bearing cap L E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

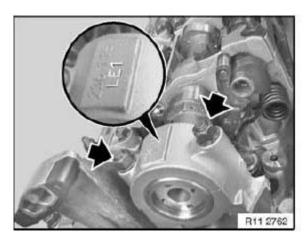


Fig. 402: Locating Bearing Cap L E1 And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft at hexagon head against direction of rotation until cam on 1st cylinder points downwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

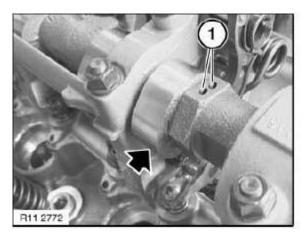


Fig. 403: Locating Marking On Hexagon Drive Of Inlet Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on right side. See 11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE (N62/N62TU).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Install spark plugs on cylinder bank 1 to 4.

Install right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 1 to 4.

Install servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

11 37 012 REMOVING AND INSTALLING/REPLACING LEFT INTERMEDIATE LEVERS (N62 FROM 9/03 AND N62TU)

Special tools required:

- 11 9 470
- 11 9 472
- 11 9 473
- 11 9 474
- 11 9 475
- 11 9 480
- 11 9 490

(cylinder bank 5 to 8)

Removal of intermediate levers is described separately from installation.

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU).
- Remove ignition coils on cylinder bank 5 to 8
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).
- Remove spark plugs on cylinder bank 5 to 8
- Remove left inlet and exhaust adjustment units . See <u>11 36 047 REMOVING AND</u> <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Rotate inlet camshaft against direction of rotation until lettering (1) on 8th cylinder points upwards in cylinder axis and cam is horizontal.


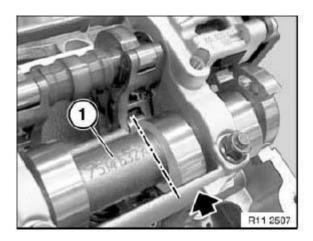


Fig. 404: Locating Camshaft Numbers
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 5 to 8 with R E1 to R E5 from inlet side.


Release nuts and remove bearing cap R E1.

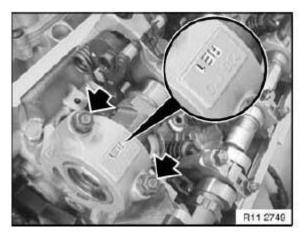

<u>Fig. 405: Locating Camshaft Bearing Caps Nut</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

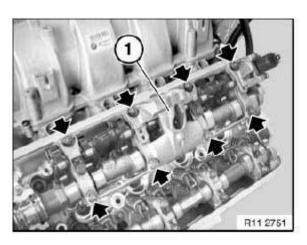

<u>Fig. 406: Locating Nuts Of Bearing Bracket</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Rocker arms are freely accessible after bearing bracket has been removed.

Do "not" remove rocker arm (1) on inlet side.

IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

The tolerance classes are designated as illustrated with the numbers from 1 to 4.

Used rocker arms (1) may only be reused in the same position.

When replacing rocker arms (1) on inlet side: install rocker arms of the same tolerance class in the same position.


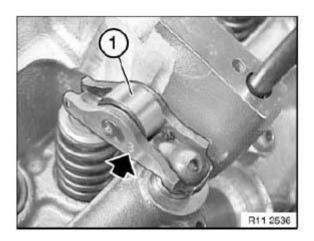


Fig. 407: Locating Rocker Arms On Inlet Side Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

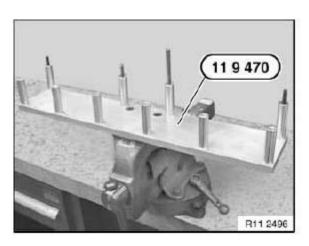

<u>Fig. 408: Identifying Special Tool (11 9 470)</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

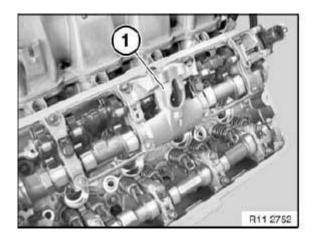


Fig. 409: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).


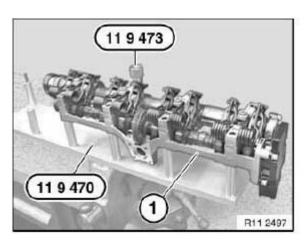


Fig. 410: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

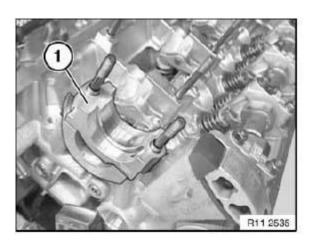

<u>Fig. 411: Identifying Lower Section Of Bearing Bracket On Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The mounting of the bearing bracket described later can only be carried out if the inlet camshaft has not been axially displaced.

Special tools 11 9 472 and 11 9 475 prevent the inlet camshaft from rotating and moving while the intermediate levers are installed.

Fit special tool 11 9 472 and secure with special tool 11 9 475.

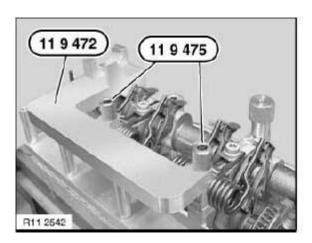


Fig. 412: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Insert special tool 11 9 474 and initially tighten without play.

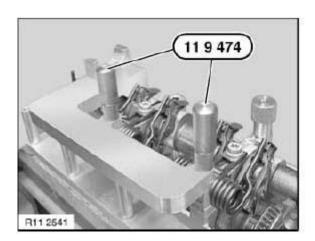


Fig. 413: Identifying Special Tool (11 9 474)
Courtesy of BMW OF NORTH AMERICA, INC.


NOTE: Removal of intermediate levers is described on 8th cylinder.

The same procedure is applicable to cylinders 5 to 7.

Raise one end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

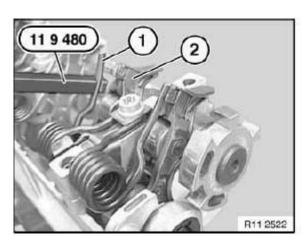

<u>Fig. 414: Identifying Torsion Spring, Intermediate Lever With Special Tool (11 9 480)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

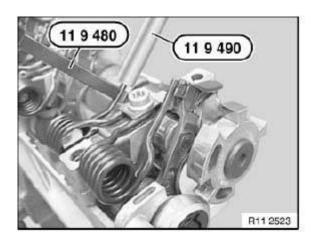


Fig. 415: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

Used intermediate levers (2) may only be reused in the same position.


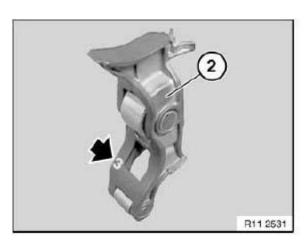


Fig. 416: Locating Intermediate Levers
Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

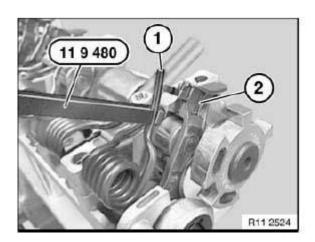

<u>Fig. 417: Identifying Torsion Spring With Special Tool (11 9 480)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to second end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

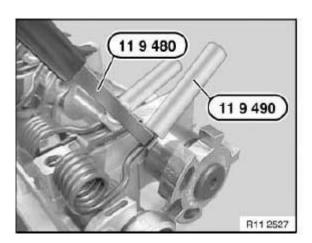


Fig. 418: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of intermediate levers is described separately from removal.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.


IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5

Used intermediate levers (2) may only be reused in the same position.

Lubricate all sliding surfaces on intermediate lever (2) with engine oil.

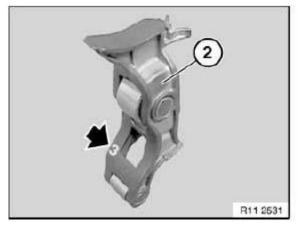

<u>Fig. 419: Locating Intermediate Levers</u> Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Raise torsion spring (1) with special tool 11 9 480.

Remove special tool 11 9 490.

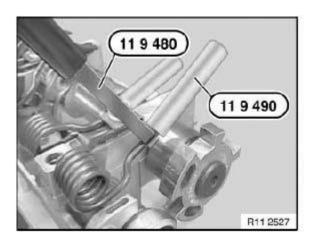


Fig. 420: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).


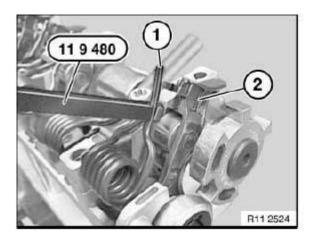


Fig. 421: Identifying Torsion Spring With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring with special tool 11 9 480.

Remove special tool 11 9 490.

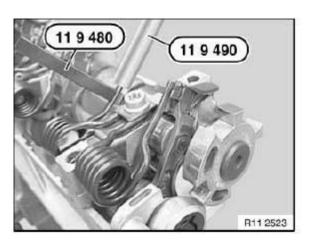


<u>Fig. 422: Identifying Special Tool (11 9 480) And (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).

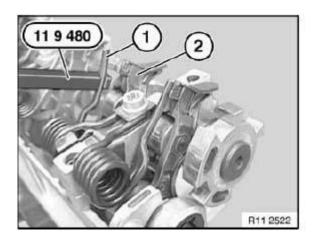

<u>Fig. 423: Identifying Torsion Spring, Intermediate Lever With Special Tool (11 9 480)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 474.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


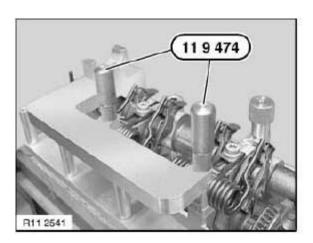


Fig. 424: Identifying Special Tool (11 9 474) Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tools 11 9 472 and special tools 11 9 475.

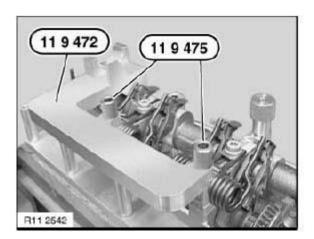

<u>Fig. 425: Identifying Special Tool (11 9 480) And (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


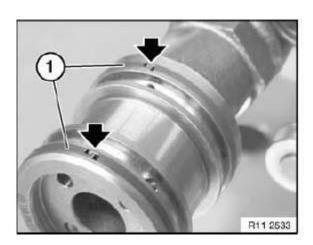


Fig. 426: Locating Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.

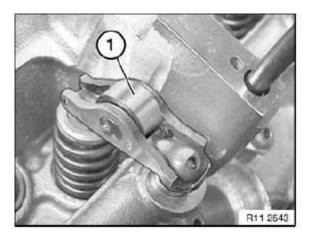

<u>Fig. 427: Identifying Rocker Arms</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

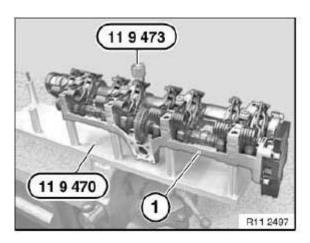


Fig. 428: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.

IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

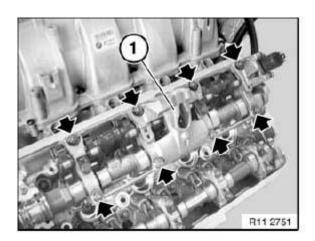


Fig. 429: Locating Nuts Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fit bearing cap R E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

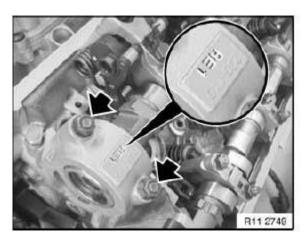


Fig. 430: Locating Camshaft Bearing Caps Nut Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft in direction of rotation until cam on 5th cylinder points upwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

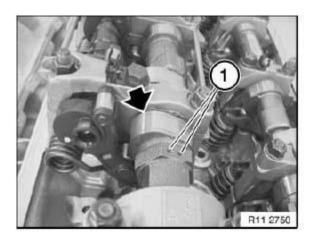


Fig. 431: Locating Marking On Hexagon Drive Of Inlet Camshaft Faces Upwards Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on left side. See 11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE (N62/N62TU).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Install spark plugs on cylinder bank 5 to 8.

Install left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 5 to 8.

Install servomotor for left eccentric shaft. . See <u>11 37 022 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

11 37 014 REMOVING AND INSTALLING/REPLACING RIGHT INTERMEDIATE LEVERS (N62 FROM 9/03 AND N62TU)

Special tools required:

- 11 9 470
- 11 9 472
- 11 9 473
- 11 9 474
- 11 9 475
- 11 9 480
- 11 9 490

(cylinder bank 1 to 4)

Removal of intermediate levers is described separately from installation.

Necessary preliminary tasks:

- Remove servomotor from right eccentric shaft. See <u>11 37 024 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU).
- Remove ignition coils on cylinder bank 1 to 4
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING</u> RIGHT CYLINDER HEAD COVER (N62/N62TU).
- Remove spark plugs on cylinder bank 1 to 4
- Remove right inlet and exhaust adjustment units . See <u>11 36 048 REMOVING AND</u> <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u> (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Rotate inlet camshaft in direction of rotation until cam on 1st cylinder is positioned horizontally as shown in illustration.

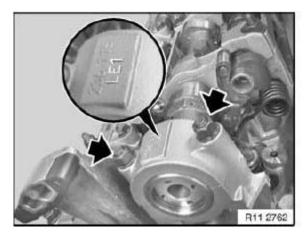


Fig. 432: Locating Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.


NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 1 to 4 with L E1 to L E5 from inlet side.

Release nuts and remove bearing cap L E1.



<u>Fig. 433: Locating Bearing Cap L E1 And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

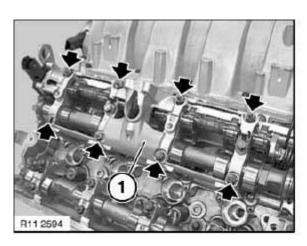

<u>Fig. 434: Locating Camshaft Bearing Bracket And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Rocker arms are freely accessible after bearing bracket has been removed.

Do "not" remove rocker arm (1) on inlet side.

IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

The tolerance classes are designated as illustrated with the numbers from 1 to 4.

Used rocker arms (1) may only be reused in the same position.

When replacing rocker arms (1) on inlet side: install rocker arms of the same tolerance class in the same position.

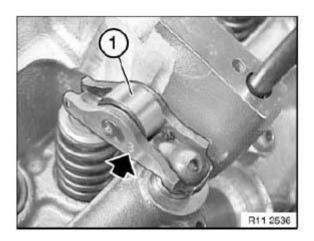


Fig. 435: Locating Rocker Arms On Inlet Side Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)



<u>Fig. 436: Identifying Special Tool (11 9 470)</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

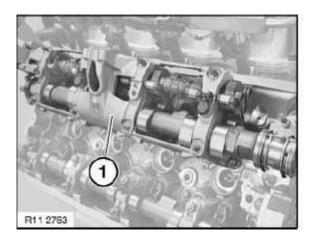


Fig. 437: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

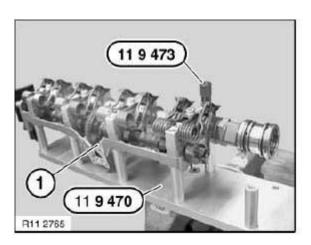


Fig. 438: Identifying Special Tool (11 9 473) And (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

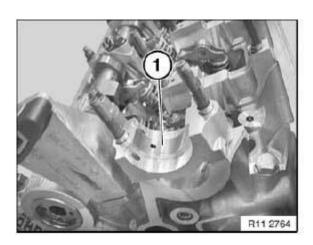


Fig. 439: Identifying Lower Section Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The mounting of the bearing bracket described later can only be carried out if the inlet camshaft has not been axially displaced.

Special tools 11 9 472 and 11 9 475 prevent the inlet camshaft from rotating and moving while the intermediate levers are installed.

Fit special tool 11 9 472 and secure with special tool 11 9 47 5.

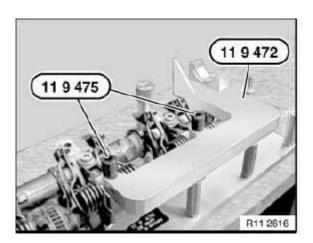


Fig. 440: Identifying Special Tool (11 9 474) And (11 9 472) Courtesy of BMW OF NORTH AMERICA, INC.

Insert special tool 11 9 474 and initially tighten without play.

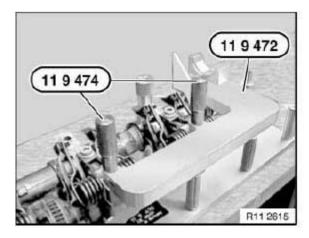


Fig. 441: Identifying Special Tool (11 9 474) And (11 9 472) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Removal of intermediate levers is described on 4th cylinder. The same procedure is applicable to cylinders 1 to 3.

Raise one end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

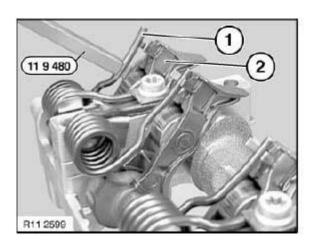


Fig. 442: Identifying Intermediate Lever And Torsion Spring Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

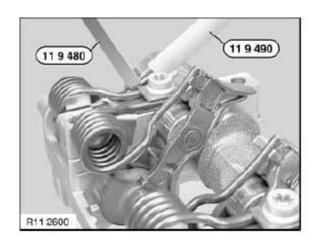



Fig. 443: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

Used intermediate levers (2) may only be reused in the same position.

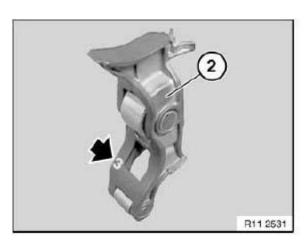

<u>Fig. 444: Locating Intermediate Levers</u> Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

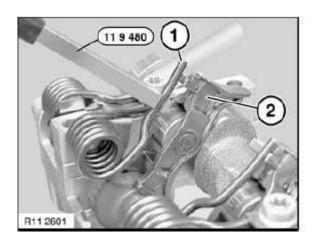


Fig. 445: Identifying Intermediate Lever, Torsion Spring With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to second end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

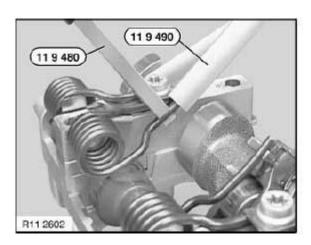


Fig. 446: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Installation

Removal of intermediate levers is described separately from installation.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.


IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5

Used intermediate levers (2) may only be reused in the same position.

Lubricate all sliding surfaces on intermediate lever (2) with engine oil.

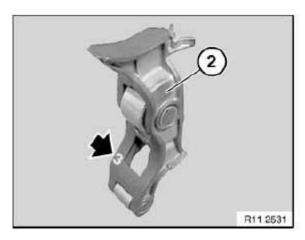

<u>Fig. 447: Locating Intermediate Levers</u> Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Raise torsion spring (1) with special tool 11 9 480.

Remove special tool 11 9 490.

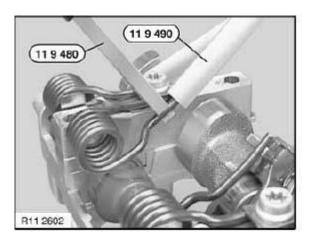


Fig. 448: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).


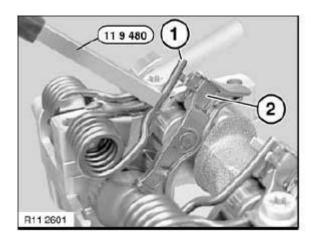


Fig. 449: Identifying Intermediate Lever, Torsion Spring With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring with special tool 11 9 480.

Remove special tool 11 9 490.

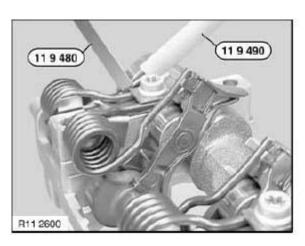

<u>Fig. 450: Identifying Special Tool (11 9 480) And (11 9 490)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).


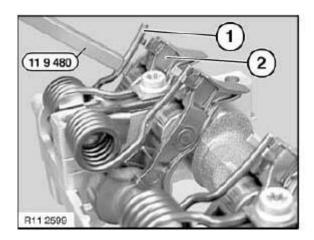



Fig. 451: Identifying Intermediate Lever And Torsion Spring Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 474.

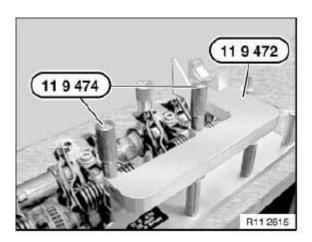

<u>Fig. 452: Identifying Special Tool (11 9 474) And (11 9 472)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tools 11 9 472 and special tools 11 9 475.

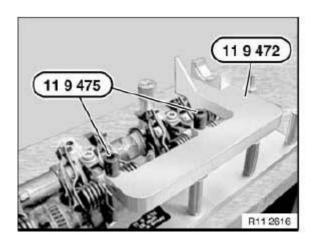

<u>Fig. 453: Identifying Special Tool (11 9 474) And (11 9 472)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


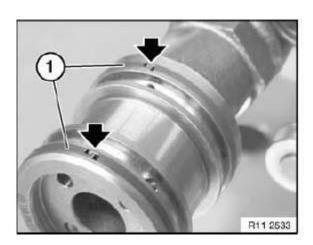


Fig. 454: Locating Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.

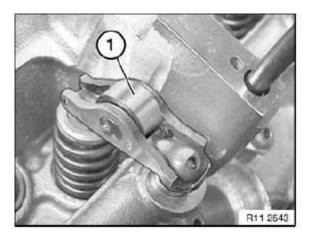

<u>Fig. 455: Identifying Rocker Arms</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

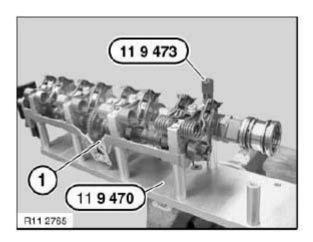


Fig. 456: Identifying Special Tool (11 9 473) And (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.

IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

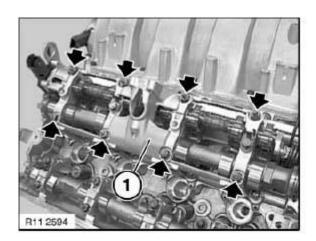


Fig. 457: Locating Camshaft Bearing Bracket And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fit bearing cap L E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

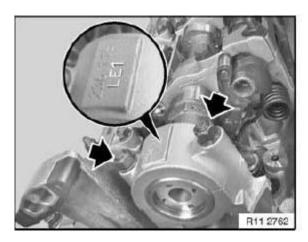


Fig. 458: Locating Bearing Cap L E1 And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft at hexagon head against direction of rotation until cam on 1st cylinder points downwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

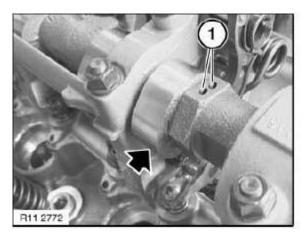


Fig. 459: Locating Marking On Hexagon Drive Of Inlet Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on right side. See 11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE (N62/N62TU).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Install spark plugs on cylinder bank 1 to 4.

Install right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT</u> <u>CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 1 to 4.

Install servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

33 ROCKER ARM WITH BEARING

11 33 516 REMOVING AND INSTALLING/REPLACING ROCKER ARMS ON LEFT INLET SIDE (N62 FROM 9/03 AND N62TU)

Special tools required:

- 11 9 470
- 11 9 473

(cylinder bank 5 to 8)

Removal of rocker arms is described separately from installation.

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU).
- Remove ignition coils on cylinder bank 5 to 8
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove spark plugs on cylinder bank 5 to 8
- Remove left inlet and exhaust adjustment units . See <u>11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

Rotate inlet camshaft against direction of rotation until lettering (1) on 8th cylinder points upwards in cylinder axis and cam is horizontal.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)




<u>Fig. 460: Locating Camshaft Numbers</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 5 to 8 with R E1 to R E5 from inlet side.


Release nuts and remove bearing cap R E1.

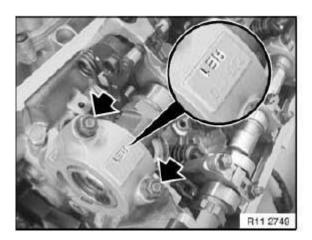

<u>Fig. 461: Locating Camshaft Bearing Caps Nut</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

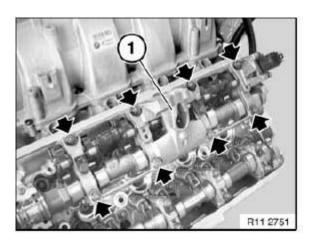

<u>Fig. 462: Locating Nuts Of Bearing Bracket</u> Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

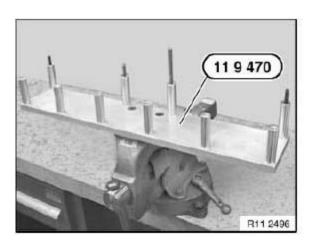


Fig. 463: Identifying Special Tool (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

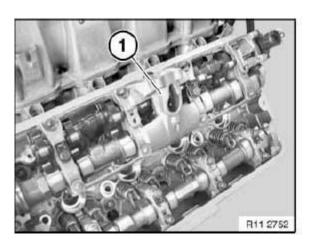


Fig. 464: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).


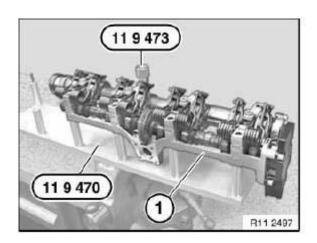


Fig. 465: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

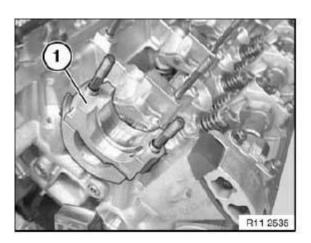


<u>Fig. 466: Identifying Lower Section Of Bearing Bracket On Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

The tolerance classes are designated as illustrated with the numbers from 1 to 4.

Used rocker arms (1) may only be reused in the same position.

Remove rocker arms (1) on inlet side and set aside in neat order.

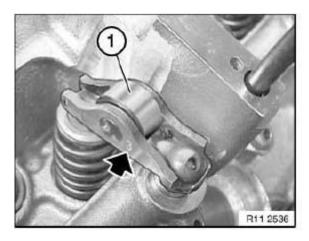

<u>Fig. 467: Locating Rocker Arms On Inlet Side</u> Courtesy of BMW OF NORTH AMERICA, INC.

Replacement only:

When replacing rocker arms (1) on inlet side:

Rocker arms have new tolerance classes and must be assigned to the old tolerance classes and fitted in the same position.

Old = new 2A

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

1

Old = new 2A

2

Old = new 2B

3

Old = new 2B

4

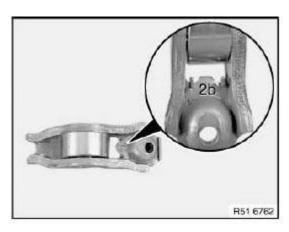


Fig. 468: Identifying Rocker Arms Number Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of rocker arms is described separately from removal.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

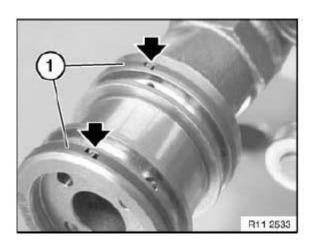


Fig. 469: Locating Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

Install rocker arms (1) on inlet side.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.

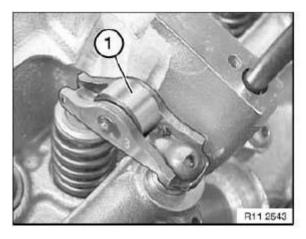


Fig. 470: Identifying Rocker Arms
Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

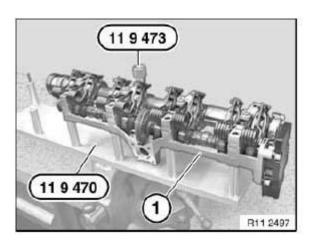


Fig. 471: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.

IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

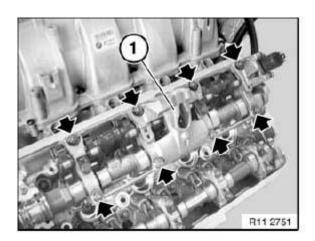


Fig. 472: Locating Nuts Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fit bearing cap R E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

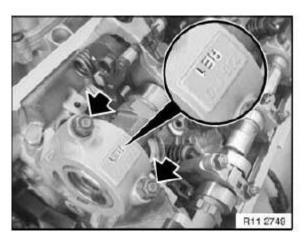


Fig. 473: Locating Camshaft Bearing Caps Nut Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft in direction of rotation until cam on 5th cylinder points upwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

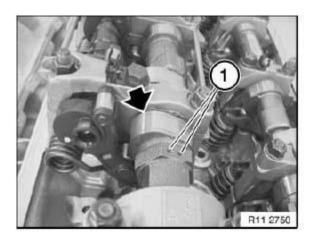


Fig. 474: Locating Marking On Hexagon Drive Of Inlet Camshaft Faces Upwards Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on left side. See 11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE (N62/N62TU).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Install spark plugs on cylinder bank 5 to 8.

Install left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 5 to 8.

Install servomotor for left eccentric shaft. . See <u>11 37 022 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

11 33 517 REMOVING AND INSTALLING/REPLACING ROCKER ARMS ON RIGHT INLET SIDE (N62 FROM 9/03 AND N62TU)

Special tools required:

- 11 9 470
- 11 9 473

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Removal of rocker arms is described separately from installation.
- Remove servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU).
- Remove ignition coils on cylinder bank 1 to 4
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove spark plugs on cylinder bank 1 to 4
- Remove right inlet and exhaust adjustment units. See <u>11 36 048 REMOVING AND</u>
 <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u>
 (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

Rotate inlet camshaft in direction of rotation until cam on 1st cylinder is positioned horizontally as shown in illustration.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


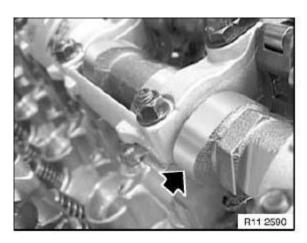


Fig. 475: Locating Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 1 to 4 with L E1 to L E5 from inlet side.


Release nuts and remove bearing cap L E1.

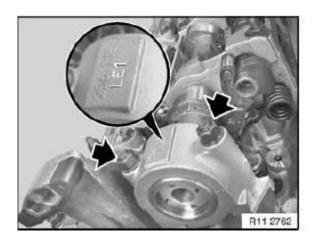

<u>Fig. 476: Locating Bearing Cap L E1 And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

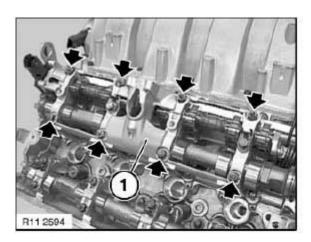

<u>Fig. 477: Locating Camshaft Bearing Bracket And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.



Fig. 478: Identifying Special Tool (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

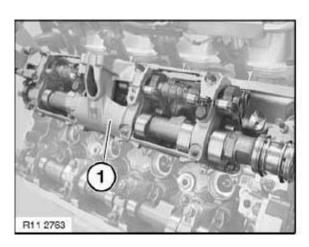


Fig. 479: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).

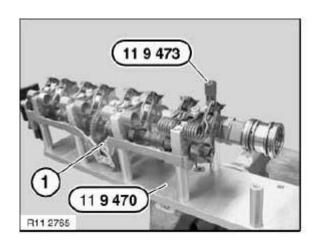


Fig. 480: Identifying Special Tool (11 9 473) And (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

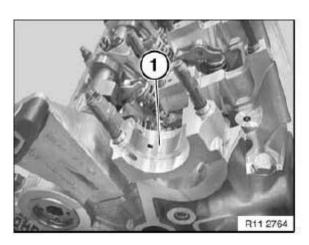


Fig. 481: Identifying Lower Section Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.


IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

The tolerance classes are designated as illustrated with the numbers from 1 to 4.

Used rocker arms (1) may only be reused in the same position.

When replacing rocker arms (1) on inlet side: install rocker arms of the same tolerance class in the same position.

Remove rocker arms (1) on inlet side and set aside in neat order.

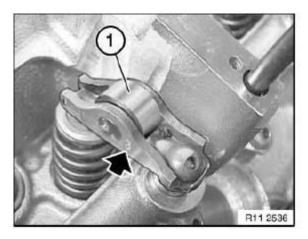

<u>Fig. 482: Locating Rocker Arms On Inlet Side</u> Courtesy of BMW OF NORTH AMERICA, INC.

Replacement only:

When replacing rocker arms (1) on inlet side:

Rocker arms have new tolerance classes and must be assigned to the old tolerance classes and fitted in the same

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

position.

Old = new 2A

1

Old = new 2A


2

Old = new 2B

3

Old = new 2B

4

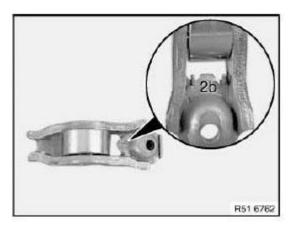

<u>Fig. 483: Identifying Rocker Arms Number</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of rocker arms is described separately from removal.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

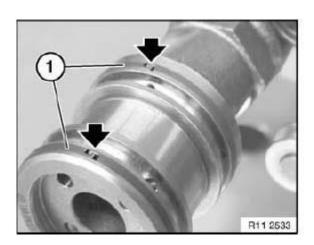


Fig. 484: Locating Compression Rings Courtesy of BMW OF NORTH AMERICA, INC.

Install rocker arms (1) on inlet side.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.

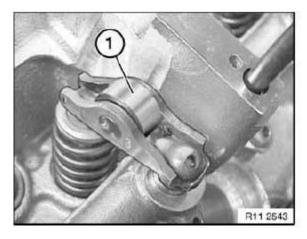


Fig. 485: Identifying Rocker Arms
Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

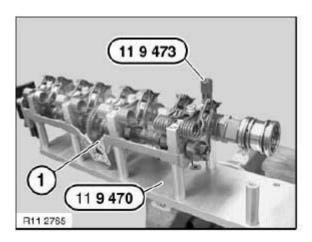


Fig. 486: Identifying Special Tool (11 9 473) And (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.

IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

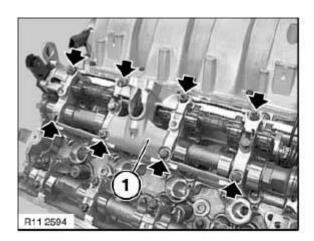


Fig. 487: Locating Camshaft Bearing Bracket And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fit bearing cap L E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

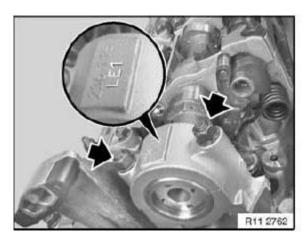


Fig. 488: Locating Bearing Cap L E1 And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft at hexagon head against direction of rotation until cam on 1st cylinder points downwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

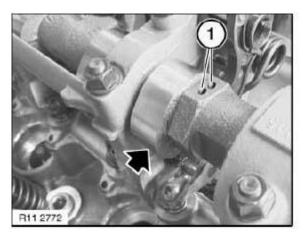


Fig. 489: Locating Marking On Hexagon Drive Of Inlet Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on right side. See 11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE (N62/N62TU).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Install spark plugs on cylinder bank 1 to 4.

Install right cylinder head cover. See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT</u> CYLINDER HEAD COVER (N62/N62TU).

Install ignition coils on cylinder bank 1 to 4.

Install servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

34 VALVES WITH SPRINGS

11 34 552 REMOVING AND INSTALLING/REPLACING ALL VALVES (N62) (CYLINDER HEAD REMOVED)

Preliminary tasks are described in **DISASSEMBLING AND ASSEMBLING CYLINDER HEAD**.

Remove valve springs

Remove valve stem seals . See 11 34 560 REPLACING ALL VALVE STEM SEALS (N62).

Remove valves from cylinder head.

Installation:

If necessary, check valve guide for wear.

If necessary, remachine valve seat. See <u>11 12 527 REMACHINING A VALVE SEAT - CYLINDER HEAD</u> <u>DISASSEMBLED (N62)</u>.

IMPORTANT: Incorrect installation possible.

Valve springs of exhaust and inlet camshafts are different. Incorrect installation will result in engine damage.

NOTE: Valve springs for exhaust valves are approx. 4 mm longer.

- 1. Valve springs of inlet valves
- 2. Valve springs of exhaust valves

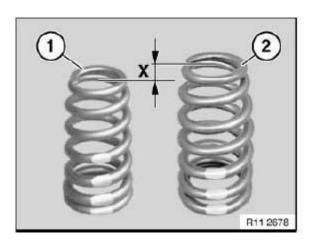


Fig. 490: Identifying Valve Springs Of Inlet And Exhaust Valves Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Incorrect installation possible.

Incorrect installation will result in valve spring breakage. Color marking (1) is normally on lower end of valve spring.

Only the diameter is decisive for the correct installation of the valve springs. Install valve spring so that larger diameter points to spring plate at bottom.


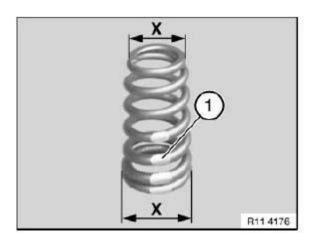


Fig. 491: Identifying Color Marking Of Valve Spring Courtesy of BMW OF NORTH AMERICA, INC.

Arrangement:

- 1. Valve
- 2. Valve stem seal with spring plate, bottom
- 3. Valve spring
- 4. Top plate spring
- 5. Valve tapers

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

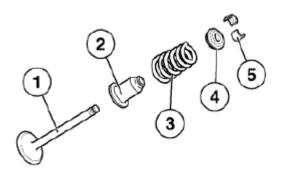

R11 4170

Fig. 492: Identifying Valve Stem Seal With Spring Plate And Top Plate Spring Courtesy of BMW OF NORTH AMERICA, INC.

11 34 560 REPLACING ALL VALVE STEM SEALS (N62)

Special tools required:

- 11 1 380
- 11 6 370
- 11 6 380

Preliminary tasks are described in **DISASSEMBLING AND ASSEMBLING CYLINDER HEAD**.

Press special tool 11 6 370 onto valve stem seal.

Withdraw valve stem seal by turning and simultaneously unscrewing special tool 11 6 370.

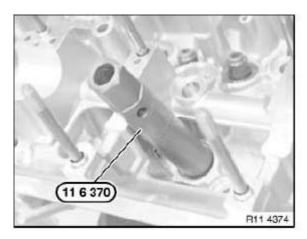


Fig. 493: Identifying Special Tool (11 6 370) Courtesy of BMW OF NORTH AMERICA, INC.


Installation:

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Lubricate valve stem with oil and insert valve.

Fit special tool 11 1 380.

Coat new valve stem seal (1) with oil and install.

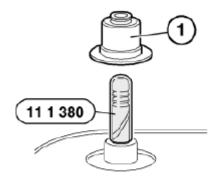

R11 4200

Fig. 494: Identifying Special Tool (11 1 380) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE:

For use on the N62 engine, special tool 11 6 380 must be remachined in accordance with the illustration with a 6.2 mm dia. drill bit to a depth of A = approx. 45 mm.

This modification has already been taken into account for reordering.

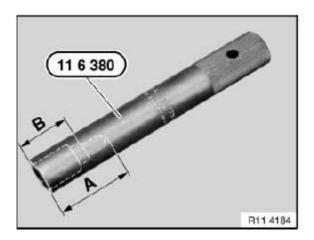


Fig. 495: Identifying Special Tool (11 6 380) Courtesy of BMW OF NORTH AMERICA, INC.

Press on valve stem seal with special tool 11 6 380 by hand as far as it will go.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

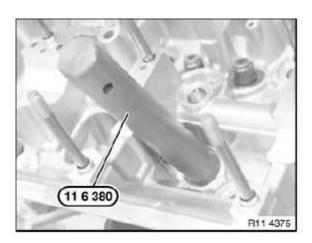


Fig. 496: Identifying Special Tool (11 6 380) Courtesy of BMW OF NORTH AMERICA, INC.

11 34 715 REPLACING ALL VALVE SPRINGS (N62TU)

Special tools required:

- 11 0 346
- 11 9 470

(cylinder head removed)

Preliminary tasks are described in DISASSEMBLING AND ASSEMBLING CYLINDER HEAD.

Remove bearing bracket (1) with inlet camshaft and stow in special tool 11 9 470. The procedure is described in 11 31 032 REMOVING AND INSTALLING/REPLACING LEFT INLET CAMSHAFT (N62 FROM 9/03 AND N62TU) or 11 31 034 REMOVING AND INSTALLING/REPLACING RIGHT INLET CAMSHAFT (N62 FROM 9/03 AND N62TU).

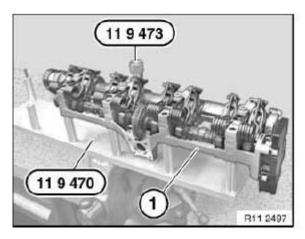


Fig. 497: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Remove exhaust camshaft.

Align special tool 11 0 346 in direction of valve shaft.

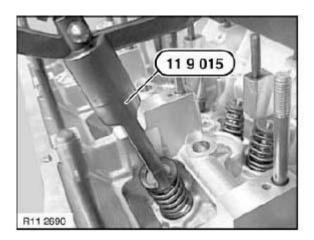


Fig. 498: Identifying Special Tool (11 0 346) Courtesy of BMW OF NORTH AMERICA, INC.

Press down valve spring on spring cap, top, and remove valve keys.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

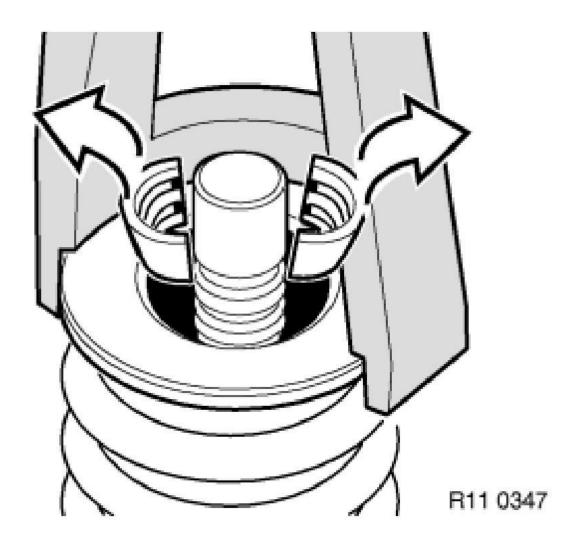



Fig. 499: Removing Valve Keys
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Incorrect installation possible.

Incorrect installation will result in valve spring breakage.

The color coding (1) is normally located on the lower end of the valve spring. Only the diameter is decisive for the correct installation of the valve springs. Install valve spring so that larger diameter points to spring plate at bottom.


ENGINE Engine - Repair Instructions - X5 (N62TU V8)

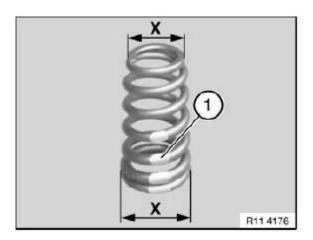

<u>Fig. 500: Identifying Color Marking Of Valve Spring</u> Courtesy of BMW OF NORTH AMERICA, INC.

Arrangement:

- 1. Valve
- 2. Valve stem seal with spring plate, bottom
- 3. Valve spring
- 4. Top plate spring
- 5. Valve tapers

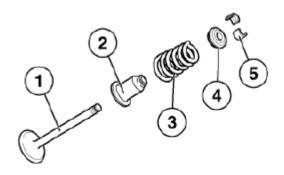

R11 4170

<u>Fig. 501: Identifying Valve Stem Seal With Spring Plate And Top Plate Spring</u> Courtesy of BMW OF NORTH AMERICA, INC.

36 VARIABLE CAMSHAFT TIMING

11 31 070 CHECKING CAMSHAFT TIMING ON LEFT SIDE (N62/N62TU)

Special tools required:

• 11 9 190

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 11 9 461
- 11 9 462

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU).
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).

Remove all spark plugs on cylinder bank 5 to 8.

If necessary, remove fan cowl.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Release screw (1).

Unclip oil line (3) from retainers (2) and remove.

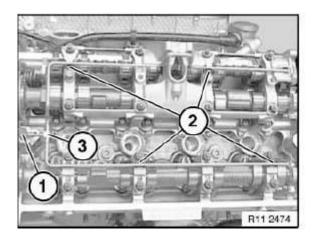


Fig. 502: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

Crank engine at central bolt in direction of rotation to firing TDC position of 1st cylinder.

NOTE: With 1st cylinder in firing TDC position, cams of inlet and exhaust camshafts at 5th cylinder point upwards at an angle as shown in illustration.

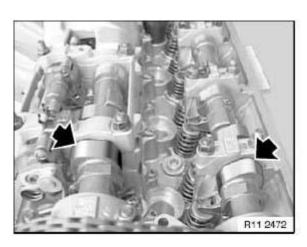


Fig. 503: Locating Cam Lobe Position
Courtesy of BMW OF NORTH AMERICA, INC.

Alignment hole for TDC position is at front on timing case cover.

Crank engine at central bolt and secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

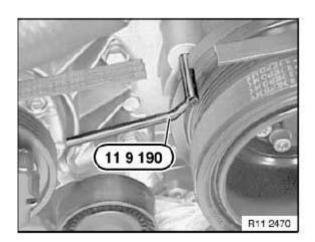


Fig. 504: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: When the engine is shut down, the inlet and exhaust adjustment unit is normally locked in its initial position.

The situation may arise in some individual cases where this initial position is not reached and the camshaft can continue to be rotated in the adjustment range of the adjustment unit.

In order to avoid incorrect timing adjustment, it is essential to check the locking of the adjustment unit and if necessary perform locking by rotating the camshafts.


Checking locking of inlet adjustment unit in initial position:

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Engage hexagon head of inlet camshaft and attempt to rotate inlet camshaft carefully against direction of rotation.

If there is no fixed connection between inlet camshaft and inlet adjustment unit, rotate inlet camshaft against direction of rotation as far as it will go.

The inlet adjustment unit is locked in the initial position when the inlet camshaft is non-positively connected to the inlet adjustment unit.

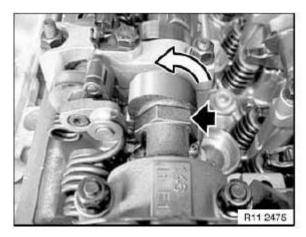

<u>Fig. 505: Rotating Inlet Camshaft</u> Courtesy of BMW OF NORTH AMERICA, INC.

Checking locking of exhaust adjustment unit in initial position:

Engage hexagon head of exhaust camshaft and attempt to rotate exhaust camshaft carefully in direction of rotation.

If there is no fixed connection between exhaust camshaft and exhaust adjustment unit, rotate exhaust camshaft in direction of rotation as far as it will go.

The exhaust adjustment unit is locked in the initial position when the exhaust camshaft is non-positively connected to the exhaust adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

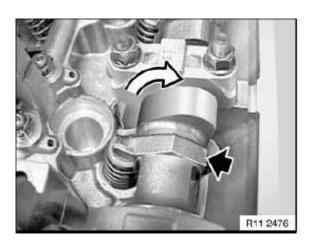


Fig. 506: Rotating Exhaust Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: If the inlet or exhaust adjustment unit of the camshafts "cannot" be locked as described, the adjustment unit is faulty and must be replaced.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

Remove special tool 11 9 461 from inlet camshaft.

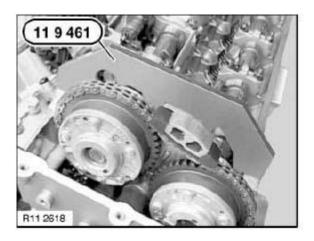


Fig. 507: Identifying Special Tool (11 9 461)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

If necessary, adjust camshaft timing on left side . See <u>11 31 070 CHECKING CAMSHAFT TIMING ON</u> <u>LEFT SIDE (N62/N62TU)</u>.

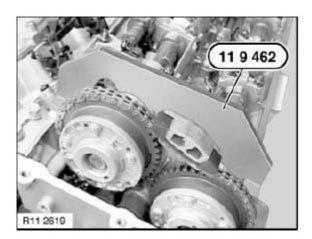


Fig. 508: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Remove all special tools.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Clip oil line (3) into retainers (2).

Insert screw (1) and tighten down.

Assemble engine.

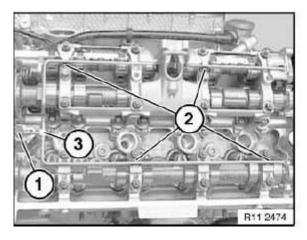


Fig. 509: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

11 31 071 CHECKING CAMSHAFT TIMING ON RIGHT SIDE (N62/N62TU)

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Special tools required:

- 11 9 190
- 11 9 461
- 11 9 462

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Remove servomotor from right eccentric shaft. See <u>11 37 024 REMOVING AND</u> <u>INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove all spark plugs on cylinder bank 1 to 4
- If necessary, remove fan cowl.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Release screw (1).

Unclip oil line (3) from retainers (2) and remove.

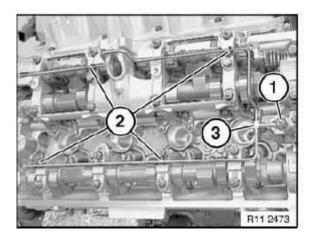


Fig. 510: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

Crank engine at central bolt in direction of rotation to firing TDC position of 1st cylinder.

NOTE: In firing TDC position, cam of exhaust camshaft at 1st cylinder points upwards at an angle.

Cam of inlet camshaft points downwards at an angle:



<u>Fig. 511: Locating Cam Lobe Position</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Alignment hole for TDC position is at front on timing case cover.

Crank engine at central bolt and secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

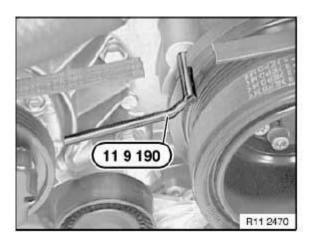


Fig. 512: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: When the engine is shut down, the inlet and exhaust adjustment unit is normally locked in its initial position.

The situation may arise in some individual cases where this initial position is not reached and the camshaft can continue to be rotated in the adjustment range of the adjustment unit.

In order to avoid incorrect timing adjustment, it is essential to check the locking of the adjustment unit and if necessary perform locking by rotating the camshafts.

Checking locking of inlet adjustment unit in initial position:

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Engage hexagon head of inlet camshaft and attempt to rotate inlet camshaft carefully against direction of rotation.

If there is no fixed connection between inlet camshaft and inlet adjustment unit, rotate inlet camshaft against direction of rotation as far as it will go.

The inlet adjustment unit is locked in the initial position when the inlet camshaft is non-positively connected to the inlet adjustment unit.

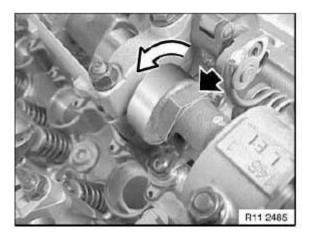


Fig. 513: Rotating Inlet Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

Checking locking of exhaust adjustment unit in initial position:

Engage hexagon head of exhaust camshaft and attempt to rotate exhaust camshaft carefully in direction of rotation.

If there is no fixed connection between exhaust camshaft and exhaust adjustment unit, rotate exhaust camshaft in direction of rotation as far as it will go.

The exhaust adjustment unit is locked in the initial position when the exhaust camshaft is non-positively connected to the exhaust adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

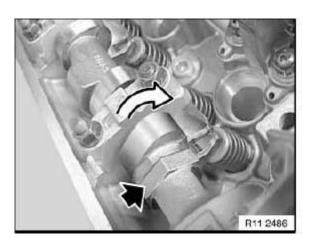


Fig. 514: Rotating Exhaust Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: If the inlet or exhaust adjustment unit of the camshafts "cannot" be locked as described, the adjustment unit is faulty and must be replaced.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

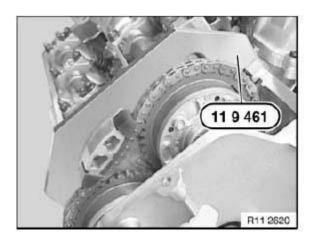


Fig. 515: Identifying Special Tool (11 9 461)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

If necessary, adjust camshaft timing on right side. See 11 31 574 ADJUSTING CAMSHAFT TIMING ON

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

RIGHT SIDE (N62/N62TU).

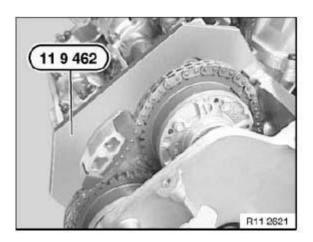


Fig. 516: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.


Remove all special tools.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Clip oil line (3) into retainers (2).

Insert screw (1) and tighten down.

Assemble engine.

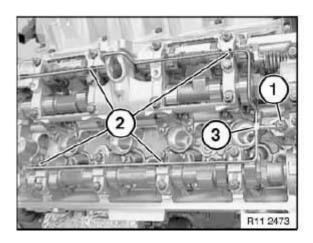

<u>Fig. 517: Identifying Retainer And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

11 31 573 ADJUSTING CAMSHAFT TIMING ON LEFT SIDE (N62/N62TU)

Special tools required:

domingo, 3 de octubre de 2021 12:49:35 a. m.	Page 297	© 2011 Mitchell Repair Information Company, LLC.
--	----------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 11 9 190
- 11 9 460
- 11 9 461
- 11 9 462
- 11 9 463

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Check camshaft timing on left side . See <u>11 31 070 CHECKING CAMSHAFT TIMING ON LEFT SIDE (N62/N62TU)</u>.
- Remove left timing case cover . See <u>11 14 080 REMOVING AND INSTALLING TOP LEFT TIMING CASE COVER (N62/N62TU)</u>.

NOTE: When slackening screws, grip camshafts at hexagon head.

Slacken screws of exhaust and inlet adjustment unit.

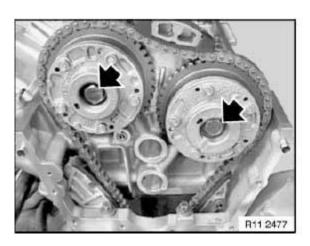


Fig. 518: Locating Slacken Screws Of Exhaust And Inlet Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

Get special tool kit 11 9 460 ready for securing camshafts.

NOTE: Special tool 11 9 461 for securing inlet camshaft.

Special tool 11 9 462 for securing exhaust camshaft.

Special tool 11 9 463 (holder with screw).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

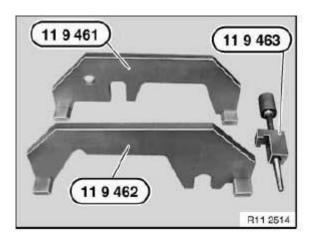


Fig. 519: Identifying Special Tool (11 9 461), (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and align inlet camshaft so that special tool 11 9 461 rests without a gap on cylinder head.

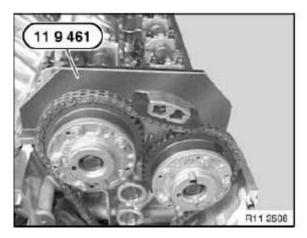


Fig. 520: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

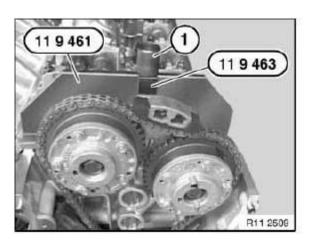


Fig. 521: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (1), grip camshaft at hexagon head.

Tighten down screw (1) of inlet adjustment unit.

Tightening torque 11 36 16AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

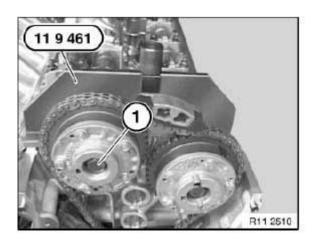


Fig. 522: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1), remove special tools 11 9 463 and 11 9 461 from inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


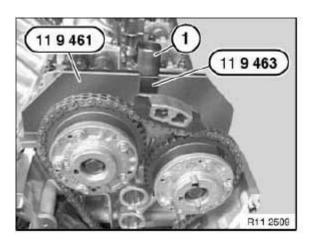


Fig. 523: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and align exhaust camshaft so that special tool 11 9 462 rests without a gap on cylinder head.

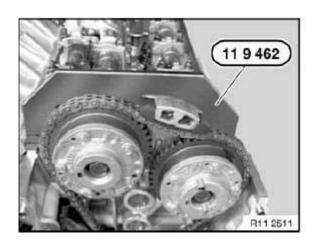

<u>Fig. 524: Identifying Special Tool (11 9 462)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

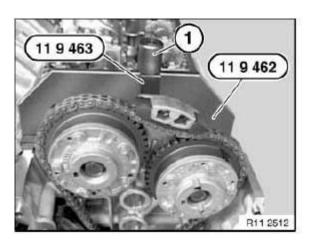


Fig. 525: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (2), grip camshaft at hexagon head.

Tighten down screw (2) of exhaust adjustment unit.

Tightening torque 11 36 16AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .


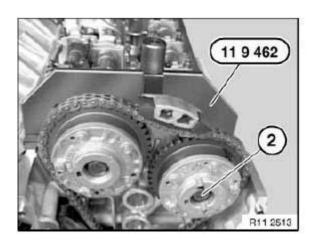


Fig. 526: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1), remove special tools 11 9 463 and 11 9 462 from exhaust camshaft.

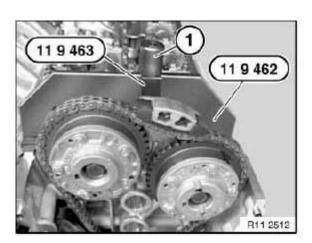

<u>Fig. 527: Identifying Special Tool (11 9 462) And (11 9 463)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 190.

Crank engine at central bolt twice in direction of rotation until engine returns to firing TDC position of 1st cylinder.

Secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

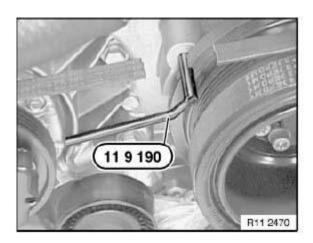


Fig. 528: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

Remove special tool 11 9 461 from inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

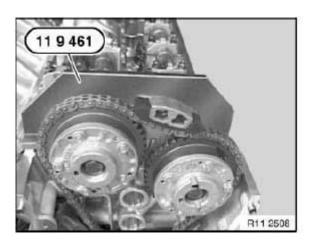


Fig. 529: Identifying Special Tool (11 9 461)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

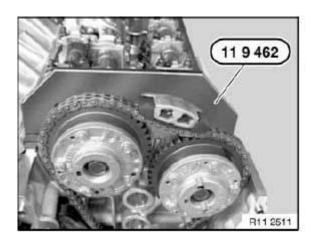


Fig. 530: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Remove all special tools.

Assemble engine.

11 31 574 ADJUSTING CAMSHAFT TIMING ON RIGHT SIDE (N62/N62TU)

Special tools required:

- 11 9 190
- 11 9 460

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 11 9 461
- 11 9 462
- 11 9 463

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Are described in the operation "CHECKING CAMSHAFT TIMING ON RIGHT SIDE".
- Remove right timing case cover . See <u>11 14 085 REMOVING AND INSTALLING TOP RIGHT TIMING CASE COVER (N62/N62TU)</u>.

NOTE: When slackening screws, grip camshafts at hexagon head.

Slacken screws of exhaust and inlet adjustment unit.

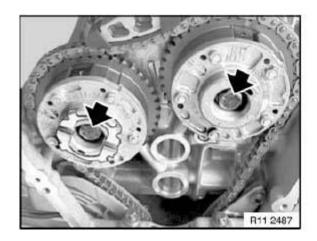


Fig. 531: Locating Slacken Screws Of Exhaust And Inlet Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

Get special tool kit 11 9 460 ready for securing camshafts.

NOTE: Special tool 11 9 461 for securing inlet camshaft.

Special tool 11 9 462 for securing exhaust camshaft.

Special tool 11 9 463 (holder with screw).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

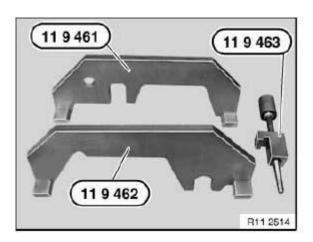


Fig. 532: Identifying Special Tool (11 9 461), (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and align inlet camshaft so that special tool 11 9 461 rests without a gap on cylinder head.

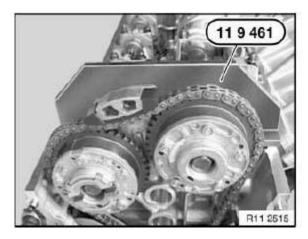


Fig. 533: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

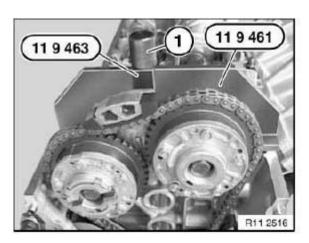


Fig. 534: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (1), grip camshaft at hexagon head.

Tighten down screw (1) of inlet adjustment unit.

Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .


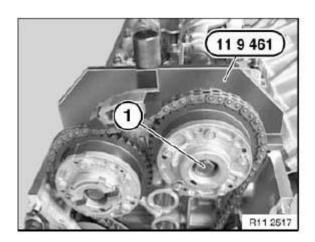


Fig. 535: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1), remove special tools 11 9 463 and 11 9 461 from inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

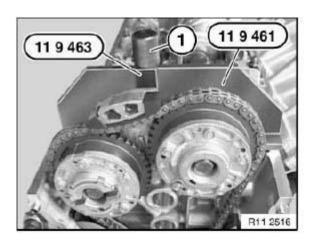

<u>Fig. 536: Identifying Special Tool (11 9 461) And (11 9 463)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and align exhaust camshaft so that special tool 11 9 462 rests without a gap on cylinder head.

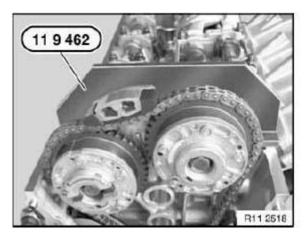


Fig. 537: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

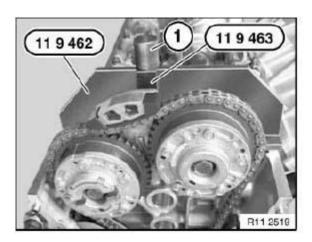


Fig. 538: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (2), grip camshaft at hexagon head.

Tighten down screw (2) of exhaust adjustment unit.

Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

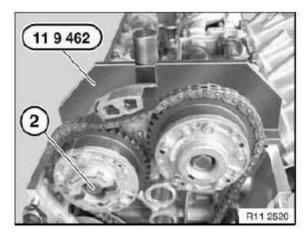


Fig. 539: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1), remove special tools 11 9 463 and 11 9 462 from exhaust camshaft.

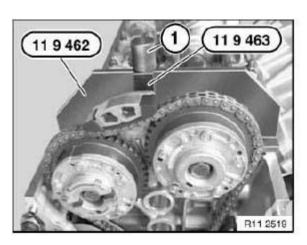


Fig. 540: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 190.

Crank engine at central bolt twice in direction of rotation until engine returns to firing TDC position of 1st cylinder.

Secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

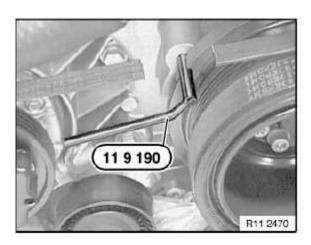


Fig. 541: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

Remove special tool 11 9 461 from inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

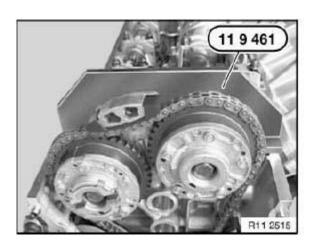


Fig. 542: Identifying Special Tool (11 9 461)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

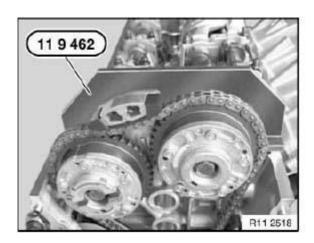


Fig. 543: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Remove all special tools.

Assemble engine.

11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE (N62/N62TU)

Special tools required:

• 11 9 190

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 11 9 460
- 11 9 461
- 11 9 462
- 11 9 463

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Read fault memory and make a documentary record
- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove all spark plugs on cylinder bank 5 to 8
- If necessary, remove fan cowl
- Remove left timing case cover . See <u>11 14 080 REMOVING AND INSTALLING TOP LEFT</u> TIMING CASE COVER (N62/N62TU).


Removal:

Removal of inlet and exhaust adjustment units is described separately from installation.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Release screw (1).

Unclip oil line (3) from retainers (2) and remove.

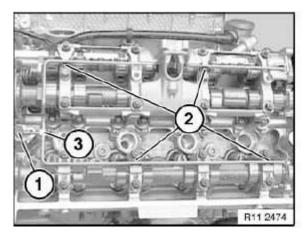

<u>Fig. 544: Identifying Retainer And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Crank engine at central bolt in direction of rotation to firing TDC position of 1st cylinder.

NOTE: With 1st cylinder in firing TDC position, cams of inlet and exhaust camshafts at 5th cylinder point upwards at an angle as shown in graphic.



<u>Fig. 545: Locating Cam Lobe Position</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Alignment hole for TDC position is at front on timing case cover.

Crank engine at central bolt and secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

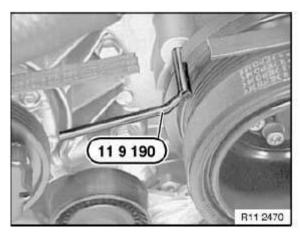


Fig. 546: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: When the engine is shut down, the inlet and exhaust adjustment unit is normally locked in its initial position.

The situation may arise in some individual cases where this initial position is not reached and the camshaft can continue to be rotated in the adjustment

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


range of the adjustment unit.
In order to avoid incorrect timing adjustment, it is essential to check the locking of the adjustment unit and if necessary perform locking by rotating the camshafts.

Checking locking of inlet adjustment unit in initial position:

Engage hexagon head of inlet camshaft and attempt to rotate inlet camshaft carefully against direction of rotation.

If there is no fixed connection between inlet camshaft and inlet adjustment unit, rotate inlet camshaft against direction of rotation as far as it will go.

The inlet adjustment unit is locked in the initial position when the inlet camshaft is non-positively connected to the inlet adjustment unit.

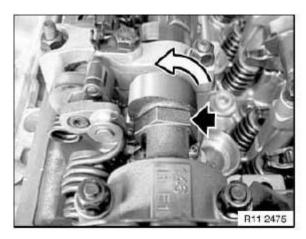

<u>Fig. 547: Rotating Inlet Camshaft</u> Courtesy of BMW OF NORTH AMERICA, INC.

Checking locking of exhaust adjustment unit in initial position:

Engage hexagon head of exhaust camshaft and attempt to rotate exhaust camshaft carefully in direction of rotation.

If there is no fixed connection between exhaust camshaft and exhaust adjustment unit, rotate exhaust camshaft in direction of rotation as far as it will go.

The exhaust adjustment unit is locked in the initial position when the exhaust camshaft is non-positively connected to the exhaust adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

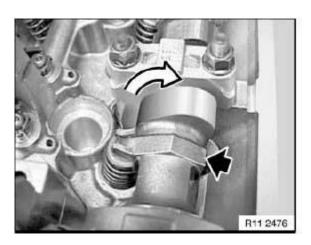


Fig. 548: Rotating Exhaust Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: If the inlet or exhaust adjustment unit of the camshafts "cannot" be locked as described, the adjustment unit is faulty and must be replaced.

Remove special tool 11 9 190.

Crank engine at central bolt against direction of rotation to 45° before TDC position.


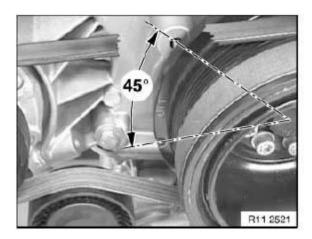


Fig. 549: Identifying Crank Shaft Rotation Angle Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When slackening screws, grip camshafts at hexagon head.

Slacken screws of exhaust and inlet adjustment unit.

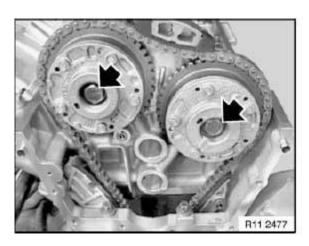

<u>Fig. 550: Locating Slacken Screws Of Exhaust And Inlet Adjustment Unit</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove screw on exhaust adjustment unit.


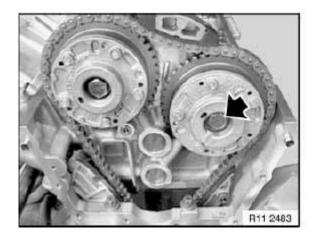


Fig. 551: Locating Screw On Exhaust Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.


Vigorously press back tensioner rail (3) several times to remove oil in chain tensioner.

Feed out exhaust adjustment unit (2).

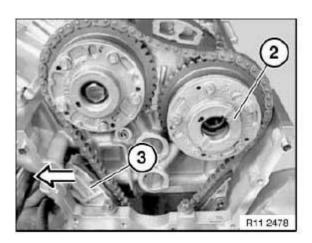

<u>Fig. 552: Pressing Back Tensioner Rail</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove screw on inlet adjustment unit.

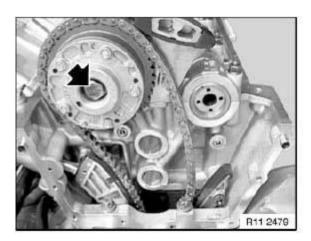

<u>Fig. 553: Locating Screw On Inlet Adjustment Unit</u> Courtesy of BMW OF NORTH AMERICA, INC.

Feed out inlet adjustment unit (1).

Secure timing chain to prevent it from sliding down.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

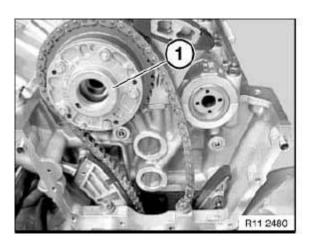


Fig. 554: Identifying Inlet Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

Installation:


Installation of inlet and exhaust adjustment units is described separately from removal.

IMPORTANT: Danger of mix-up:

Inlet and exhaust adjustment units are different.

Mixing up the inlet and exhaust adjustment units will cause damage to the engine.

- 1. Inlet adjustment unit (1) is marked with EIN and IN.
- 2. Exhaust adjustment unit (2) is marked with AUS and EX.

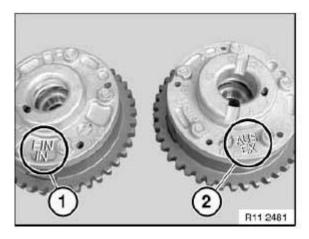

<u>Fig. 555: Identifying Inlet And Exhaust Adjustment Unit</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Position of inlet adjustment unit (1) to timing chain can be freely selected.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Pull timing chain up.

Feed inlet adjustment unit (1) into timing chain and fit onto inlet camshaft.

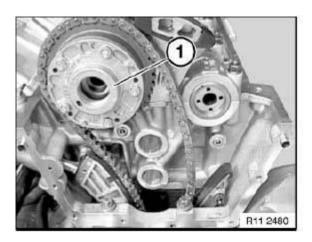


Fig. 556: Identifying Inlet Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

Replace screw.

Install screw on inlet adjustment unit.

Tighten screw without play and then slacken off again by half a turn.

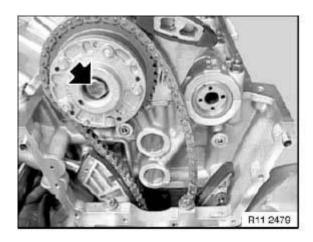


Fig. 557: Locating Screw On Inlet Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Position of exhaust adjustment unit (2) to timing chain can be freely selected.

Pull timing chain up.

Feed exhaust adjustment unit (2) into timing chain.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Press tensioner rail (3) back and fit exhaust adjustment unit (2) onto exhaust camshaft.

NOTE: If tensioner rail (3) cannot be pressed back far enough to enable fitting of exhaust adjustment unit (2):

Remove chain tensioner.

Place chain tensioner on a level surface and compress slowly and carefully.

Repeat this procedure twice.

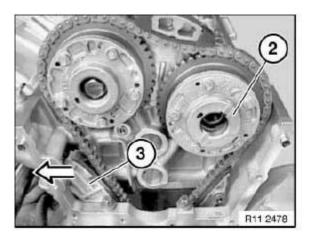


Fig. 558: Pressing Back Tensioner Rail
Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace sealing ring.

Install chain tensioner and tighten down.

Tightening torque 11 31 8AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

Fit exhaust adjustment unit (2).

Replace screw.

Install screw on exhaust adjustment unit.

Tighten screw without play and then slacken off again by half a turn.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

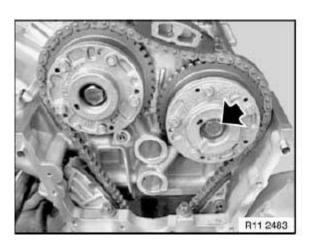


Fig. 559: Locating Screw On Exhaust Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

Get special tool kit 11 9 460 ready for securing camshafts.

NOTE: Special tool 11 9 461 for securing inlet camshaft.

Special tool 11 9 462 for securing exhaust camshaft.

Special tool 11 9 463 (holder with screw).

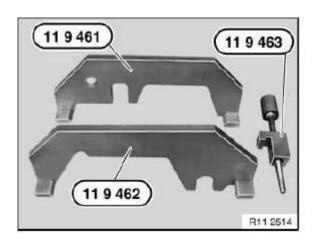


Fig. 560: Identifying Special Tool (11 9 461), (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and align inlet camshaft so that special tool 11 9 461 rests without a gap on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

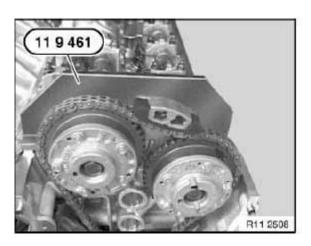


Fig. 561: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

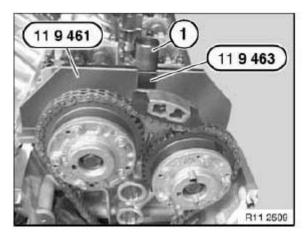


Fig. 562: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Make sure screws of inlet and exhaust adjustment units have been slackened off by a half turn.

Crank engine at central bolt from 45° before TDC position in direction of rotation to firing TDC position.

Secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


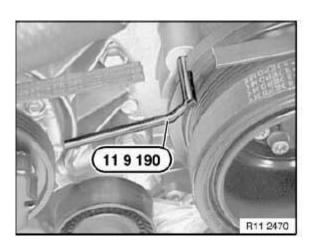


Fig. 563: Identifying Special Tool (11 9 190) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (1), grip camshaft at hexagon head.

Tighten down screw (1) of inlet adjustment unit.


Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

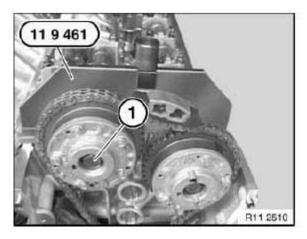

<u>Fig. 564: Identifying Special Tool (11 9 461)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1) and remove special tools 11 9 463 /11 9 461 from inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

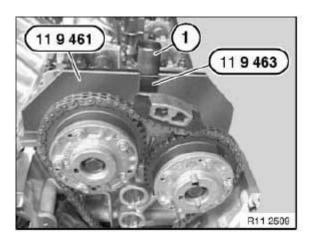

<u>Fig. 565: Identifying Special Tool (11 9 461) And (11 9 463)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and align exhaust camshaft so that special tool 11 9 462 rests without a gap on cylinder head.

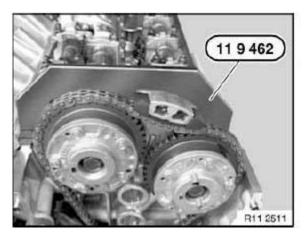


Fig. 566: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

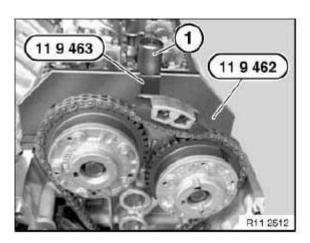


Fig. 567: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (2), grip camshaft at hexagon head.

Tighten down screw (2) of exhaust adjustment unit.

Tightening torque 11 36 16AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

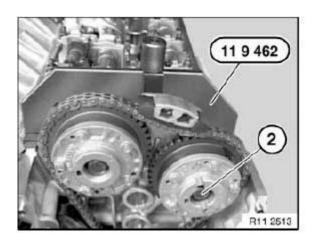


Fig. 568: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1) and remove special tools 11 9 463 /11 9 462 from exhaust camshaft.

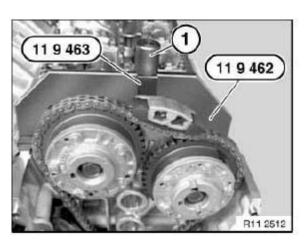


Fig. 569: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 190.

Crank engine at central bolt twice in direction of rotation until engine returns to firing TDC position of 1st cylinder.

Secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

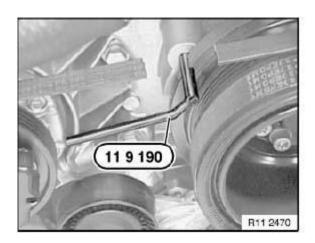


Fig. 570: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

Remove special tool 11 9 461 from inlet camshaft.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

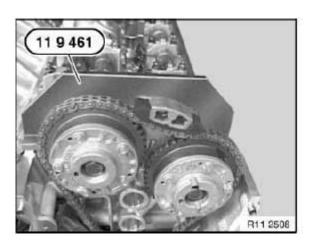


Fig. 571: Identifying Special Tool (11 9 461)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

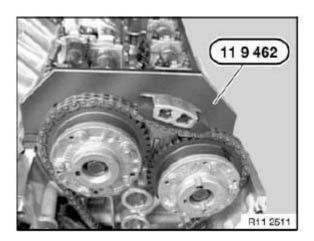


Fig. 572: Identifying Special Tool (11 9 462)
Courtesy of BMW OF NORTH AMERICA, INC.

Remove all special tools.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Clip oil line (3) into retainers (2).

Insert screw (1) and tighten down.

Assemble engine.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

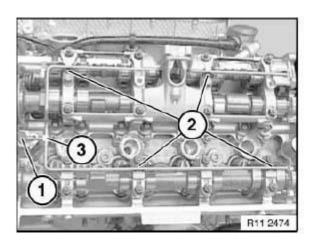


Fig. 573: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE (N62/N62TU)

Special tools required:

- 11 9 190
- 11 9 460
- 11 9 461
- 11 9 462
- 11 9 463

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Read fault memory and make a documentary record
- Remove servomotor for right eccentric shaft . See <u>11 37 024 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU).
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove all spark plugs on cylinder bank 1 to 4
- If necessary, remove fan cowl
- Remove right timing case cover . See <u>11 14 085 REMOVING AND INSTALLING TOP RIGHT</u> TIMING CASE COVER (N62/N62TU).

Removal:

Removal of inlet and exhaust adjustment units is described separately from installation.

domingo, 3 de octubre de 2021 12:49:36 a. m.	Page 328	© 2011 Mitchell Repair Information Company, LLC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Release screw (1).

Unclip oil line (3) from retainers (2) and remove.

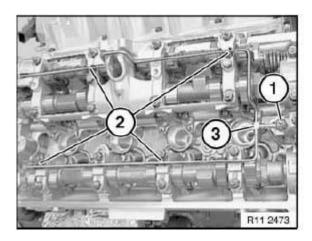


Fig. 574: Identifying Retainer And Screw Courtesy of BMW OF NORTH AMERICA, INC.

Crank engine at central bolt in direction of rotation to firing TDC position of 1st cylinder.

NOTE: In firing TDC position, cam of exhaust camshaft at 1st cylinder points upwards at an angle.

Cam of inlet camshaft points downwards at an angle.



<u>Fig. 575: Locating Cam Lobe Position</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Alignment hole for TDC position is at front on timing case cover.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Crank engine at central bolt and secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

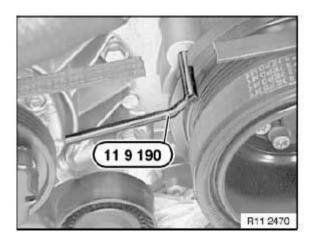


Fig. 576: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: When the engine is shut down, the inlet and exhaust adjustment unit is normally locked in its initial position.

The situation may arise in some individual cases where this initial position is not reached and the camshaft can continue to be rotated in the adjustment range of the adjustment unit.

In order to avoid incorrect timing adjustment, it is essential to check the locking of the adjustment unit and if necessary perform locking by rotating the camshafts.

Checking locking of inlet adjustment unit in initial position:

Engage hexagon head of inlet camshaft and attempt to rotate inlet camshaft carefully against direction of rotation.

If there is no fixed connection between inlet camshaft and inlet adjustment unit, rotate inlet camshaft against direction of rotation as far as it will go.

The inlet adjustment unit is locked in the initial position when the inlet camshaft is non-positively connected to the inlet adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

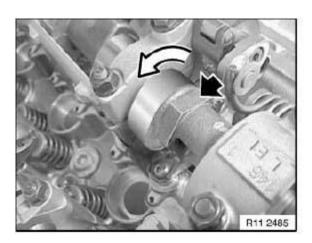


Fig. 577: Rotating Inlet Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

Checking locking of exhaust adjustment unit in initial position:

Engage hexagon head of exhaust camshaft and attempt to rotate exhaust camshaft carefully in direction of rotation.

If there is no fixed connection between exhaust camshaft and exhaust adjustment unit, rotate exhaust camshaft in direction of rotation as far as it will go.

The exhaust adjustment unit is locked in the initial position when the exhaust camshaft is non-positively connected to the exhaust adjustment unit.

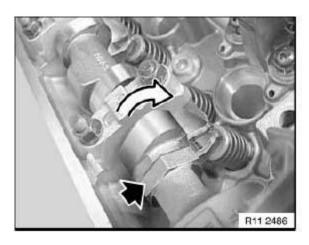


Fig. 578: Rotating Exhaust Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: If the inlet or exhaust adjustment unit of the camshafts "cannot" be locked as described, the adjustment unit is faulty and must be replaced.

Remove special tool 11 9 190.

domingo, 3 de octubre de 2021 12:49:36 a.m.	Page 331	© 2011 Mitchell Repair Information Company, LLC.
---	----------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Crank engine at central bolt against direction of rotation to 45° before TDC position.


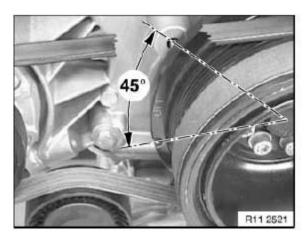


Fig. 579: Identifying Crank Shaft Rotation Angle Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When slackening screws, grip camshafts at hexagon head.

Slacken screws of exhaust and inlet adjustment unit.

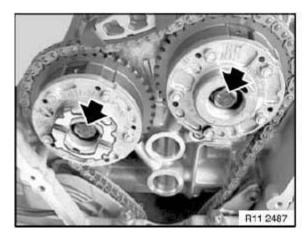

<u>Fig. 580: Locating Slacken Screws Of Exhaust And Inlet Adjustment Unit</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove screw on inlet adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


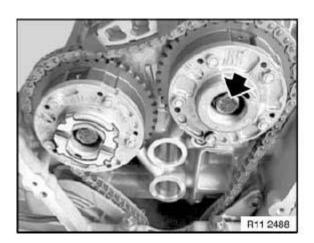


Fig. 581: Identifying Inlet Adjustment Unit Screw Courtesy of BMW OF NORTH AMERICA, INC.

Vigorously press back tensioner rail (3) several times to remove oil in chain tensioner.


Feed out inlet adjustment unit (1).

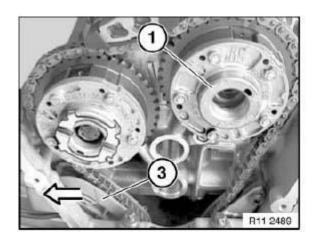

<u>Fig. 582: Pressing Back Tensioner Rail</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove screw on exhaust adjustment unit.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

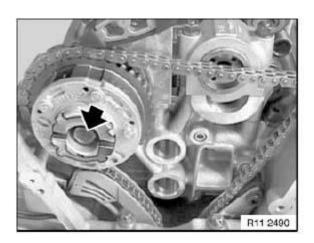

<u>Fig. 583: Identifying Exhaust Adjustment Unit Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Feed out exhaust adjustment unit (2).

Secure timing chain to prevent it from sliding down.

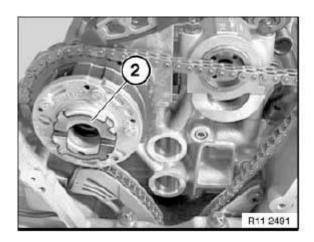


Fig. 584: Identifying Exhaust Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of inlet and exhaust adjustment units is described separately from removal.


IMPORTANT: Danger of mix-up:

Inlet and exhaust adjustment units are different.

Mixing up the inlet and exhaust adjustment units will cause damage to the engine.

1. Inlet adjustment unit (1) is marked with EIN and IN.

2. Exhaust adjustment unit (2) is marked with AUS and EX.

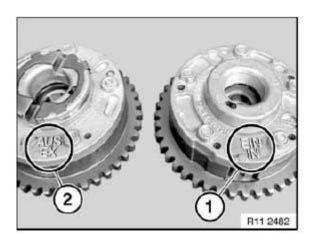

<u>Fig. 585: Identifying Inlet And Exhaust Adjustment Unit Marked With EIN And IN</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The exhaust adjustment unit on cylinder bank 1 to 4 also has a metal clip (3) for driving the vacuum pump.

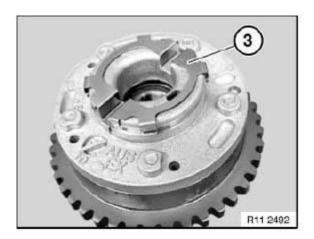


Fig. 586: Identifying Metal Clip Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Position of exhaust adjustment unit (2) to timing chain can be freely selected.

Pull timing chain up.

Feed exhaust adjustment unit (2) into timing chain and fit onto exhaust camshaft.

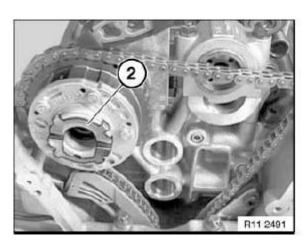


Fig. 587: Identifying Exhaust Adjustment Unit Courtesy of BMW OF NORTH AMERICA, INC.

Replace screw.

Install screw on exhaust adjustment unit.

Tighten screw without play and then slacken off again by half a turn.

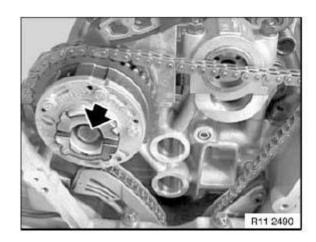


Fig. 588: Identifying Exhaust Adjustment Unit Screw Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Position of inlet adjustment unit (1) to timing chain can be freely selected.

Pull timing chain up.

Feed inlet adjustment unit (1) into timing chain.

Press tensioner rail (3) back and fit inlet adjustment unit (1) onto inlet camshaft.

NOTE: If tensioner rail (3) cannot be pressed back far enough to enable fitting of inlet

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

adjustment unit (1):

Slacken off chain tensioner by approx. three turns.

Fit inlet adjustment unit (1).

Replace and insert screw on inlet adjustment unit (1).

Tighten down chain tensioner.

Tightening torque of chain tensioner, 11 31 8AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

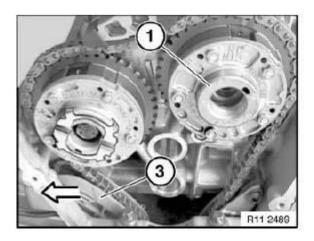


Fig. 589: Pressing Back Tensioner Rail Courtesy of BMW OF NORTH AMERICA, INC.

Tighten screw on inlet adjustment unit without play and then slacken off again by a half turn.

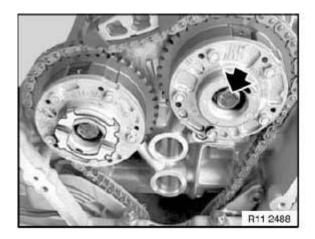


Fig. 590: Identifying Inlet Adjustment Unit Screw Courtesy of BMW OF NORTH AMERICA, INC.

Get special tool kit 11 9 460 ready for securing camshafts.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

NOTE: Special tool 11 9 461 for securing inlet camshaft.

Special tool 11 9 462 for securing exhaust camshaft.

Special tool 11 9 463 (holder with screw).

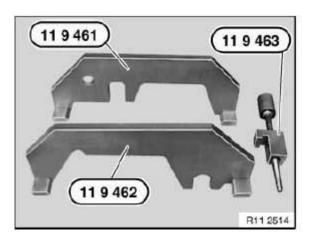


Fig. 591: Identifying Special Tool (11 9 461), (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and align inlet camshaft so that special tool 11 9 461 rests without a gap on cylinder head.


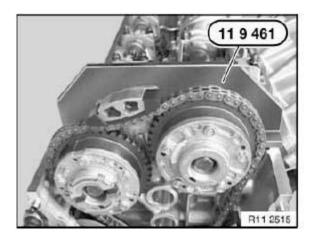


Fig. 592: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

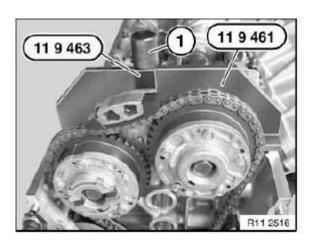

<u>Fig. 593: Identifying Special Tool (11 9 461) And (11 9 463)</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Make sure screws of inlet and exhaust adjustment units have been slackened off.

Crank engine at central bolt from 45° before TDC position in direction of rotation to firing TDC position.

Secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

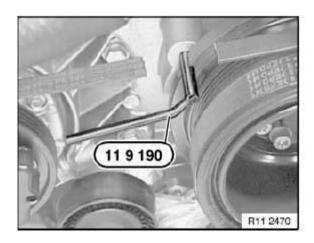



Fig. 594: Identifying Special Tool (11 9 190) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (1), grip camshaft at hexagon head.

Tighten down screw (1) of inlet adjustment unit.

Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

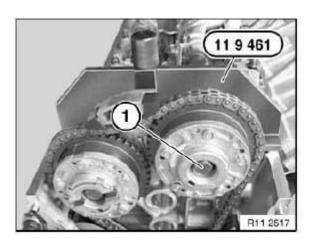

<u>Fig. 595: Identifying Special Tool (11 9 461)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1) and remove special tools 11 9 463 /11 9 461 from inlet camshaft.

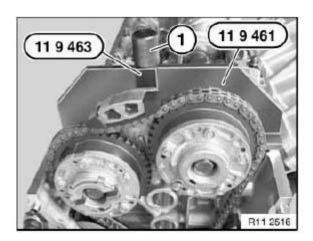


Fig. 596: Identifying Special Tool (11 9 461) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and align exhaust camshaft so that special tool 11 9 462 rests without a gap on cylinder head.

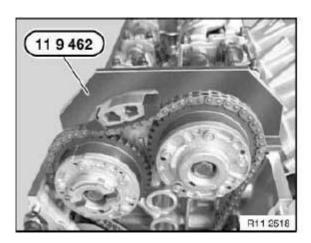


Fig. 597: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Fit special tool 11 9 463, secure screw (1) in thread for oil line and tighten down by hand.

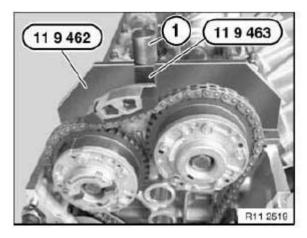


Fig. 598: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: When tightening down screw (2), grip camshaft at hexagon head.

Tighten down screw (2) of exhaust adjustment unit.

Tightening torque 11 36 16AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

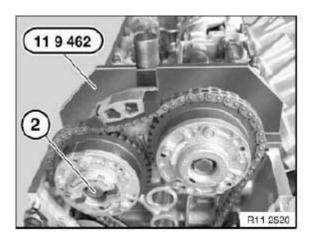


Fig. 599: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.

Release screw (1) and remove special tools 11 9 463 /11 9 462 from exhaust camshaft.

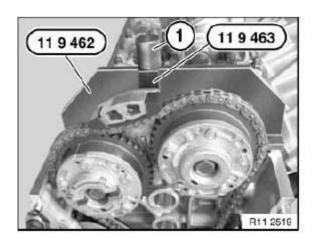


Fig. 600: Identifying Special Tool (11 9 462) And (11 9 463) Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 190.

Crank engine at central bolt twice in direction of rotation until engine returns to firing TDC position of 1st cylinder.

Secure vibration damper with special tool 11 9 190 in firing TDC position of 1st cylinder.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

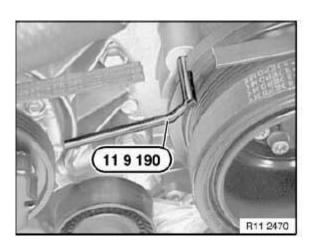


Fig. 601: Identifying Special Tool (11 9 190)
Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 461 on inlet camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 461 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

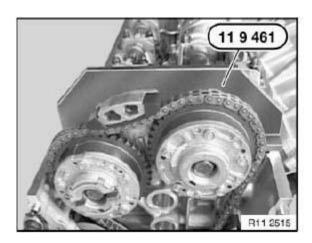


Fig. 602: Identifying Special Tool (11 9 461) Courtesy of BMW OF NORTH AMERICA, INC.

Place special tool 11 9 462 on exhaust camshaft and check timing.

NOTE: The timing is correctly adjusted when special tool 11 9 462 rests flat on the cylinder head or protrudes by up to 0.5 mm to the exhaust side.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

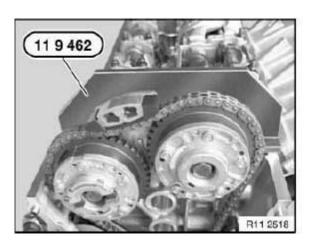


Fig. 603: Identifying Special Tool (11 9 462) Courtesy of BMW OF NORTH AMERICA, INC.


Remove all special tools.

IMPORTANT: Screw (1) is a special screw and must not be replaced with a normal M8 screw.

Clip oil line (3) into retainers (2).

Insert screw (1) and tighten down.

Assemble engine.

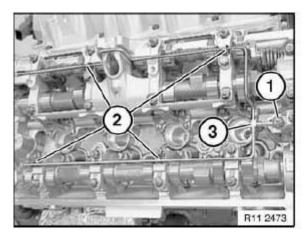

<u>Fig. 604: Identifying Retainer And Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

11 36 715 REMOVING AND INSTALLING/REPLACING BOTH LEFT SOLENOID VALVES (N62/N62TU)

(cylinder bank 5 to 8)

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Necessary preliminary tasks:

- Read out fault memory of control unit of Digital Motor Electronics (DME)
- Switch off ignition
- Remove design cover, if equipped.
- Unlock hose on tank venting valve and disconnect.

NOTE: Solenoid valve (1) controls adjustment unit on inlet side.

Solenoid valve (2) controls adjustment unit on exhaust side.


Unlock plug of solenoid valves (1 and 2) and disconnect.

Release screws and remove holder (3).

Pull out solenoid valves (1 and 2).

Installation:

Check holder (3) for deformation; replace if necessary.

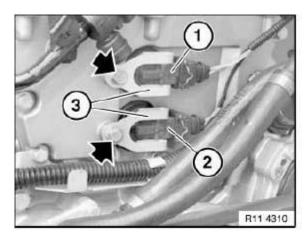


<u>Fig. 605: Locating Solenoid Valve And Holders</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean sealing faces (1) on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

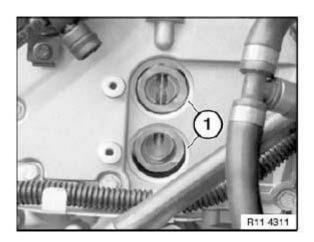

<u>Fig. 606: Identifying Sealing Faces On Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace O-rings (1 and 2) on solenoid valve (3) and lubricate.

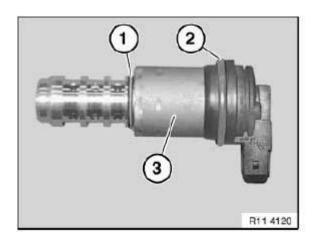


Fig. 607: Identifying Solenoid Valve And O-Rings Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Press in solenoid valve as far as it will go.

Make sure holders are in correct installation positions.

Install and tighten down screws.

Now clear the fault memory.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

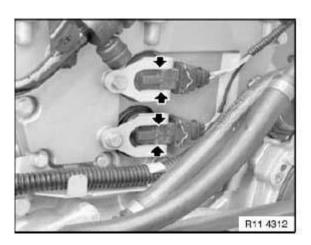


Fig. 608: Identifying Holders And Screws
Courtesy of BMW OF NORTH AMERICA, INC.

11 36 720 REMOVING AND INSTALLING/REPLACING BOTH RIGHT SOLENOID VALVES (N62/N62TU)

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Read out fault memory of control unit of Digital Motor Electronics (DME)
- Switch off ignition
- Unfasten acoustic cover screws. Raise acoustic cover and remove towards front.
- Remove design cover, if equipped.
- Remove upper section of intake filter housing with air-mass flow sensor and intake hose

NOTE: Solenoid valve (1) controls adjustment unit on inlet side.

Solenoid valve (2) controls adjustment unit on exhaust side.

Unlock plug of solenoid valves (1 and 2) and disconnect.


Release screws and remove holder (3).

Pull out solenoid valves (1 and 2).

Installation:

Check holder (3) for deformation; replace if necessary.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

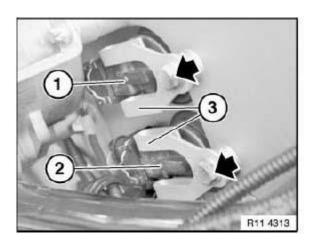

<u>Fig. 609: Locating Solenoid Valves And Holder</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean sealing faces (1) on cylinder head.

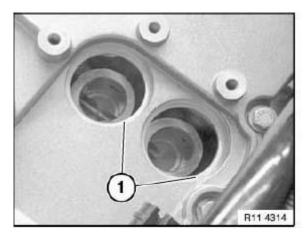


Fig. 610: Identifying Sealing Faces On Cylinder Head Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace O-rings (1 and 2) on solenoid valve (3) and lubricate.

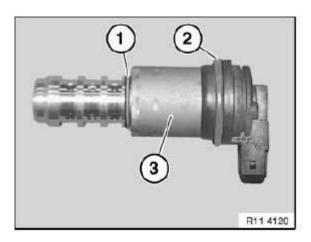


Fig. 611: Identifying Solenoid Valve And O-Rings Courtesy of BMW OF NORTH AMERICA, INC.


Installation:

Press in solenoid valves as far as they will go.

Make sure holders are in correct installation positions.

Install and tighten down screws.

Now clear the fault memory.

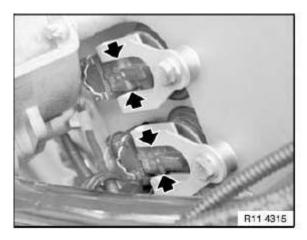

<u>Fig. 612: Identifying Holders And Screws</u> Courtesy of BMW OF NORTH AMERICA, INC.

37 VARIABLE VALVE GEAR

11 37 006 REMOVING AND INSTALLING/REPLACING LEFT ECCENTRIC SHAFT (N62 FROM 9/03 AND N62TU)

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft. See <u>11 37 022 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU).
- Remove ignition coils on cylinder bank 5 to 8
- Remove spark plugs on cylinder bank 5 to 8
- Remove left cylinder head cover. See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).
- Remove left inlet and exhaust adjustment units. See <u>11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).
- Remove left inlet camshaft . See <u>11 31 032 REMOVING AND INSTALLING/REPLACING LEFT INLET CAMSHAFT (N62 FROM 9/03 AND N62TU)</u>.

Eccentric shafts from 2/2003:

NOTE: Eccentric shafts of cylinders 1 to 4 and 5 to 8 are identical parts.

IMPORTANT: Note installation direction of eccentric shafts.

Depending on the side on which the magnet wheel is fitted, the eccentric shafts

are used for cylinders 1 to 4 or 5 to 8.

Incorrect assembly will result in engine damage.

NOTE: The work steps are only described on one bearing position. The procedure is

identical for the other bearing positions.

Carefully tilt bearing shell (1) to one side and simultaneously remove towards top.

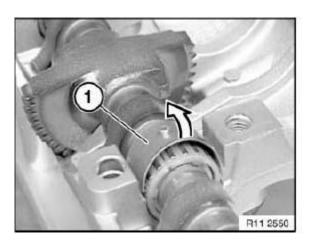


Fig. 613: Tilting Bearing Shell
Courtesy of BMW OF NORTH AMERICA, INC.

Lift out eccentric shaft (1).

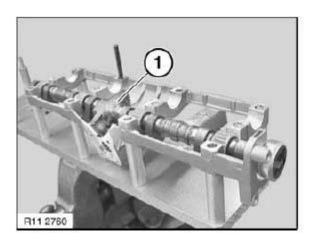


Fig. 614: Identifying Eccentric Shaft Courtesy of BMW OF NORTH AMERICA, INC.

Removal of magnet wheel (if necessary):

NOTE: Carefully clamp eccentric shaft (1) as illustrated with protective jaws (2) in a vice.

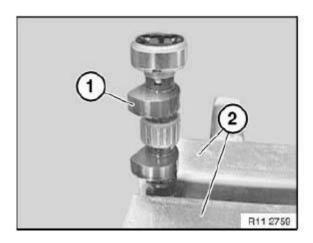


Fig. 615: Identifying Eccentric Shaft Clamp Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Danger of mix-up:

It is very easy to mix up left and right or front and rear on the eccentric shaft.


If necessary, mark the side on which the magnet wheel is fitted.

NOTE: Magnet wheel (1) is extremely magnetic.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

After removal, place magnet wheel in a plastic bag to protect it against metal chips.


Release screw and remove magnet wheel (1).

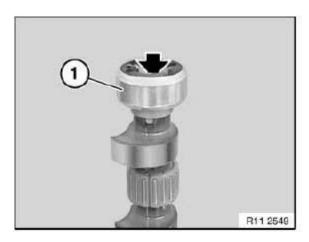

<u>Fig. 616: Identifying Magnet Wheel</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Needle bearings (1) break off very easily when removed and installed.

Carefully press needle bearings (1) apart at split position only to such an extent that they can be removed from eccentric shaft.

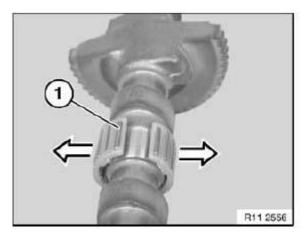


<u>Fig. 617: Pressing Needle Bearings</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: If the needle-roller bearings are replaced, the bearing shells must be replaced as well.

Carefully press bearing shell (1) to one side and simultaneously remove towards top.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

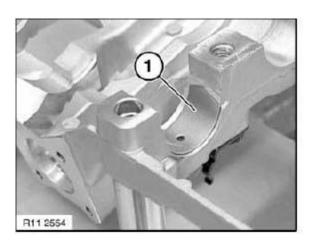

<u>Fig. 618: Identifying Bearing Shell</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation


Installation of eccentric shaft is described separately from removal.

NOTE: Lubricate eccentric shaft at bearing positions.

Replace needle bearing (1).

IMPORTANT: Needle bearings break off very easily when installed.

Carefully press needle bearings (1) apart at split position only to such an extent that they can be fitted over eccentric shaft.

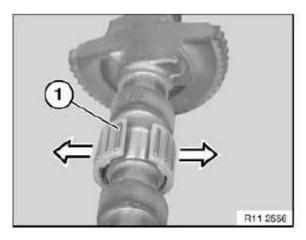

<u>Fig. 619: Pressing Needle Bearings</u> Courtesy of BMW OF NORTH AMERICA, INC.

Eccentric shafts from 2/2003:

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

NOTE: Eccentric shafts of cylinders 1 to 4 and 5 to 8 are identical parts.

IMPORTANT: Note installation direction of eccentric shafts.

Depending on the side on which the magnet wheel is fitted, the eccentric shafts

are used for cylinders 1 to 4 or 5 to 8.

Incorrect assembly will result in engine damage.

Installation of magnet wheel:

NOTE: Carefully clamp eccentric shaft (1) as illustrated with protective jaws (2) in a

vice.

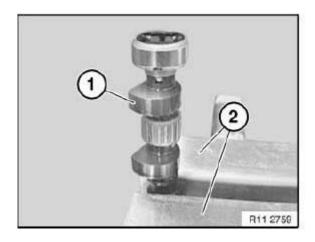


Fig. 620: Identifying Eccentric Shaft Clamp Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Incorrect assembly will result in engine damage.

Assembling eccentric shaft for cylinder bank 5 to 8:

The machined curvature (3) and the groove in the eccentric shaft must point forwards as illustrated.

The unmachined surface on the eccentric points to the left.

Secure magnet wheel (1) with lug in eccentric shaft groove.

IMPORTANT: Only install original antimagnetic screw (2).

Insert screw (2) and tighten down.

Tightening torque 11 37 1AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.


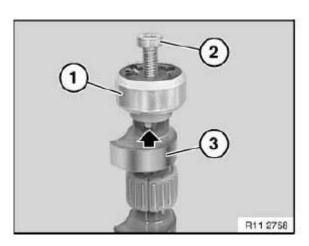


Fig. 621: Identifying Machined Curvature And Magnet Wheel Courtesy of BMW OF NORTH AMERICA, INC.


NOTE: Replace bearing shells (1) of needle bearings.

IMPORTANT: Bearing shells (1) must be installed in such a way that ends of bearing shells (1) face each other as shown in illustration.

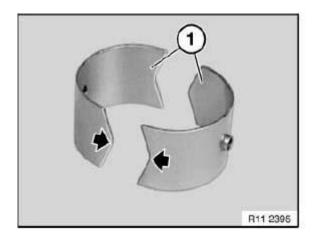


<u>Fig. 622: Identifying Bearing Shells</u> Courtesy of BMW OF NORTH AMERICA, INC.

Insert bearing shells (1) into bearing bracket so that it is secured in bore (2).

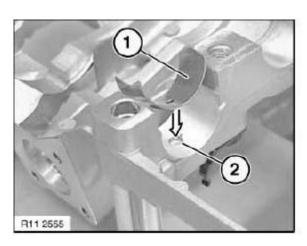

<u>Fig. 623: Inserting Bearing Shells Into Bearing Bracket</u> Courtesy of BMW OF NORTH AMERICA, INC.

Lubricate bearing shells (1) with engine oil.

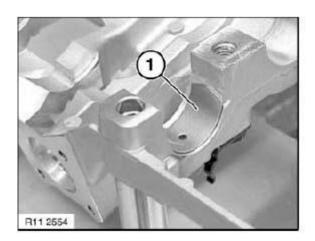


<u>Fig. 624: Identifying Bearing Shell</u> Courtesy of BMW OF NORTH AMERICA, INC.

Cylinder bank 5 to 8:

IMPORTANT: The machined curvature (1) of the eccentric points inwards.


Install eccentric shaft as shown in graphic.

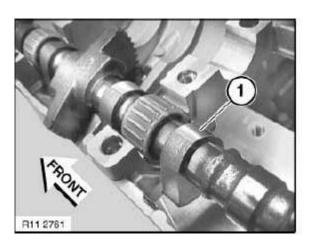

<u>Fig. 625: Identifying Machined Curvature Of Eccentric Points</u> Courtesy of BMW OF NORTH AMERICA, INC.

Lubricate bearing shells (1) with engine oil.

Install bearing shells (1).

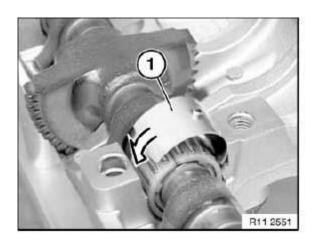

<u>Fig. 626: Installing Bearing Shells</u> Courtesy of BMW OF NORTH AMERICA, INC.

Bearing shells (1) must snap audibly into place.

Check correct position of bearing shells (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

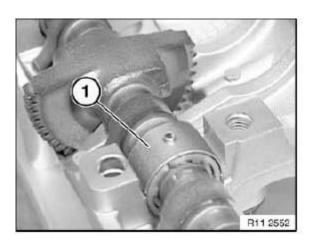


Fig. 627: Identifying Bearing Shells Position Courtesy of BMW OF NORTH AMERICA, INC.

Install left inlet camshaft . See <u>11 31 032 REMOVING AND INSTALLING/REPLACING LEFT INLET CAMSHAFT (N62 FROM 9/03 AND N62TU)</u>.

Assemble engine.

11 37 008 REMOVING AND INSTALLING/REPLACING RIGHT ECCENTRIC SHAFT (N62 FROM 9/03 AND N62TU)

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Remove servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND</u> <u>INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.
- Remove ignition coils on cylinder bank 1 to 4
- Remove spark plugs on cylinder bank 1 to 4
- Remove right cylinder head cover. See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT CYLINDER HEAD COVER (N62/N62TU)</u>.
- Remove right inlet and exhaust adjustment units. See <u>11 36 048 REMOVING AND</u>
 <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u> (N62/N62TU).
- Remove right inlet camshaft . See <u>11 31 034 REMOVING AND INSTALLING/REPLACING RIGHT INLET CAMSHAFT (N62 FROM 9/03 AND N62TU)</u>.

Eccentric shafts from 2/2003:

NOTE: Eccentric shafts of cylinders 1 to 4 and 5 to 8 are identical parts.

IMPORTANT: Note installation direction of eccentric shafts.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Depending on the side on which the magnet wheel is fitted, the eccentric shafts are used for cylinders 1 to 4 or 5 to 8.


Incorrect assembly will result in engine damage.

Removal:

Removal of eccentric shaft is described separately from installation.

NOTE: The work steps are only described on one bearing position. The procedure is identical for the other bearing positions.

Carefully tilt bearing shell (1) to one side and simultaneously remove towards top.

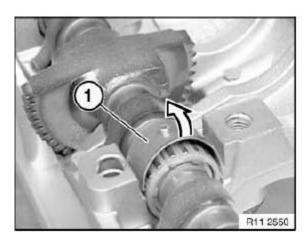

<u>Fig. 628: Tilting Bearing Shell</u> Courtesy of BMW OF NORTH AMERICA, INC.

Lift out eccentric shaft (2).

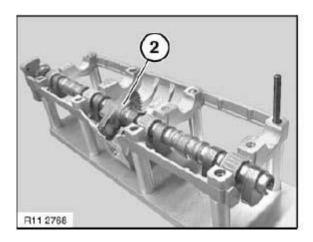


Fig. 629: Identifying Eccentric Shaft Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Removal of magnet wheel (if necessary):

NOTE: Carefully clamp eccentric shaft (1) as illustrated with protective jaws (2) in a vice.

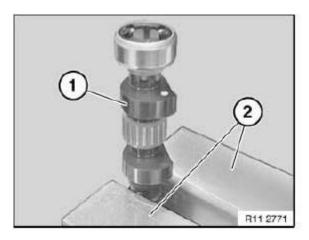


Fig. 630: Identifying Eccentric Shaft Clamp And Protective Jaws Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Danger of mix-up:

It is very easy to mix up left and right or front and rear on the eccentric shaft.

If necessary, mark the side on which the magnet wheel is fitted.

NOTE: Magnet wheel (1) is extremely magnetic.

After removal, place magnet wheel in a plastic bag to protect it against metal chips.

Release screw and remove magnet wheel (1).



ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Fig. 631: Identifying Magnet Wheel Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Needle bearings (1) break off very easily when removed and installed.

Carefully press needle bearings (1) apart at split position only to such an extent that they can be removed from eccentric shaft.

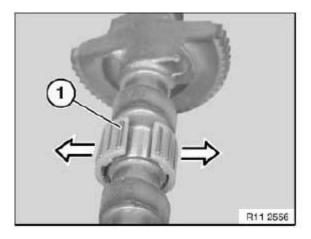


Fig. 632: Pressing Needle Bearings
Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: If the needle-roller bearings are replaced, the bearing shells must be replaced as well.

Carefully press bearing shell (1) to one side and simultaneously remove towards top.

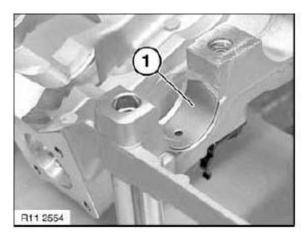


Fig. 633: Identifying Bearing Shell Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Installation of eccentric shaft is described separately from removal.

NOTE: Lubricate eccentric shaft at bearing positions.

Replace needle bearing (1).

IMPORTANT: Needle bearings break off very easily when installed.

Carefully press needle bearings (1) apart at split position only to such an extent that they can be fitted over eccentric shaft.

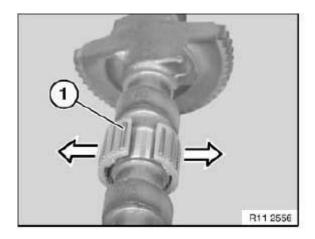


Fig. 634: Pressing Needle Bearings Courtesy of BMW OF NORTH AMERICA, INC.

Eccentric shafts from 2/2003:

NOTE: Eccentric shafts of cylinders 1 to 4 and 5 to 8 are identical parts.

IMPORTANT: Note installation direction of eccentric shafts.

Depending on the side on which the magnet wheel is fitted, the eccentric shafts

are used for cylinders 1 to 4 or 5 to 8.

Incorrect assembly will result in engine damage.

Installation of magnet wheel:

NOTE: Carefully clamp eccentric shaft (1) as illustrated with protective jaws (2) in a

vice.

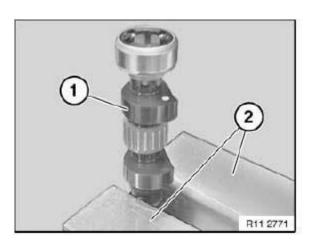


Fig. 635: Identifying Eccentric Shaft Clamp And Protective Jaws Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Incorrect assembly will result in engine damage.

Assemble eccentric shaft for cylinder bank 1 to 4:

The machined curvature (3) and the groove in the eccentric shaft must point forwards as illustrated.

The unmachined surface on the eccentric points to the right.

Secure magnet wheel (1) with lug in eccentric shaft groove.

IMPORTANT: Only install original antimagnetic screw (2).

Insert screw (2) and tighten down.

Tightening torque 11 37 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

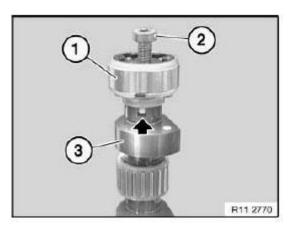


Fig. 636: Identifying Magnet Wheel And Screw Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

NOTE: Replace bearing shells (1) of needle bearings.

IMPORTANT: Bearing shells (1) must be installed in such a way that ends of bearing shells (1) face each other as shown in illustration.

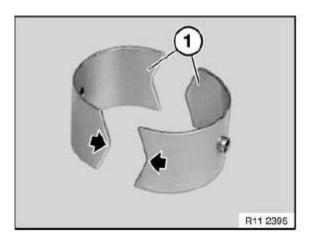


Fig. 637: Identifying Bearing Shells
Courtesy of BMW OF NORTH AMERICA, INC.

Insert bearing shells (1) into bearing bracket so that it is secured in bore (2).


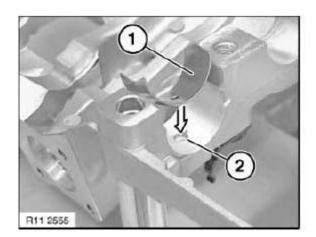


Fig. 638: Inserting Bearing Shells Into Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Lubricate bearing shells (1) with engine oil.

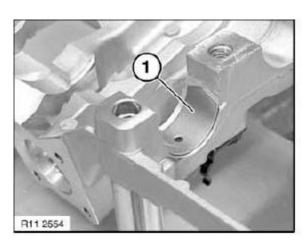

<u>Fig. 639: Identifying Bearing Shell</u> Courtesy of BMW OF NORTH AMERICA, INC.

Cylinder bank 1 to 4:

IMPORTANT: The machined curvature (1) of the eccentric points inwards.

The magnet wheel (2) is at the rear.

Install eccentric shaft as shown in graphic.


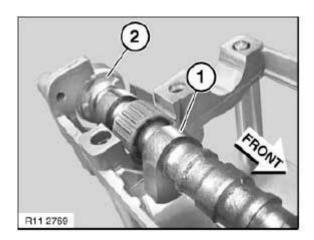


Fig. 640: Installing Eccentric Shaft
Courtesy of BMW OF NORTH AMERICA, INC.

Lubricate bearing shells (1) with engine oil.

Install bearing shells (1).


ENGINE Engine - Repair Instructions - X5 (N62TU V8)

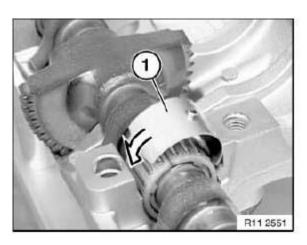

<u>Fig. 641: Installing Bearing Shells</u> Courtesy of BMW OF NORTH AMERICA, INC.

Bearing shells (1) must snap audibly into place.

Check correct position of bearing shells (1).

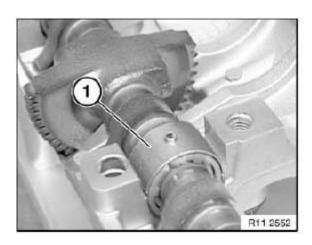

<u>Fig. 642: Identifying Bearing Shells Position</u> Courtesy of BMW OF NORTH AMERICA, INC.

Install right inlet camshaft . See <u>11 31 034 REMOVING AND INSTALLING/REPLACING RIGHT INLET CAMSHAFT (N62 FROM 9/03 AND N62TU)</u>.

Assemble engine.

11 37 012 REMOVING AND INSTALLING/REPLACING LEFT INTERMEDIATE LEVERS (N62 FROM 9/03 AND N62TU)

Special tools required:

• 11 9 470

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

- 11 9 472
- 11 9 473
- 11 9 474
- 11 9 475
- 11 9 480
- 11 9 490

(cylinder bank 5 to 8)

Removal of intermediate levers is described separately from installation.

Necessary preliminary tasks:

- Remove servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND</u> <u>INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.
- Remove ignition coils on cylinder bank 5 to 8
- Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).
- Remove spark plugs on cylinder bank 5 to 8
- Remove left inlet and exhaust adjustment units . See <u>11 36 047 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

Rotate inlet camshaft against direction of rotation until lettering (1) on 8th cylinder points upwards in cylinder axis and cam is horizontal.

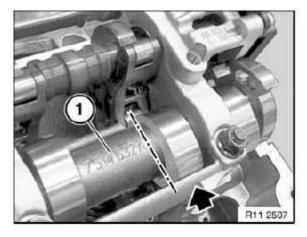


Fig. 643: Locating Camshaft Numbers
Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 5 to 8 with R E1 to

R E5 from inlet side.

Release nuts and remove bearing cap R E1.

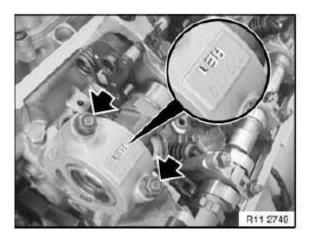


Fig. 644: Locating Camshaft Bearing Caps Nut Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

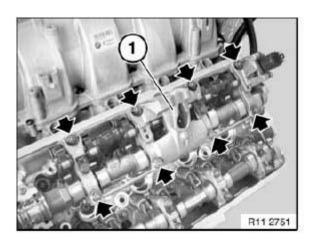


Fig. 645: Locating Nuts Of Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Rocker arms are freely accessible after bearing bracket has been removed.


Do "not" remove rocker arm (1) on inlet side.

IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

The tolerance classes are designated as illustrated with the numbers from 1 to 4.
Used rocker arms (1) may only be reused in the same position.

When replacing rocker arms (1) on inlet side: install rocker arms of the same tolerance class in the same position.

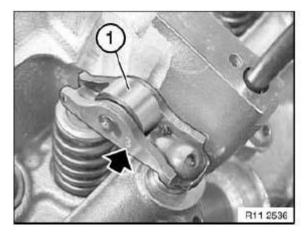

<u>Fig. 646: Locating Rocker Arms On Inlet Side</u> Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

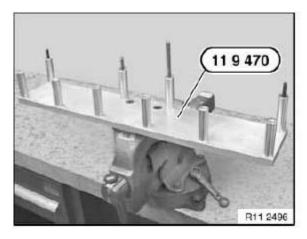


Fig. 647: Identifying Special Tool (11 9 470)
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

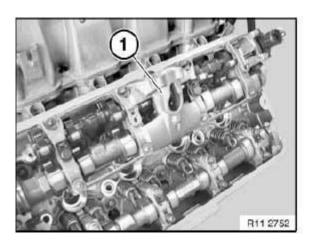


Fig. 648: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).


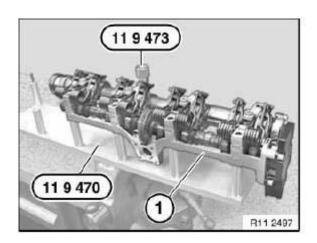


Fig. 649: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

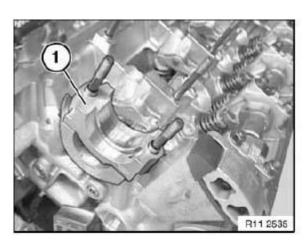

<u>Fig. 650: Identifying Lower Section Of Bearing Bracket On Cylinder Head</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The mounting of the bearing bracket described later can only be carried out if the inlet camshaft has not been axially displaced.

Special tools 11 9 472 and 11 9 475 prevent the inlet camshaft from rotating and moving while the intermediate levers are installed.

Fit special tool 11 9 472 and secure with special tool 11 9 475.


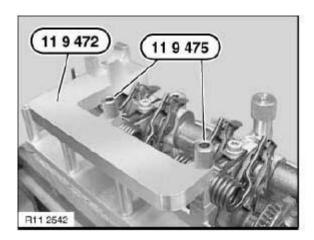


Fig. 651: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Insert special tool 11 9 474 and initially tighten without play.

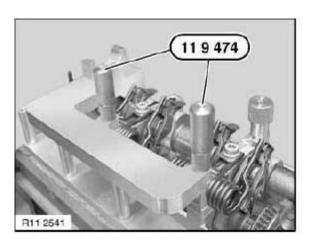

<u>Fig. 652: Identifying Special Tool (11 9 474)</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Removal of intermediate levers is described on 8th cylinder. The same procedure is applicable to cylinders 5 to 7.

Raise one end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

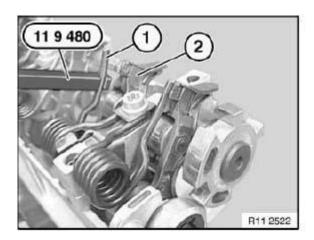


Fig. 653: Identifying Torsion Spring, Intermediate Lever With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

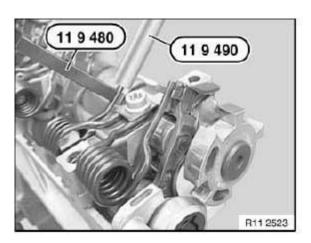



Fig. 654: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

Used intermediate levers (2) may only be reused in the same position.

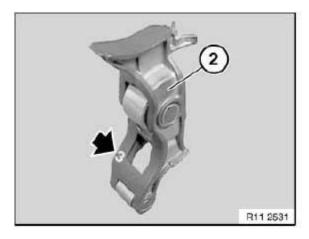

<u>Fig. 655: Locating Intermediate Levers</u> Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

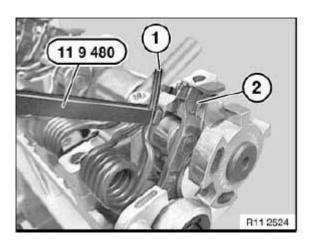


Fig. 656: Identifying Torsion Spring With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to second end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

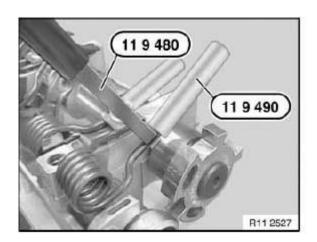


Fig. 657: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Installation of intermediate levers is described separately from removal.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.


Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Used intermediate levers (2) may only be reused in the same position.

Lubricate all sliding surfaces on intermediate lever (2) with engine oil.

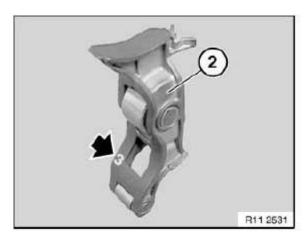

<u>Fig. 658: Locating Intermediate Levers</u> Courtesy of BMW OF NORTH AMERICA, INC.

Raise torsion spring (1) with special tool 11 9 480.

Remove special tool 11 9 490.


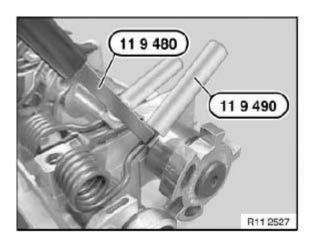


Fig. 659: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).

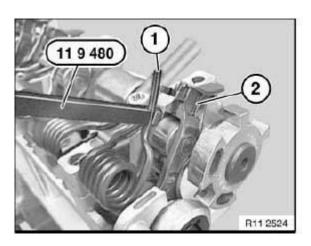

<u>Fig. 660: Identifying Torsion Spring With Special Tool (11 9 480)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring with special tool 11 9 480.

Remove special tool 11 9 490.

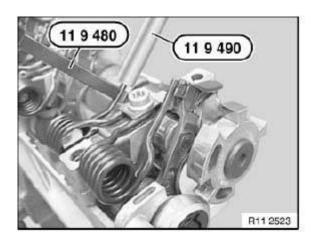



Fig. 661: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.


Insert end of torsion spring (1) into guide on intermediate lever (2).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

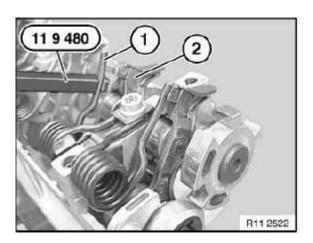

<u>Fig. 662: Identifying Torsion Spring, Intermediate Lever With Special Tool (11 9 480)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 474.

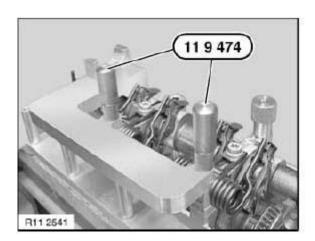

<u>Fig. 663: Identifying Special Tool (11 9 474)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tools 11 9 472 and special tools 11 9 475.


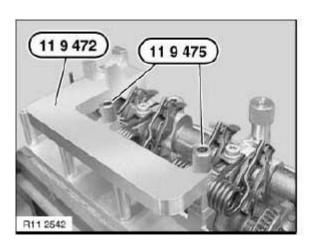


Fig. 664: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

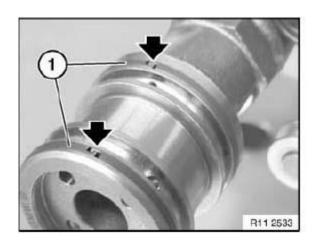


<u>Fig. 665: Locating Compression Rings</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

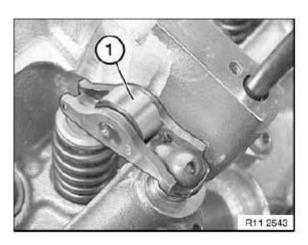

<u>Fig. 666: Identifying Rocker Arms</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

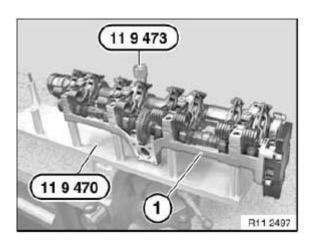


Fig. 667: Identifying Special Tool (11 9 470) And (11 9 473) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.

Insert nuts and tighten by hand without play.


IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

domingo, 3 de octubre de 2021 12:49:37 a. m.	Page 379	© 2011 Mitchell Repair Information Company, LLC.
--	----------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

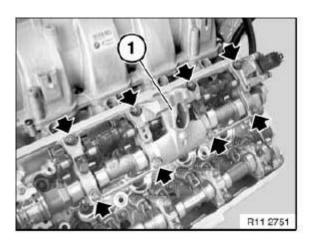


<u>Fig. 668: Locating Nuts Of Bearing Bracket</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

Fit bearing cap R E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

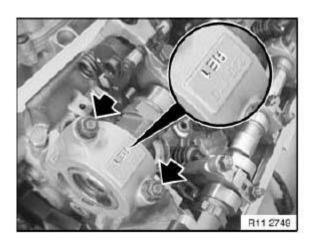

<u>Fig. 669: Locating Camshaft Bearing Caps Nut</u> Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft in direction of rotation until cam on 5th cylinder points upwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

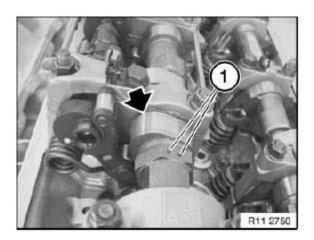


Fig. 670: Locating Marking On Hexagon Drive Of Inlet Camshaft Faces Upwards Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on left side. See <u>11 36 047 REMOVING AND</u> <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON LEFT SIDE</u> (N62/N62TU).

Install spark plugs on cylinder bank 5 to 8.

Install left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).

Install ignition coils on cylinder bank 5 to 8.

Install servomotor for left eccentric shaft . See <u>11 37 022 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

11 37 014 REMOVING AND INSTALLING/REPLACING RIGHT INTERMEDIATE LEVERS (N62 FROM 9/03 AND N62TU)

Special tools required:

- 11 9 470
- 11 9 472
- 11 9 473
- 11 9 474
- 11 9 475
- 11 9 480
- 11 9 490

(cylinder bank 1 to 4)

- 1			
	domingo, 3 de octubre de 2021 12:49:37 a. m.	Page 381	© 2011 Mitchell Repair Information Company, LLC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Removal of intermediate levers is described separately from installation.

Necessary preliminary tasks:

- Remove servomotor from right eccentric shaft. See <u>11 37 024 REMOVING AND</u> INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU).
- Remove ignition coils on cylinder bank 1 to 4
- Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING</u> RIGHT CYLINDER HEAD COVER (N62/N62TU).
- Remove spark plugs on cylinder bank 1 to 4
- Remove right inlet and exhaust adjustment units. See <u>11 36 048 REMOVING AND</u>
 <u>INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE</u> (N62/N62TU).

IMPORTANT: The inlet camshaft must first be rotated so that when the bearing bracket is removed the intermediate levers do not slip out and damage the camshaft.

Rotate inlet camshaft in direction of rotation until cam on 1st cylinder is positioned horizontally as shown in illustration.

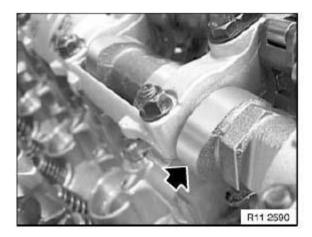


Fig. 671: Locating Camshaft
Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

NOTE: Bearing caps of inlet camshaft are marked on cylinder bank 1 to 4 with L E1 to L E5 from inlet side.

Release nuts and remove bearing cap L E1.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

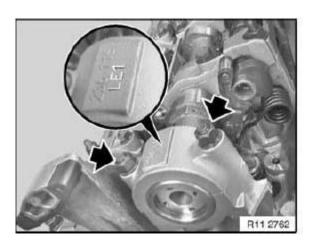


Fig. 672: Locating Bearing Cap L E1 And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

Release 8 nuts of bearing bracket (1) from outside to inside.

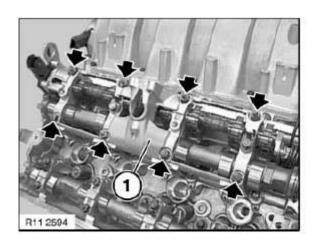


Fig. 673: Locating Camshaft Bearing Bracket And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Rocker arms are freely accessible after bearing bracket has been removed.

Do "not" remove rocker arm (1) on inlet side.

IMPORTANT: Rocker arms (1) are divided into individual tolerance classes.


The tolerance classes are designated as illustrated with the numbers from 1 to 4.

Used rocker arms (1) may only be roused in the same position.

Used rocker arms (1) may only be reused in the same position.

When replacing rocker arms (1) on inlet side: install rocker arms of the same tolerance class in the same position.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

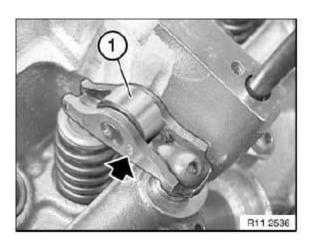

<u>Fig. 674: Locating Rocker Arms On Inlet Side</u> Courtesy of BMW OF NORTH AMERICA, INC.

Clamp special tool 11 9 470 as illustrated in a vice.

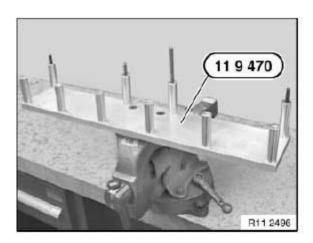


Fig. 675: Identifying Special Tool (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Carefully lift out bearing bracket (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

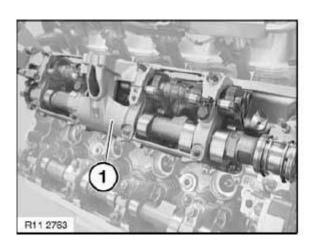


Fig. 676: Identifying Bearing Bracket Courtesy of BMW OF NORTH AMERICA, INC.

Place bearing bracket (1) with inlet camshaft and eccentric shaft as illustrated on special tool 11 9 470.

Secure bearing bracket (1) with a nut (special tool 11 9 473).


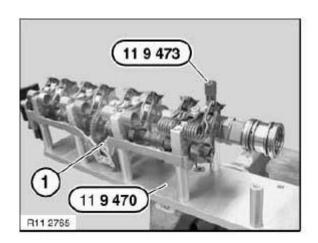


Fig. 677: Identifying Special Tool (11 9 473) And (11 9 470) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: The lower section of the bearing bracket (1) is machined with the cylinder head and must not be mixed up.

NOTE: Lower section of bearing bracket (1) remains on cylinder head.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

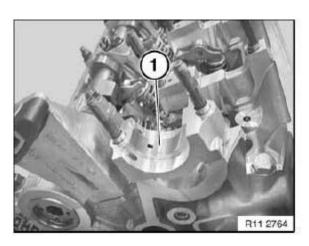

<u>Fig. 678: Identifying Lower Section Of Bearing Bracket</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: The mounting of the bearing bracket described later can only be carried out if the inlet camshaft has not been axially displaced.

Special tools 11 9 472 and 11 9 475 prevent the inlet camshaft from rotating and moving while the intermediate levers are installed.

Fit special tool 11 9 472 and secure with special tool 11 9 47 5.

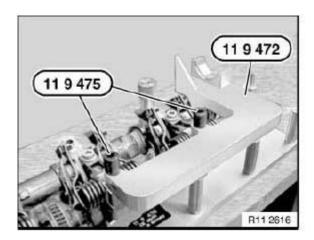


Fig. 679: Identifying Special Tool (11 9 474) And (11 9 472) Courtesy of BMW OF NORTH AMERICA, INC.

Insert special tool 11 9 474 and initially tighten without play.

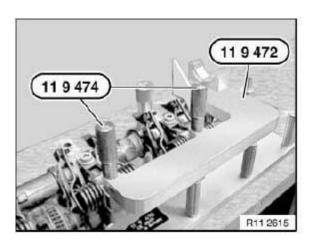


Fig. 680: Identifying Special Tool (11 9 474) And (11 9 472) Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Removal of intermediate levers is described on 4th cylinder. The same procedure is applicable to cylinders 1 to 3.

Raise one end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

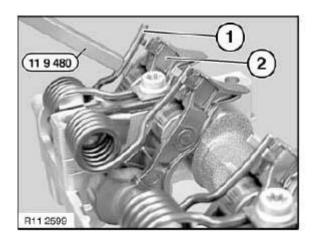


Fig. 681: Identifying Intermediate Lever And Torsion Spring Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

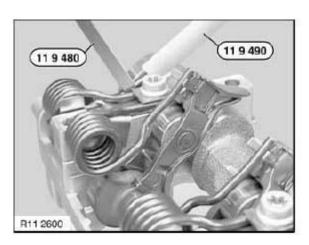



Fig. 682: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.

Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

Used intermediate levers (2) may only be reused in the same position.

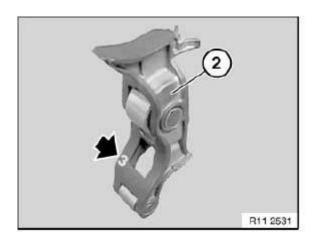

<u>Fig. 683: Locating Intermediate Levers</u> Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring (1) with special tool 11 9 480.

Lift out intermediate lever (2) and set down in an orderly fashion.

IMPORTANT: Keep holding torsion spring (1) with special tool 11 9 480.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

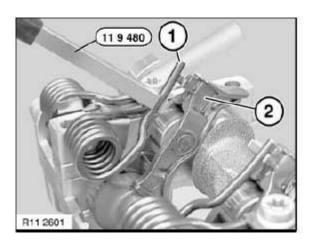


Fig. 684: Identifying Intermediate Lever, Torsion Spring With Special Tool (11 9 480) Courtesy of BMW OF NORTH AMERICA, INC.

Attach special tool 11 9 490 to second end of torsion spring.

Support end of torsion spring protected with special tool 11 9 490 on inlet camshaft.

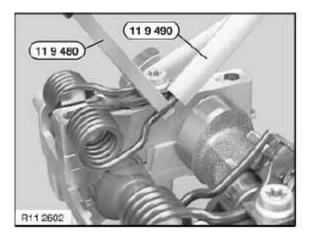


Fig. 685: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Installation

Removal of intermediate levers is described separately from installation.

Clean all bearings and cams of inlet camshaft and lubricate with engine oil.

IMPORTANT: Intermediate levers (2) are divided into individual tolerance classes.


Only intermediate levers of the same tolerance class may be fitted in a single cylinder head.

The tolerance classes are designated as illustrated with the numbers from 1 to 5.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Used intermediate levers (2) may only be reused in the same position.

Lubricate all sliding surfaces on intermediate lever (2) with engine oil.

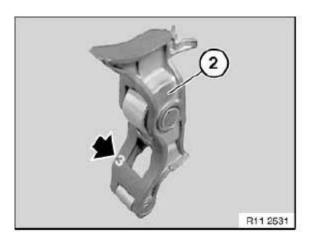

<u>Fig. 686: Locating Intermediate Levers</u> Courtesy of BMW OF NORTH AMERICA, INC.

Raise torsion spring (1) with special tool 11 9 480.

Remove special tool 11 9 490.


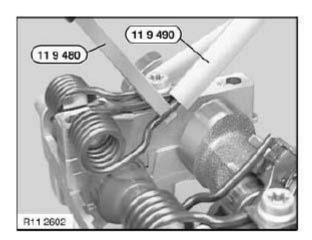


Fig. 687: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).

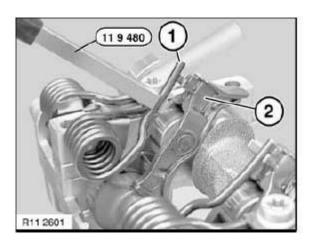

<u>Fig. 688: Identifying Intermediate Lever, Torsion Spring With Special Tool (11 9 480)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Raise second end of torsion spring with special tool 11 9 480.

Remove special tool 11 9 490.

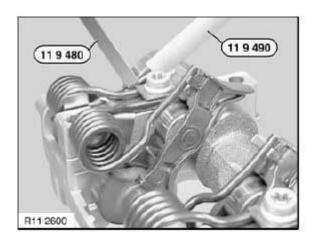


Fig. 689: Identifying Special Tool (11 9 480) And (11 9 490) Courtesy of BMW OF NORTH AMERICA, INC.

Hold torsion spring (1) with special tool 11 9 480.

Install intermediate lever (2) from above.

Insert end of torsion spring (1) into guide on intermediate lever (2).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


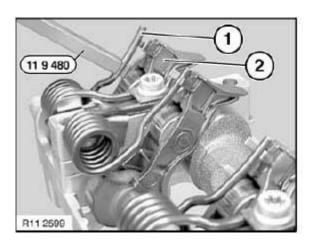


Fig. 690: Identifying Intermediate Lever And Torsion Spring Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 474.

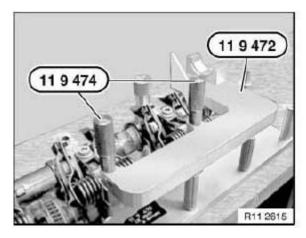

<u>Fig. 691: Identifying Special Tool (11 9 474) And (11 9 472)</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tools 11 9 472 and special tools 11 9 475.


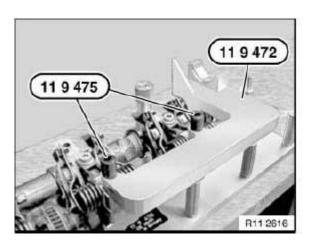


Fig. 692: Identifying Special Tool (11 9 474) And (11 9 472) Courtesy of BMW OF NORTH AMERICA, INC.

Ends of compression rings (1) point upwards.

Make sure compression rings (1) are engaged at ends.

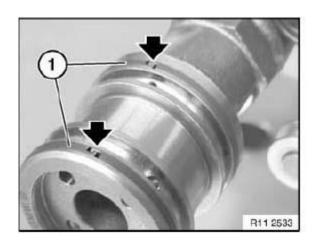

<u>Fig. 693: Locating Compression Rings</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Rocker arms (1) slip slightly when bearing bracket is fitted.

Make sure rocker arms (1) are secured as illustrated on hydraulic valve clearance compensating elements and on valves.

Align rockers (1) straight.

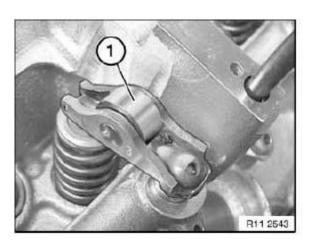


Fig. 694: Identifying Rocker Arms
Courtesy of BMW OF NORTH AMERICA, INC.

Remove special tool 11 9 473.

Remove bearing bracket (1) from special tool 11 9 470.

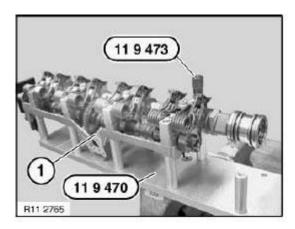


Fig. 695: Identifying Camshaft Bearing Caps Of Cylinders Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Do not tilt bearing bracket (1).

Lower bearing bracket (1) from above and carefully bring into contact with cylinder head.


Insert nuts and tighten by hand without play.

IMPORTANT: Make sure none of the intermediate levers or rocker arms have slipped out.

Tighten down nuts from inside to outside.

Tightening torque 11 31 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

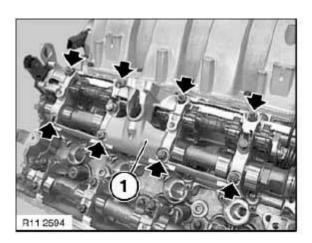

<u>Fig. 696: Locating Camshaft Bearing Bracket And Nuts</u> Courtesy of BMW OF NORTH AMERICA, INC.

IMPORTANT: Camshaft bearing caps of cylinders 1 to 4 and 5 to 8 must not be mixed up.

Fit bearing cap L E1 in such a way that marking is legible from inlet side.

Install nuts and tighten down.

Tightening torque 11 31 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

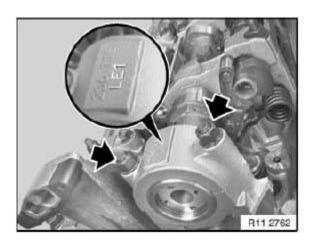


Fig. 697: Locating Bearing Cap L E1 And Nuts Courtesy of BMW OF NORTH AMERICA, INC.

Rotate inlet camshaft at hexagon head against direction of rotation until cam on 1st cylinder points downwards at an angle as shown in illustration.

NOTE: The marking (1) on the hexagon drive of the inlet camshaft faces upwards.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

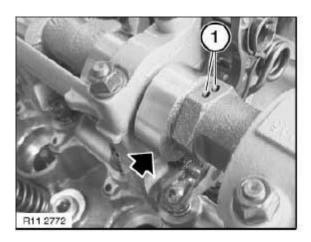


Fig. 698: Locating Marking On Hexagon Drive Of Inlet Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

Install inlet and exhaust adjustment unit on right side. See 11 36 048 REMOVING AND INSTALLING/REPLACING INLET AND EXHAUST ADJUSTMENT UNITS ON RIGHT SIDE (N62/N62TU).

Install spark plugs on cylinder bank 1 to 4.

Install right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING RIGHT</u> <u>CYLINDER HEAD COVER (N62/N62TU)</u>.

Install ignition coils on cylinder bank 1 to 4.

Install servomotor for right eccentric shaft. See <u>11 37 024 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)</u>.

Assemble engine.

11 37 022 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR LEFT ECCENTRIC SHAFT (N62/N62TU)

IMPORTANT: Follow instructions issued by diagnosis tester.
Risk of damage to intermediate shaft.

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Connect diagnosis tester.
- Unfasten acoustic cover screws. Raise acoustic cover and remove towards front.
- Remove ignition coil cover

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

IMPORTANT: Follow instructions issued by diagnosis tester.

Unlock plug (1) on servomotor (2) and disconnect.


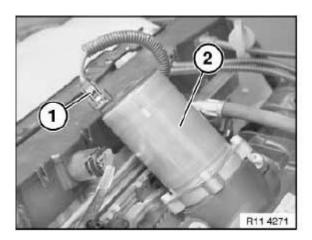


Fig. 699: Identifying Plug On Servomotor Courtesy of BMW OF NORTH AMERICA, INC.

Unfasten screws.

Rotate servomotor (2) until no longer engaged in spline teeth of eccentric shaft.

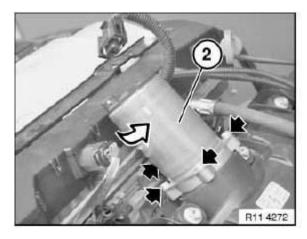

<u>Fig. 700: Rotating Servomotor</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace sealing ring on spacer.

Install servomotor (1) and screw in up to spacer.

Rotate servomotor (1) into correct installation position.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Install and tighten down screws.

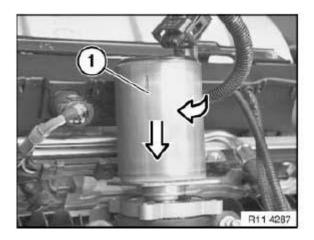


Fig. 701: Rotating Servomotor Into Correct Installation Position Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Read out fault memory of control unit of Digital Motor Electronics (DME).

Check stored fault messages.

Rectify faults.

Now clear the fault memory.

11 37 024 REMOVING AND INSTALLING/REPLACING SERVOMOTOR FOR RIGHT ECCENTRIC SHAFT (N62/N62TU)

IMPORTANT: Follow instructions issued by diagnosis tester.
Risk of damage to intermediate shaft.


(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Connect diagnosis tester
- Unfasten acoustic cover screws. Raise acoustic cover and remove towards front.
- Remove ignition coil cover

IMPORTANT: Follow instructions issued by diagnosis tester.


Unlock plug (1) on servomotor (2) and disconnect.

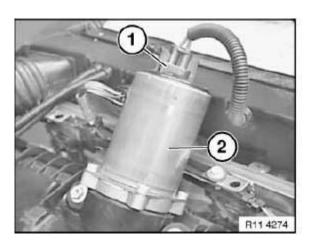

<u>Fig. 702: Identifying Plug On Servomotor</u> Courtesy of BMW OF NORTH AMERICA, INC.

Unfasten screws.

Rotate servomotor (2) until no longer engaged in spline teeth of eccentric shaft.

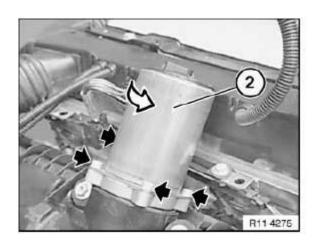

<u>Fig. 703: Rotating Servomotor</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:


Replace sealing ring on spacer.

Install servomotor (1) and screw in up to spacer.

Rotate servomotor (1) into correct installation position.

Install and tighten down screws.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

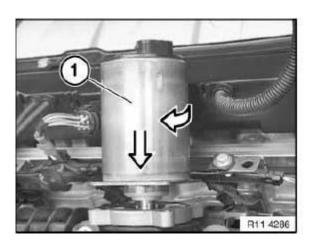

<u>Fig. 704: Identifying Sealing Ring</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Read out fault memory of control unit of Digital Motor Electronics (DME).

Check stored fault messages.

Rectify faults.

Now clear the fault memory.

11 37 035 REMOVING AND INSTALLING/REPLACING LEFT ECCENTRIC SHAFT SENSOR (N62/N62TU)

(cylinder bank 5 to 8)


Necessary preliminary tasks:

• Remove left cylinder head cover . See <u>11 12 005 REMOVING AND INSTALLING/SEALING LEFT</u> CYLINDER HEAD COVER (N62/N62TU).

Unfasten screws.

Remove eccentric shaft sensor (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

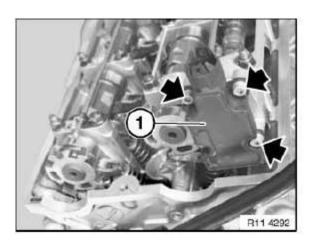

<u>Fig. 705: Locating Eccentric Shaft Sensor Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Read out fault memory of control unit of Digital Motor Electronics (DME).

Check stored fault messages.

Rectify faults.

Now clear the fault memory.

11 37 040 REMOVING AND INSTALLING/REPLACING RIGHT ECCENTRIC SHAFT SENSOR (N62/N62TU)

(cylinder bank 1 to 4)

Necessary preliminary tasks:

• Remove right cylinder head cover . See <u>11 12 006 REMOVING AND INSTALLING/SEALING</u> RIGHT CYLINDER HEAD COVER (N62/N62TU).

Unfasten screws.

Remove eccentric shaft sensor (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

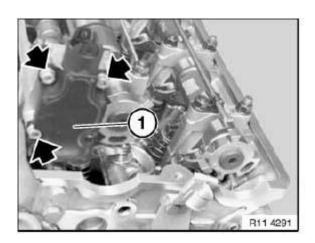


Fig. 706: Locating Eccentric Shaft Sensor Screw Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Read out fault memory of control unit of Digital Motor Electronics (DME).

Check stored fault messages.

Rectify faults.

Now clear the fault memory.

11 37 700 REPLACING CONTROL UNIT (VALVETRONIC)

Switch off ignition.

Disconnect battery leads. See <u>12 00... INSTRUCTIONS FOR DISCONNECTING AND CONNECTING BATTERY</u>.

CAUTION: Follow instructions for removing and installing electronic control units .

See 12 00 ... INSTRUCTIONS FOR REMOVING AND INSTALLING
ELECTRONIC CONTROL UNITS .

Observe following instructions before replacing control unit:

Program control unit . See 12 14 705 PROGRAMMING CONTROL UNIT (DME / DDE) .

Remove right fresh air duct . See <u>64 31 053 REMOVING AND INSTALLING OR REPLACING FRESH AIR DUCT</u>.


Release screw and remove holder (1).

Release screws and remove cover (2) from control unit box.

domingo, 3 de octubre de 2021 12:49:38 a. m.	Page 402	© 2011 Mitchell Repair Information Company, LLC.
--	----------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)


NOTE: Release screws on seal (3) only when removing wiring harness.

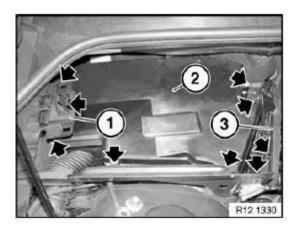

<u>Fig. 707: Locating Holder, Screws And Cover</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Insert tabs (1) in openings (2) and close cover.

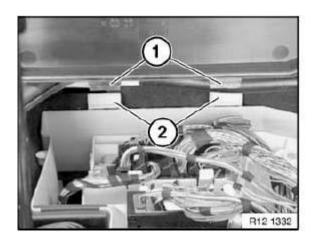


<u>Fig. 708: Locating Tabs And Cover</u> Courtesy of BMW OF NORTH AMERICA, INC.

Unlock and detach plug connections on Valvetronic control unit (1).

Remove Valvetronic control unit (1).

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

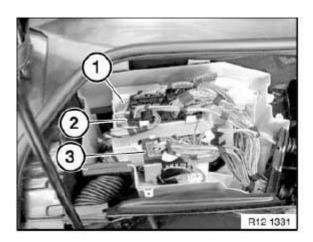

<u>Fig. 709: Identifying Valvetronic Control Unit</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Interrogate fault memory of DME control unit.

Check stored fault messages.

Rectify faults.

Then clear fault memory.

40 OIL SUPPLY

11 40 000 CHECKING ENGINE OIL PRESSURE

Special tools required:

- 11 4 050
- 13 3 061
- 13 3 063
- 13 6 051
- 13 6 054

NOTE: To check the engine oil pressure, the oil pressure switch must be removed and

the special tools installed and connected.

NOTE: A small amount of oil will emerge when the oil pressure switch is removed.

Have a cleaning cloth ready.

Make sure no oil runs onto belt drive.

Remove any remnants of oil immediately with cleaning cloth.

domingo, 3 de octubre de 2021 12:49:38 a. m.	Page 404	© 2011 Mitchell Repair Information Company, LLC.
--	----------	--

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Remove oil pressure switch.

Installation:

Tightening torque, 12 61 1AZ. See **ENGINE ELECTRICAL SYSTEM - TIGHTENING TORQUES**.

Install special tool 11 4 050 with sealing ring (1) in place of oil pressure switch.

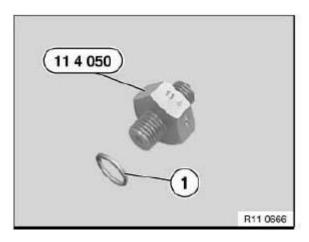


Fig. 710: Identifying Special Tool (11 4 050)
Courtesy of BMW OF NORTH AMERICA, INC.

Check engine oil pressure with DIS Tester

Attach special tool 13 6 054 with sealing ring (1) and special tool 13 6 051 and connect to DIS Tester.

Check engine oil pressure with pressure gauge

Install special tool 13 3 063 and special tool 13 3 061 (pressure gauge).

Start engine and check engine oil pressure.

Specified value . See \underline{ENGINE} - $\underline{TECHNICAL\ DATA}$ - $\underline{V8}$ ($\underline{N62TU}$) .

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

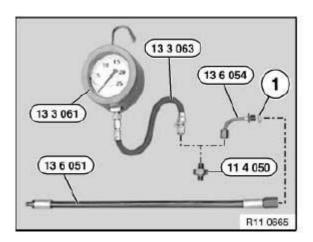


Fig. 711: Identifying Special Tool (13 3 061), (13 6 051) And (13 6 054) Courtesy of BMW OF NORTH AMERICA, INC.

41 OIL PUMP WITH FILTER AND DRIVE

11 41 000 REMOVING AND INSTALLING/REPLACING OIL PUMP (N62)


Necessary preliminary tasks:

- Drain engine oil.
- Remove upper oil sump section . See <u>11 13 010 REMOVING AND INSTALLING/REPLACING OIL SUMP TOP SECTION (N62/N62TU)</u>.
- Remove reinforcement plate.

Unscrew nut (1).

Tightening torque 11 41 4AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

Remove oil pump sprocket wheel (2).

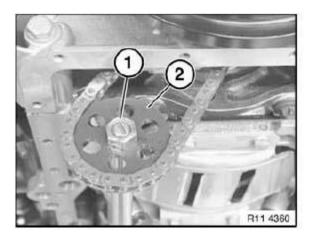

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

<u>Fig. 712: Identifying Oil Pump Sprocket Wheel</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screws, remove oil pump (1) with aid of a second person.

Installation:

Replace screws.

Tightening torque 11 41 2AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

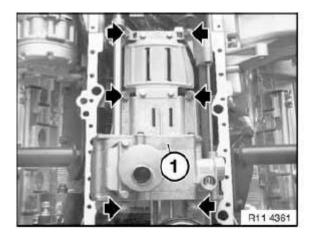


Fig. 713: Locating Oil Pump And Screw
Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace sealing ring (1).

Apply light coat of oil to sealing ring (1).

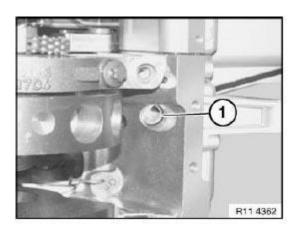



Fig. 714: Identifying Sealing Ring Courtesy of BMW OF NORTH AMERICA, INC.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Installation:

Insert oil line (2) in crankcase.

Do not damage sealing ring.

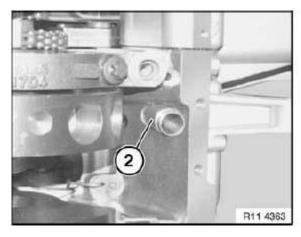

<u>Fig. 715: Identifying Oil Line</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace sealing ring (1).

Apply light coat of oil to sealing ring (1).

Insert oil line (2) in bore hole in oil pump.

Replace sealing ring (3).

Apply light coat of oil to sealing ring (3).

Do not damage sealing rings.

Make sure oil lines are correctly seated.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

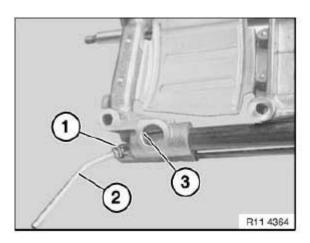


Fig. 716: Identifying Oil Line In Bore Hole In Oil Pump Courtesy of BMW OF NORTH AMERICA, INC.

Install oil pump with aid of a second person.

Assemble engine.

43 OIL FILLING, DIPSTICK

11 43 000 REMOVING AND INSTALLING/SEALING GUIDE TUBE FOR OIL DIPSTICK (N62)

Necessary preliminary tasks:

- Remove intake air manifold . See <u>11 61 050 REMOVING AND INSTALLING INTAKE AIR MANIFOLD (N62)</u>.
- Drain engine oil.

NOTE: For purposes of clarity, this work step is shown on the engine after it has been removed.

Unlock and detach vacuum line (1).

Release screws and remove check valve (2).

Remove guide tube (3) upwards.

Installation:

Replace sealing ring on guide tube.

Apply light coat of oil to seal.

Replacing sealing ring on check valve pipe.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Apply light coat of oil to seal.

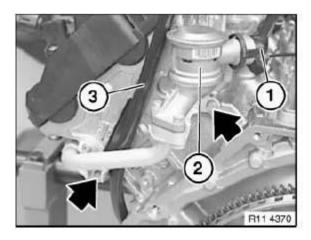


Fig. 717: Locating Vacuum Line And Check Valve Courtesy of BMW OF NORTH AMERICA, INC.

Assemble engine.

Check engine for leaks.

51 WATER PUMP WITH DRIVE

11 51 000 REMOVING AND INSTALLING/REPLACING WATER PUMP (N62/N62TU)

WARNING: Only carry out work on the cooling system after the engine has cooled down (risk of scalding).

Follow instructions for working on cooling system . See 17 00 ...

INSTRUCTIONS FOR WORKING ON COOLING SYSTEM.

Necessary preliminary tasks:

- Drain and dispose of coolant from radiator.
- Remove fan cowl.
- Remove electric fan.
- Remove alternator drive belt . See <u>11 28 010 REPLACING ALTERNATOR DRIVE BELT</u> (N62/N62TU).


Unlock and detach plug connections (1).

Release screw and remove vacuum line holder.

Unlock and detach all coolant hoses on water pump.

Release screws and remove belt pulley (2).


domingo, 3 de octubre de 2021 12:49:38 a. m.	Page 410	© 2011 Mitchell Repair Information Company, LLC.
--	----------	--

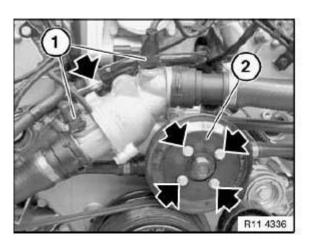

<u>Fig. 718: Locating Plug Connections</u> Courtesy of BMW OF NORTH AMERICA, INC.

Remove vibration damper . See <u>11 23 010 REMOVING AND INSTALLING/REPLACING VIBRATION DAMPER (N62/N62TU)</u>.

Release screws and remove water pump (1).

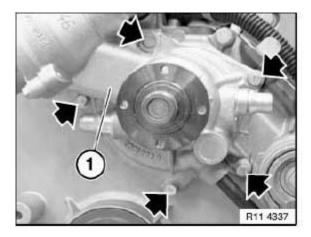

<u>Fig. 719: Locating Water Pump Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Check adapter sleeve (1) for correct seating and damage; replace if necessary.

Clean sealing faces (2).

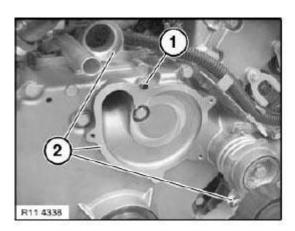


Fig. 720: Identifying Adapter Sleeve And Sealing Faces Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean sealing surfaces.

Replace sealing rings (1 and 2).

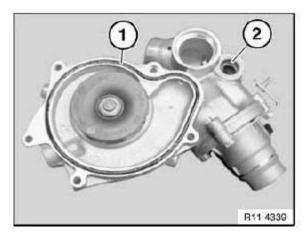



Fig. 721: Identifying Sealing Rings And Sealing Surfaces Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace both coolant pipes (1) and coat sealing surfaces with anti-friction rubber coating.

Thin coolant pipe (1) only with water-cooled alternator.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

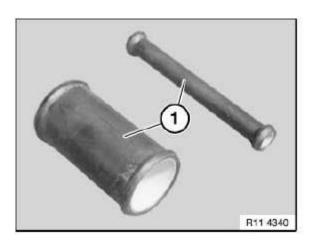

<u>Fig. 722: Identifying Coolant Pipe</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Remove coolant thermostat and coolant sensor of faulty water pump.

Check coolant thermostat and coolant sensor for damage and replace if necessary.

Install coolant thermostat and coolant sensor in new water pump.

Assemble engine.

Vent cooling system and check for leaks . See <u>17 00 039 VENTING COOLING SYSTEM AND CHECKING FOR WATER LEAKS (N52K)</u>.

52 FAN

11 52 020 REMOVING AND INSTALLING OR REPLACING FAN CLUTCH (N62)

Special tools required:

- 11 5 040
- 11 5 050

CAUTION: Left-hand threads.

Using special tool 11 5 050 brace against pulley and unfasten cap nut from water pump using special tool 11 5 040.

Remove fan wheel with fan coupling from water pump.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

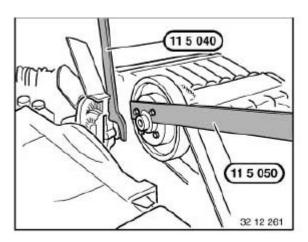


Fig. 723: Identifying Special Tool (11 5 040) And (11 5 050) Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Tighten down fan impeller using special tool 11 5 040.

Tightening torque 11 52 1AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .


NOTE: When using special tool 11 5 040, 30 Nm on the torque wrench scale are equivalent to a tightening torque of 40 Nm.



Fig. 724: Identifying Special Tool (11 5 040) Courtesy of BMW OF NORTH AMERICA, INC.

Release screws, detach fan from fan clutch.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

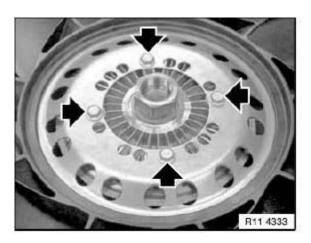

<u>Fig. 725: Locating Fan Clutch Screw</u> Courtesy of BMW OF NORTH AMERICA, INC.

53 THERMOSTAT AND CONNECTIONS

11 53 000 REMOVING AND INSTALLING/REPLACING COOLANT THERMOSTAT (N62)

WARNING: Danger of scalding!
Only perform these tasks on an engine that has cooled down.

Recycling:

Catch and dispose of drained coolant.

Observe country-specific waste-disposal regulations.

Follow instructions for working on cooling system . See <u>17 00 ... INSTRUCTIONS FOR WORKING ON</u> COOLING SYSTEM .

Remove front underbody protection.


Remove coolant drain plug on radiator. Drain and dispose of coolant.

Unlock plug (1) and remove.

Unlock and detach water hose (2).

Unfasten nut.

Release screws and remove coolant thermostat (3).

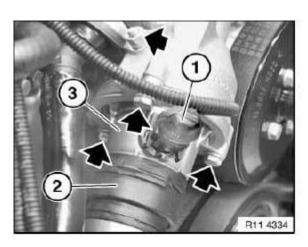

<u>Fig. 726: Locating Water Hose And Plug</u> Courtesy of BMW OF NORTH AMERICA, INC.

NOTE: Coolant thermostat is integrated in cover and can only be replaced as a complete unit.

Clean sealing surfaces.

Replace sealing ring (1).

Installation:

Top up coolant.

Vent cooling system and check for leaks . See <u>17 00 039 VENTING COOLING SYSTEM AND CHECKING FOR WATER LEAKS (N52K)</u>.

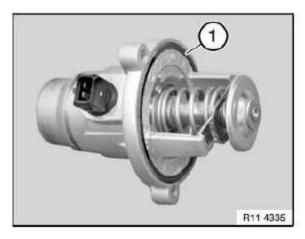


Fig. 727: Identifying Sealing Ring Courtesy of BMW OF NORTH AMERICA, INC.

61 INTAKE MANIFOLD

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

11 61 050 REMOVING AND INSTALLING INTAKE AIR MANIFOLD (N62)

Remove acoustic cover. To remove, unfasten screws. Raise acoustic cover and remove towards front.

Remove design cover, if equipped.

Remove center of bulkhead.


Remove intake hose.

Remove injection pipe.

On rear side of manifold, unlock and disconnect plug on differential pressure sensor and on servomotor.

Unlock and detach vent hose (1).

Remove cable from holder.

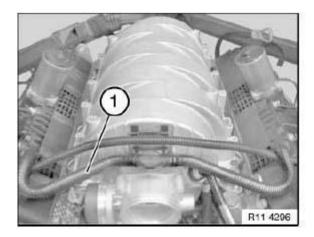


<u>Fig. 728: Identifying Vent Hose</u> Courtesy of BMW OF NORTH AMERICA, INC.

Unfasten screws.

Remove intake air manifold (2) upwards with aid of a second person.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

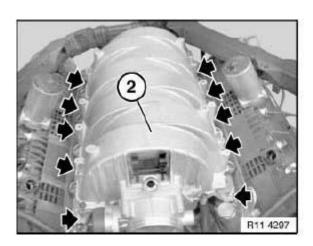

<u>Fig. 729: Locating Intake Air Manifold</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean sealing faces (1) on intake air manifold (2).

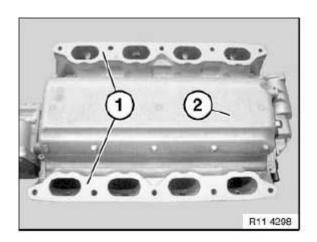


Fig. 730: Identifying Sealing Faces On Intake Air Manifold Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Clean sealing face (1) on left and right.

Replace gasket on left and right.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

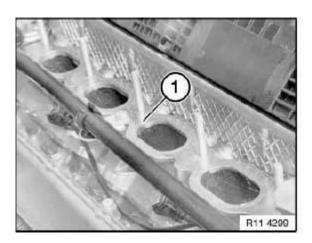


Fig. 731: Identifying Sealing Face
Courtesy of BMW OF NORTH AMERICA, INC.

Assemble engine.

Check air intake system for leaks.

66 VACUUM PUMP

11 66 000 REMOVING AND INSTALLING/REPLACING VACUUM PUMP (N62/N62TU)

NOTE: Press brake pedal several times in order to reduce vacuum pressure in brake booster.

Installation location:

Vacuum pump is fitted on cylinder head 1 to 4 at front on exhaust camshaft.

Remove design cover, if equipped.

Remove acoustic cover. To remove, unfasten screws. Raise acoustic cover and remove towards front.

Remove intake hose with air-mass flow sensor and upper section of intake filter housing.


IMPORTANT: Installation:

Due to the risk of damage to the engine gaskets/seals and the lack of brake boosting, make sure before starting the engine that all the vacuum lines are connected.

Open hose clip (1) and pull off vacuum line.

Release nuts on hose holders.


Remove vacuum hose.

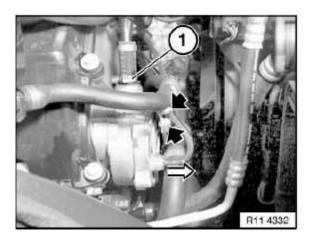

<u>Fig. 732: Identifying Hose Clip</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release screws and remove holder (1).

Remove vacuum pump (2).

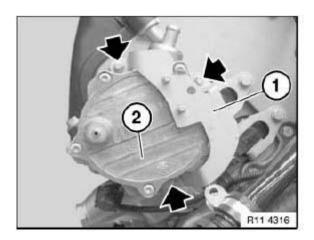

<u>Fig. 733: Identifying Screws, Holder And Vacuum Pump</u> Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Replace sealing ring (1) and secure with grease.

Drive (2) must be rotated into correct position prior to installation.

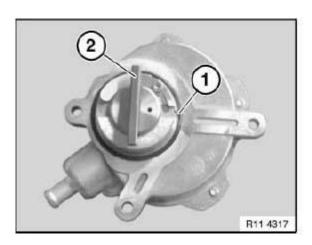


Fig. 734: Identifying Sealing Ring And Drive Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Align vacuum pump drive to groove (3) on exhaust camshaft.

Vacuum pump can best be installed when groove (3) is vertically aligned.

If vacuum pump cannot be installed, crank engine if necessary at central bolt into correct position.

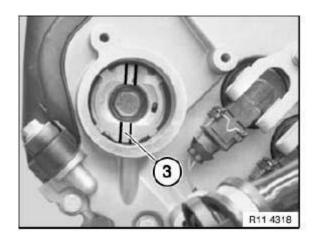


Fig. 735: Aligning Vacuum Pump Drive To Groove On Exhaust Camshaft Courtesy of BMW OF NORTH AMERICA, INC.

72 AIR PUMP, LINES AND CONTROL VALVES

11 72 000 REMOVING AND INSTALLING/REPLACING AIR PUMP (N62)

Remove upper section of intake filter housing.

Release retaining screws on coolant expansion tank.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Remove suction filter housing.

Remove raw air housing.

Unlock and disconnect pressure and suction lines (1).

Loosen screws (2).

Loosen screw (3).

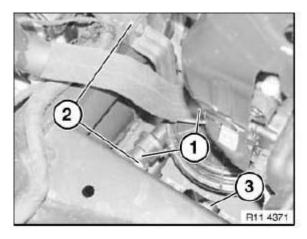


Fig. 736: Identifying Pressure And Suction Lines Screw Courtesy of BMW OF NORTH AMERICA, INC.


Remove front splash guard.

Remove trim panel at bottom right.

Unlock plug (1) and remove.

Unscrew bolt (3).

Remove air pump (2).

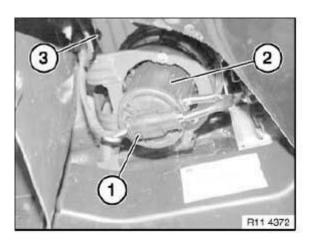

<u>Fig. 737: Identifying Air Pump Bolt And Plug</u> Courtesy of BMW OF NORTH AMERICA, INC.

Unscrew nuts.

Unclip plug (1).

Remove holder from air pump.

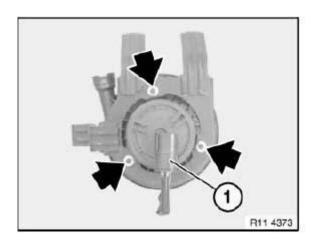


Fig. 738: Locating Holder From Air Pump And Plug Courtesy of BMW OF NORTH AMERICA, INC.

78 EMISSION CONTROL, OXYGEN SENSOR

11 78 530 REPLACING LEFT OXYGEN CONTROL SENSOR (N62/N62TU)

Special tools required:

- 11 7 030
- 11 9 150

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

(cylinder bank 5 to 8)


Necessary preliminary tasks:

- Switch off ignition
- Remove reinforcement plate

WARNING: Scalding hazard!
Only perform this task on an engine that has cooled down.

Unlock and detach plug connection (3).

Unclip control sensor cable.

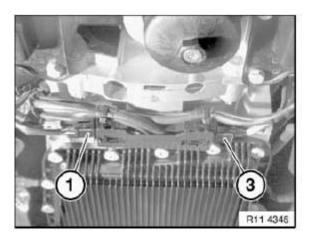

<u>Fig. 739: Identifying Plug Connection</u> Courtesy of BMW OF NORTH AMERICA, INC.

Release control sensor (4) with special tool 11 7 030 in conjunction with 11 9 150.

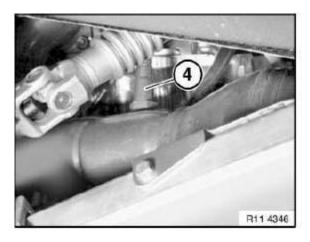


Fig. 740: Identifying Control Sensor

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Threads of new oxygen sensors are already coated with Never Seez Compound.

If the oxygen sensor is reused, only apply a thin and uniform coat of Never Seez Compound to thread.

Oxygen sensor section projecting into exhaust system branch must not be cleaned or come into contact with lubricant.

Installation:

When special tool 11 9 150 is used in conjunction with special tool 11 7 030, 47 Nm on the torque wrench dial corresponds to an actual tightening torque of 50 Nm.

Tighten down control sensor (4) with special tool 11 7 030 in conjunction with 11 9 150.

Tightening torque 11 78 1AZ . See **ENGINE - TIGHTENING TORQUES (N62TU V8)** .

Pay attention to cable routing of control sensor.

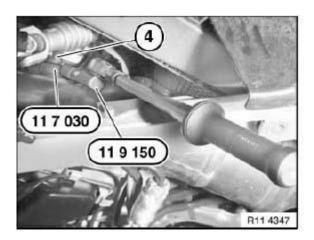


Fig. 741: Identifying Special Tool (11 7 030) And (11 9 150) Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Read out fault memory of control unit of Digital Motor Electronics (DME).

Check stored fault messages.

Rectify faults.

Now clear the fault memory.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

11 78 533 REPLACING RIGHT OXYGEN CONTROL SENSOR (N62/N62TU)

Special tools required:

• 11 7 030

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Switch off ignition.
- Remove reinforcement plate

WARNING: Scalding hazard!
Only perform this task on an engine that has cooled down.

Release plug connector (1) and pull off.

Unclip control sensor cable.

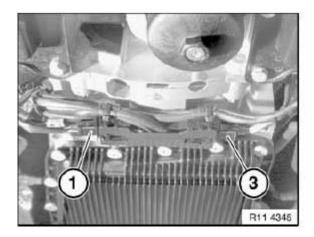


Fig. 742: Identifying Plug Connection Courtesy of BMW OF NORTH AMERICA, INC.

Release control sensor (2) with special tool 11 7 030.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

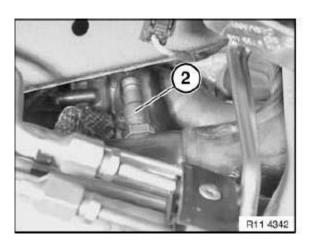


Fig. 743: Identifying Control Sensor With Special Tool Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Threads of new oxygen sensors are already coated with Never Seez Compound.

If the oxygen sensor is reused, only apply a thin and uniform coat of Never Seez Compound to thread.

Oxygen sensor section projecting into exhaust system branch must not be cleaned or come into contact with lubricant.

Installation:

Tighten down control sensor (2) with special tool 11 7 030.

Tightening torque 11 78 1AZ. See ENGINE - TIGHTENING TORQUES (N62TU V8).

Pay attention to cable routing of control sensor.

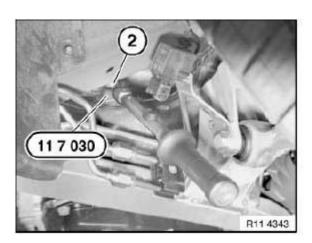


Fig. 744: Identifying Special Tool (11 7 030)

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Different heat shields!

To prevent fraying, make sure that wiring harness (1) is correctly laid on heat shield (2).

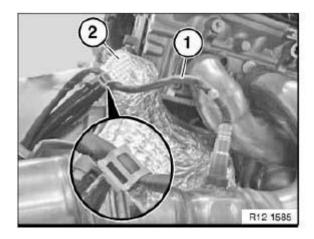


Fig. 745: Identifying Heat Shields And Wiring Harness Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Read out fault memory of control unit of Digital Motor Electronics (DME).

Check stored fault messages.

Rectify faults.

Now clear the fault memory.

11 78 540 REPLACING LEFT OXYGEN MONITOR SENSOR (N62/N62TU)

Special tools required:

• 11 7 030

(cylinder bank 5 to 8)

Necessary preliminary tasks:

- Switch off ignition.
- Remove rear underbody protection

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

WARNING: Scalding hazard! Only perform this task on an engine that has cooled down.

Unlock and detach plug connection (1) for monitor sensor (2).

Unclip monitor sensor cable.

Release monitor sensor (2) with special tool 11 7 030.

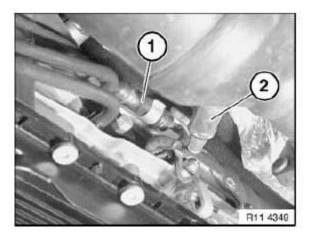


Fig. 746: Identifying Plug Connection And Monitor Sensor Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Threads of new oxygen sensors are already coated with Never Seez Compound.

If the oxygen sensor is reused, only apply a thin and uniform coat of Never Seez Compound to thread.

Oxygen sensor section projecting into exhaust system branch must not be cleaned or come into contact with lubricant.

Installation:

Tighten down monitor sensor (2) with special tool 11 7 030.

Tightening torque 11 78 1AZ. See **ENGINE - TIGHTENING TORQUES (N62TU V8)**.

Pay attention to cable routing of monitor sensor.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

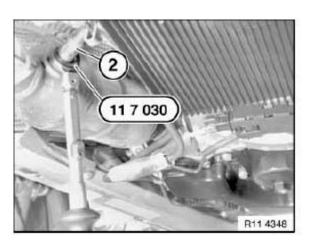


Fig. 747: Identifying Special Tool (11 7 030) Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Read out fault memory of control unit of Digital Motor Electronics (DME).

Check stored fault messages.

Rectify faults.

Now clear the fault memory.

11 78 543 REPLACING RIGHT OXYGEN MONITOR SENSOR (N62/N62TU)

Special tools required:

• 11 7 030

(cylinder bank 1 to 4)

Necessary preliminary tasks:

- Switch off ignition
- Remove rear underbody protection.

WARNING: Scalding hazard! Only perform this task on an engine that has cooled down.

Unlock and detach plug connection (1) for monitor sensor (2).

Unclip monitor sensor cable.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

Release monitor sensor (2) with special tool 11 7 030.

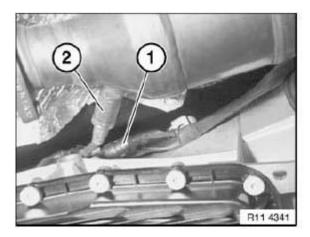


Fig. 748: Identifying Monitor Sensor And Plug Connection Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Threads of new oxygen sensors are already coated with Never Seez Compound.

If the oxygen sensor is reused, only apply a thin and uniform coat of Never Seez Compound to thread.

Oxygen sensor section projecting into exhaust system branch must not be cleaned or come into contact with lubricant.

Installation:

Tighten down monitor sensor (2) with special tool 11 7 030.

Tightening torque 11 78 1AZ . See ENGINE - TIGHTENING TORQUES (N62TU V8) .

Pay attention to cable routing of monitor sensor.

ENGINE Engine - Repair Instructions - X5 (N62TU V8)

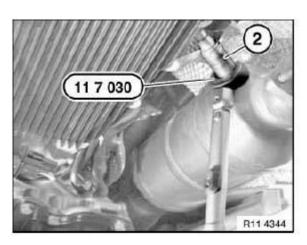


Fig. 749: Identifying Special Tool (11 7 030) Courtesy of BMW OF NORTH AMERICA, INC.

Installation:

Read out fault memory of control unit of Digital Motor Electronics (DME).

Check stored fault messages.

Rectify faults.

Now clear the fault memory.